

INSTALLATION NOTES:

1. ONE (1) INSTALLATION ANCHOR CLIP IS REQUIRED AT EACH ANCHOR LOCATION SHOWN, UNLESS OTHERWISE STATED.
2. INSTALL INDIVIDUAL INSTALLATION ANCHORS WITHIN A TOLERANCE OF ±1/2 INCH OF THE DEPICTED LOCATION IN THE ANCHOR LAYOUT DETAIL (I.E., WITHOUT CONSIDERATION OF TOLERANCES). TOLERANCES ARE NOT CUMULATIVE FROM ONE INSTALLATION ANCHOR TO THE NEXT.
3. **INSTALLATION CLIP:** FOR INSTALLATION INTO 2X BUCK USE TWO (2) #8 WOOD SCREWS PER INSTALLATION CLIP OF SUFFICIENT LENGTH TO ACHIEVE 1 1/2 INCH MINIMUM EMBEDMENT INTO WOOD SUBSTRATE.
4. **INSTALLATION CLIP:** FOR INSTALLATION THROUGH 1X BUCK TO CONCRETE/MASONRY, OR DIRECTLY INTO CONCRETE/MASONRY, USE ONE (1) 3/16 INCH ITW TAPCON PER INSTALLATION CLIP OF SUFFICIENT LENGTH TO ACHIEVE 1 1/4 INCH MINIMUM EMBEDMENT.
5. **INSTALLATION CLIP:** FOR INSTALLATION THROUGH METAL STUD USE TWO (2) #8 SELF-TAPPING SCREWS PER INSTALLATION CLIP OF SUFFICIENT LENGTH TO ACHIEVE 3 THREADS MINIMUM PENETRATION BEYOND METAL FRAME SUBSTRATE.
6. **THROUGH FRAME:** FOR INSTALLATION INTO 2X BUCK USE #10 WOOD SCREWS OF SUFFICIENT LENGTH TO ACHIEVE 1 1/2 INCH MINIMUM EMBEDMENT INTO WOOD SUBSTRATE.
7. **THROUGH FRAME:** FOR INSTALLATION THROUGH 1X BUCK TO CONCRETE/MASONRY, OR DIRECTLY INTO CONCRETE/MASONRY, USE ONE (1) 3/16 INCH ITW TAPCON OF SUFFICIENT LENGTH TO ACHIEVE 1 1/4 INCH MINIMUM EMBEDMENT.
8. **THROUGH FRAME:** FOR INSTALLATION THROUGH METAL STUD USE #10 SELF-TAPPING SCREWS OF SUFFICIENT LENGTH TO ACHIEVE 3 THREADS MINIMUM PENETRATION BEYOND METAL FRAME SUBSTRATE.
9. MINIMUM EMBEDMENT AND EDGE DISTANCE EXCLUDE WALL FINISHES, INCLUDING BUT NOT LIMITED TO STUCCO, FOAM, BRICK VENEER, AND SIDING.
10. INSTALLATION ANCHORS AND ASSOCIATED HARDWARE MUST BE MADE OF CORROSION RESISTANT MATERIAL OR HAVE A CORROSION RESISTANT COATING.
11. FOR HOLLOW BLOCK AND GROUT FILLED BLOCK, DO NOT INSTALL INSTALLATION ANCHORS INTO MORTAR JOINTS. EDGE DISTANCE IS MEASURED FROM FREE EDGE OF BLOCK OR EDGE OF MORTAR JOINT INTO FACE SHELL OF BLOCK.
12. INSTALLATION ANCHORS SHALL BE INSTALLED IN ACCORDANCE WITH ANCHOR MANUFACTURER'S INSTALLATION INSTRUCTIONS, AND ANCHORS SHALL NOT BE USED IN SUBSTRATES WITH STRENGTHS LESS THAN THE MINIMUM STRENGTH SPECIFIED BY THE ANCHOR MANUFACTURER.
13. INSTALLATION ANCHOR CAPACITIES FOR PRODUCTS HEREIN ARE BASED ON SUBSTRATE MATERIALS WITH THE FOLLOWING PROPERTIES:

A. WOOD - MINIMUM SPECIFIC GRAVITY OF 0.55.

B. CONCRETE -MINIMUM COMPRESSIVE STRENGTH OF 3000 PSI.

C. GROUT-FILLED CMU- UNIT STRENGTH CONFORMS TO ASTM C-90 WITH MINIMUM COMPRESSIVE STRENGTH OF 2000 PSI AND GROUT CONFORMS TO ASTM C 476, MINIMUM GROUT COMPRESSIVE STRENGTH OF 2000 PSI.

D. HOLLOW BLOCK CMU - UNIT STRENGTH CONFORMS TO ASTM C-90 WITH MINIMUM COMPRESSIVE STRENGTH OF 2000 PSI.

E. STEEL - MINIMUM YIELD STRENGTH OF 33 KSI. MINIMUM WALL THICKNESS OF 33 MILS.

F.ALUMINUM - MINIMUM WALL THICKNESS OF 1⁄8". 6063-T5 ALLOY OR BETTER.

ANDERSEN CORPORATION

400 SERIES PATIO DOOR SIDELITE AND TRANSOM

(NON-HVHZ)(NON-IMPACT)

GENERAL NOTES:

1. THE PRODUCT SHOWN HEREIN IS DESIGNED AND MANUFACTURED TO COMPLY WITH THE CURRENT FLORIDA BUILDING CODE (FBC), **EXCLUDING** HVHZ. THE PRODUCT HAS BEEN EVALUATED ACCORDING TO THE FOLLOWING:

AAMA/WDMA/CSA 101/I.S.2/A440-17
2. ADEQUACY OF THE EXISTING STRUCTURAL CONCRETE/MASONRY, 2X AND METAL STUD FRAMING AS A MAIN WIND FORCE RESISTING SYSTEM CAPABLE OF WITHSTANDING AND TRANSFERRING APPLIED PRODUCT LOADS TO THE FOUNDATION IS THE RESPONSIBILITY OF THE ENGINEER OR ARCHITECT OF RECORD FOR THE PROJECT OF INSTALLATION.
3. 1X AND 2X BUCKS (WHEN USED) SHALL BE DESIGNED AND ANCHORED TO PROPERLY TRANSFER ALL LOADS TO THE STRUCTURE. BUCK DESIGN AND INSTALLATION IS THE RESPONSIBILITY OF THE ENGINEER OR ARCHITECT OF RECORD FOR THE PROJECT OF INSTALLATION.
4. THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS FOR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT.
5. APPROVED IMPACT PROTECTIVE SYSTEM **IS REQUIRED** TO PROTECT THIS PRODUCT IN AREAS REQUIRING IMPACT RESISTANCE.
6. WINDOW MATERIAL: PONDEROSA PINE (SG = 0.40), FIBERGLASS, AND ALUMINUM
7. GLASS SHALL MEET THE REQUIREMENTS OF ASTM E1300 GLASS CHARTS. SEE SHEET 8 FOR GLAZING DETAIL.
8. DESIGNATION "O" STANDS FOR THE FOLLOWING:

O: FIXED PANEL

TABLE OF CONTENTS	
SHEET	SHEET DESCRIPTION
1	GENERAL & INSTALLATION NOTES
2	ELEVATIONS & ANCHOR LAYOUTS
3	VERTICAL SECTIONS (SIDELITE)
4	VERTICAL SECTIONS (TRANSOM)
5	HORIZONTAL SECTIONS (SIDELITE)
6	HORIZONTAL SECTIONS (TRANSOM)
7	COMPONENTS & BILL OF MATERIALS
8	COMPONENTS (CONTINUED) & GLAZING DETAIL
9	SIDELITE MULL TABLE (ONE-WAY)
10	TRANSOM MULL TABLE (TWO-WAY)
11	MULLION DETAILS

DESIGN PRESSURE RATING		
SIZE	DESIGN PRESSURE	MISSILE IMPACT RATING
18 7⁄8" X 95 1⁄2" (SIDELITE)	+65.0 / -65.0 PSF	NON-IMPACT
71 3⁄4" X 21 7⁄8" (TRANSOM)	+65.0 / -65.0 PSF	NON-IMPACT



100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)(NON-IMPACT)
GENERAL & INSTALLATION NOTES


PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954)399-8478
FAX: (954)744-4738
WEB: www.buildingdrops.com

BD

BUILDING DROPS

REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23
THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT		

Digitally signed by Hermes F. Norero, P.E.
Reason: I am approving this document
Date: 2023.08.11 20:54:24 -0400

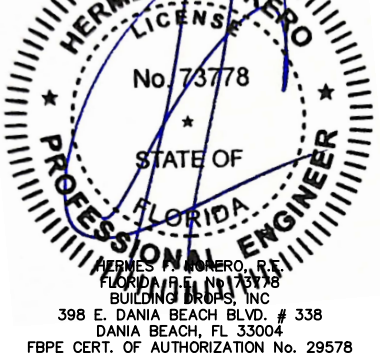

FL #:

FL14431

DATE:

08.09.17

DWG. BY:

HR

CHK. BY:

HFN

SCALE:

NTS


DWG. #:

AWD121


SHEET:

1

OF 11

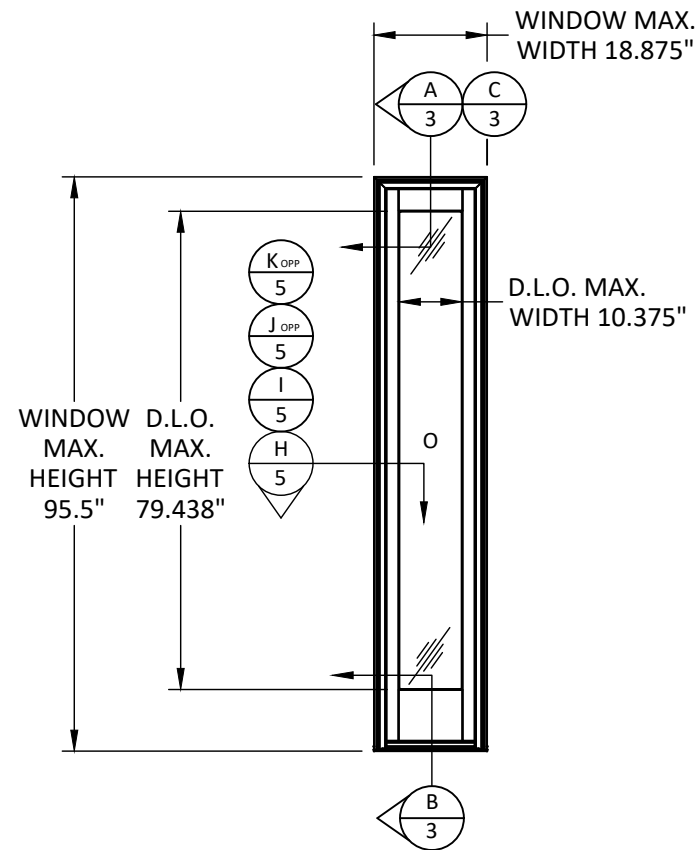


**ELEVATION
(SIDELITE)**

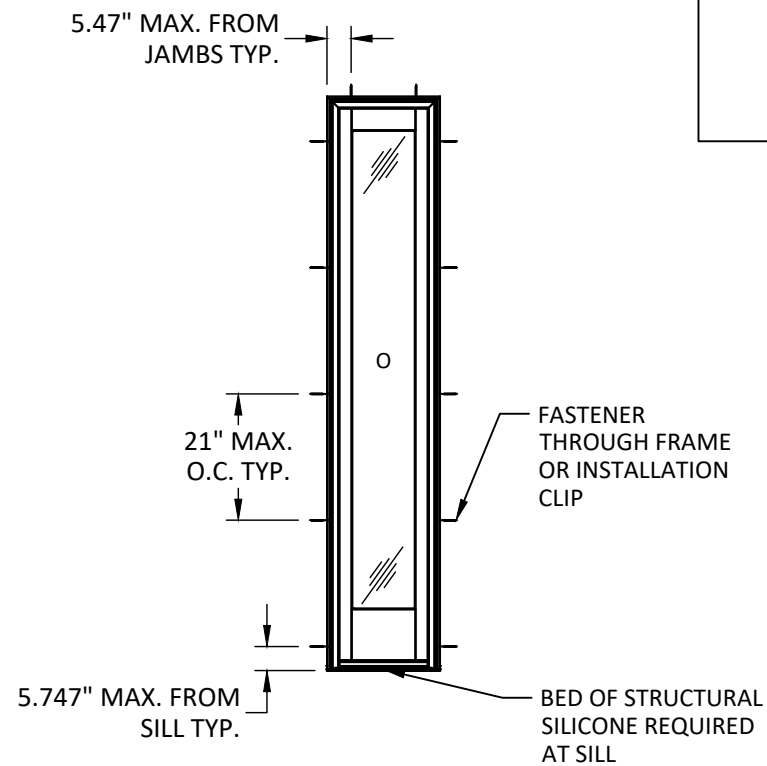



**ANCHOR LAYOUT
(SIDELITE)**

NOTES:

1. FOR 2X WOOD INSTALLATION, USE (2) #8 WOOD SCREWS PER CLIP OR (1) #10 WOOD SCREW PER LOCATION THROUGH FRAME.
2. FOR CONCRETE/MASONRY INSTALLATION, USE (1) $\frac{3}{16}$ " ITW TAPCON PER CLIP OR (1) $\frac{3}{16}$ " ITW TAPCON PER LOCATION THROUGH FRAME.
3. FOR METAL STUD INSTALLATION, USE (2) #8 SELF-TAPPING ANCHORS PER CLIP OR (1) #10 SELF-TAPPING ANCHOR PER LOCATION THROUGH FRAME.
4. ACCEPTABLE STRUCTURAL SILICONES FOR SIDELITE SILL ARE AS FOLLOWS:
 - TRENCO SPECTRUM 2
 - DOW 795
 - PECORA 895
 - GE SILPRUF SCS-2000

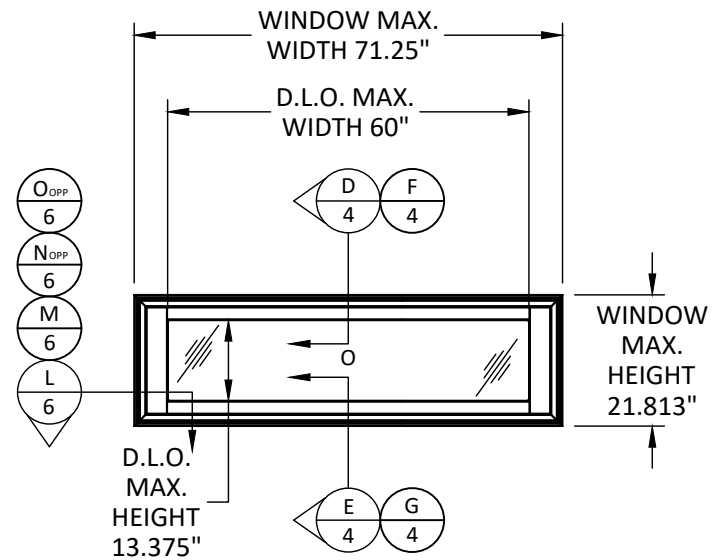

**ELEVATIONS
(TRANSOM)**

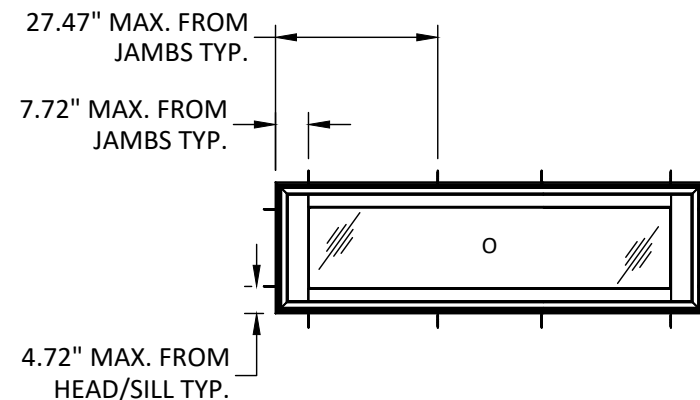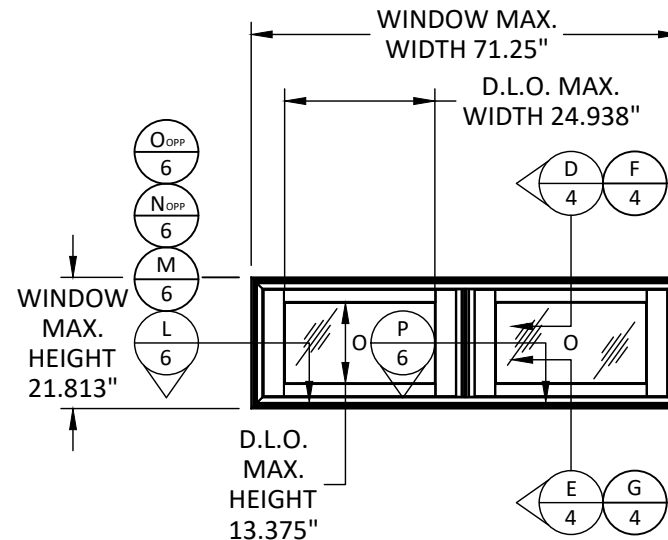

**ANCHOR LAYOUT
(TRANSOM)**



ANDERSEN
WINDOWS & DOORS

100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485


TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
ELEVATIONS & ANCHOR LAYOUTS

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT

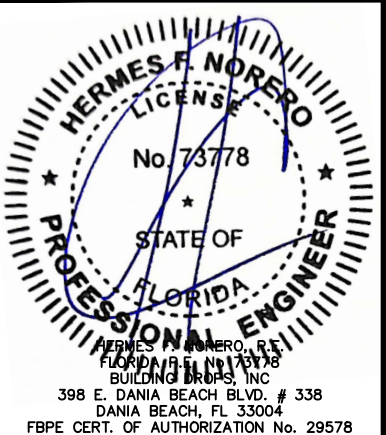

FL #:

FL14431

DATE: **08.09.17**

DWG. BY:
HR

CHK. BY:
HFN




SCALE: **NTS**

DWG. #: **AWD121**

SHEET:

2

s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg 6/16/2023 12:10 PM

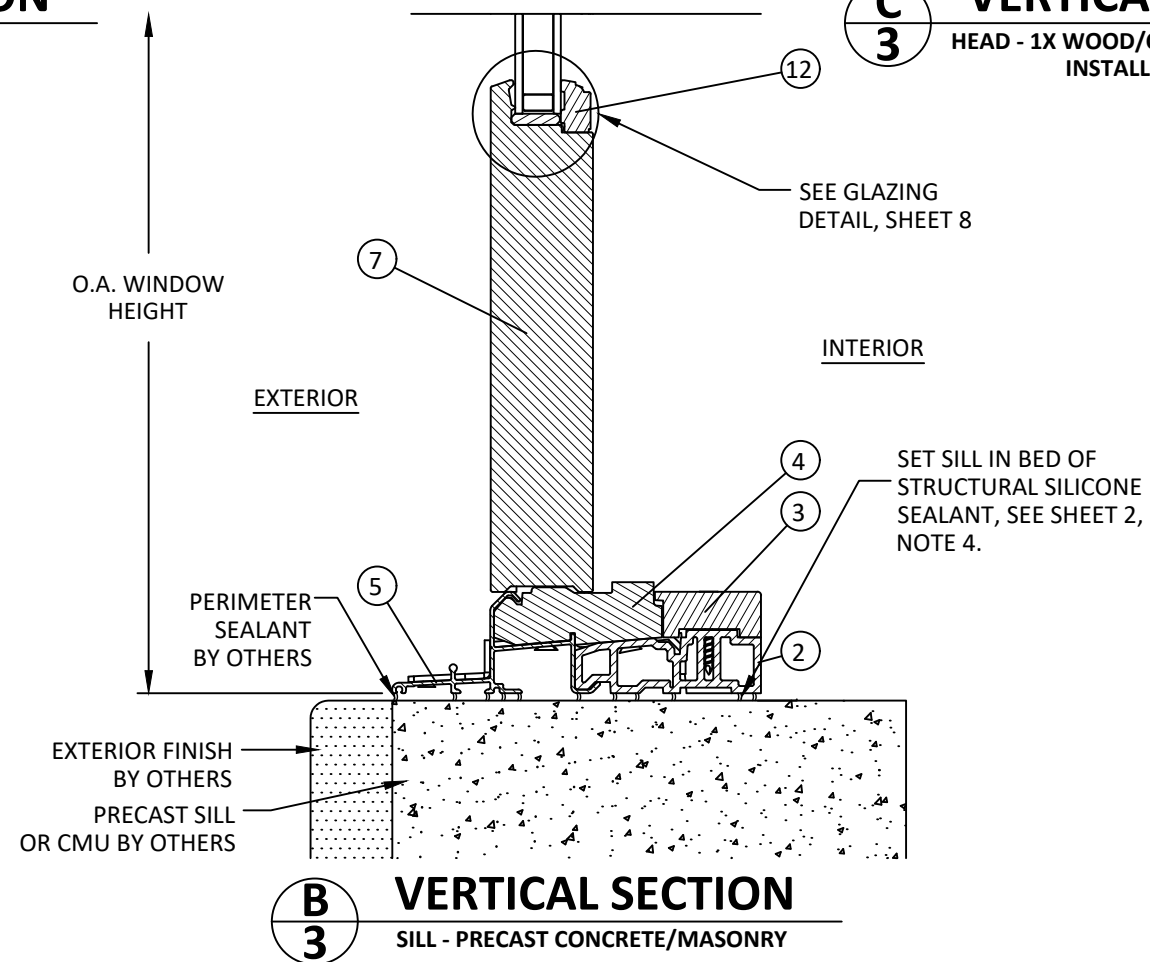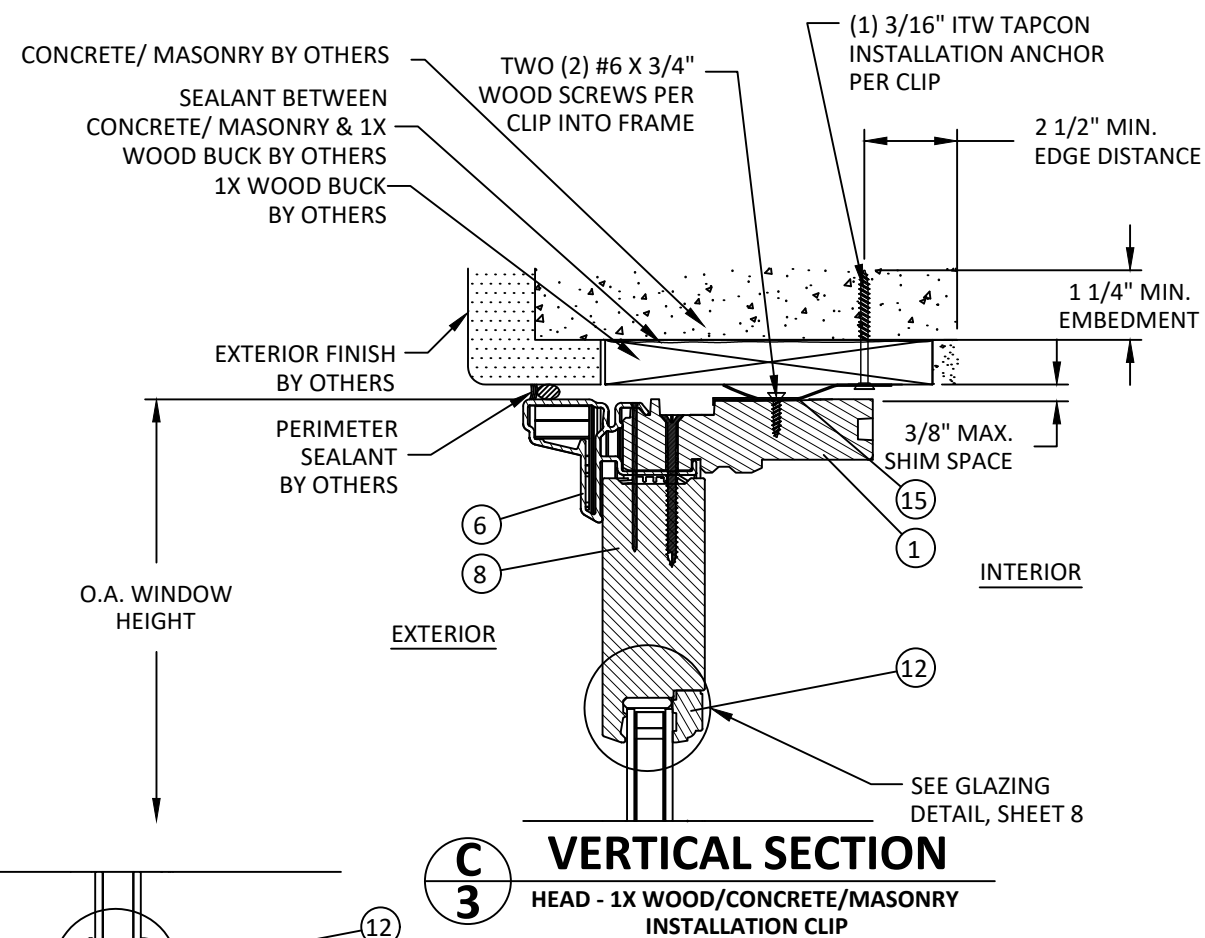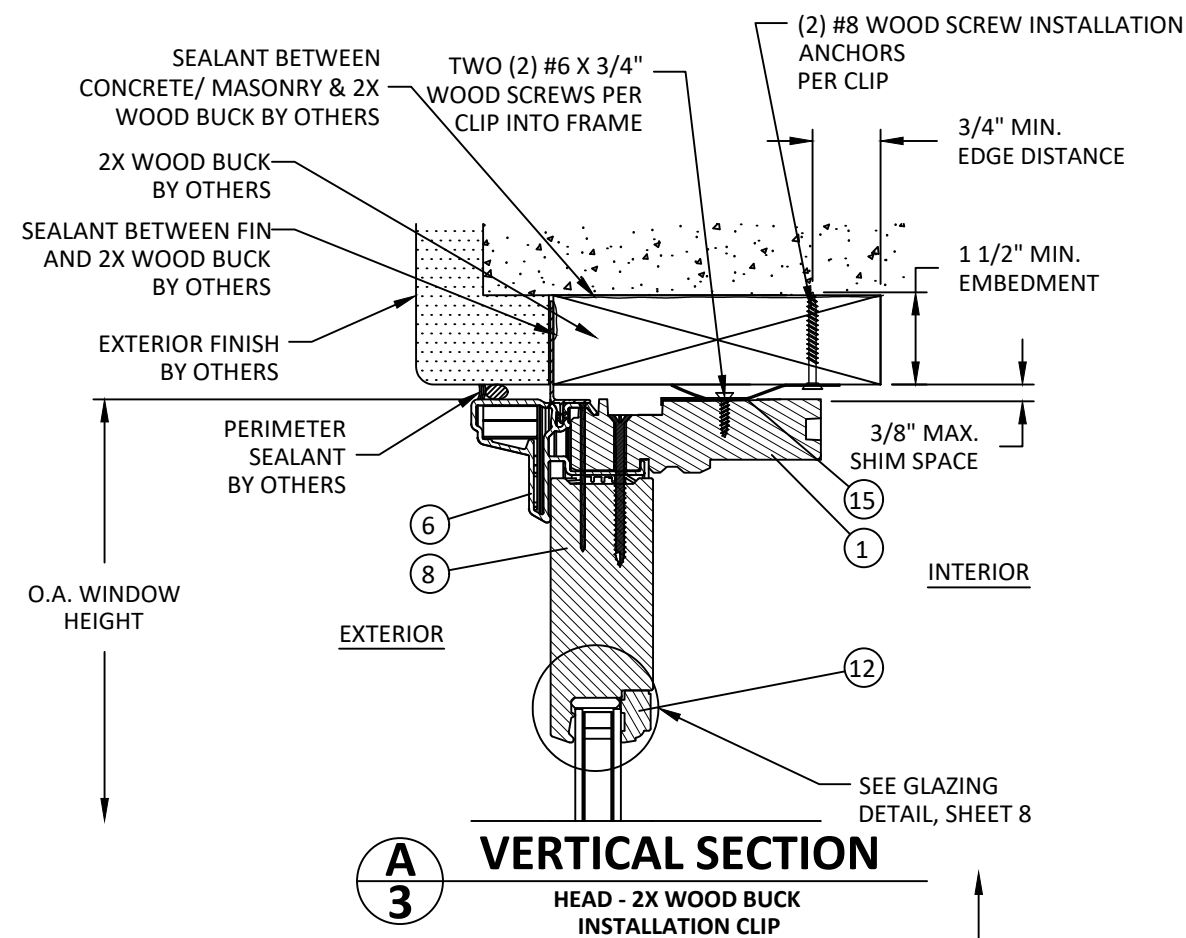

100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
VERTICAL SECTIONS (SIDELITE)

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 474-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT




FL #:	FL14431
DATE:	08.09.17
DWG. BY:	CHK. BY:
HR	HFN
SCALE:	NTS
DWG. #:	AWD121
SHEET:	


3

6/16/2023 12:10 PM


s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg

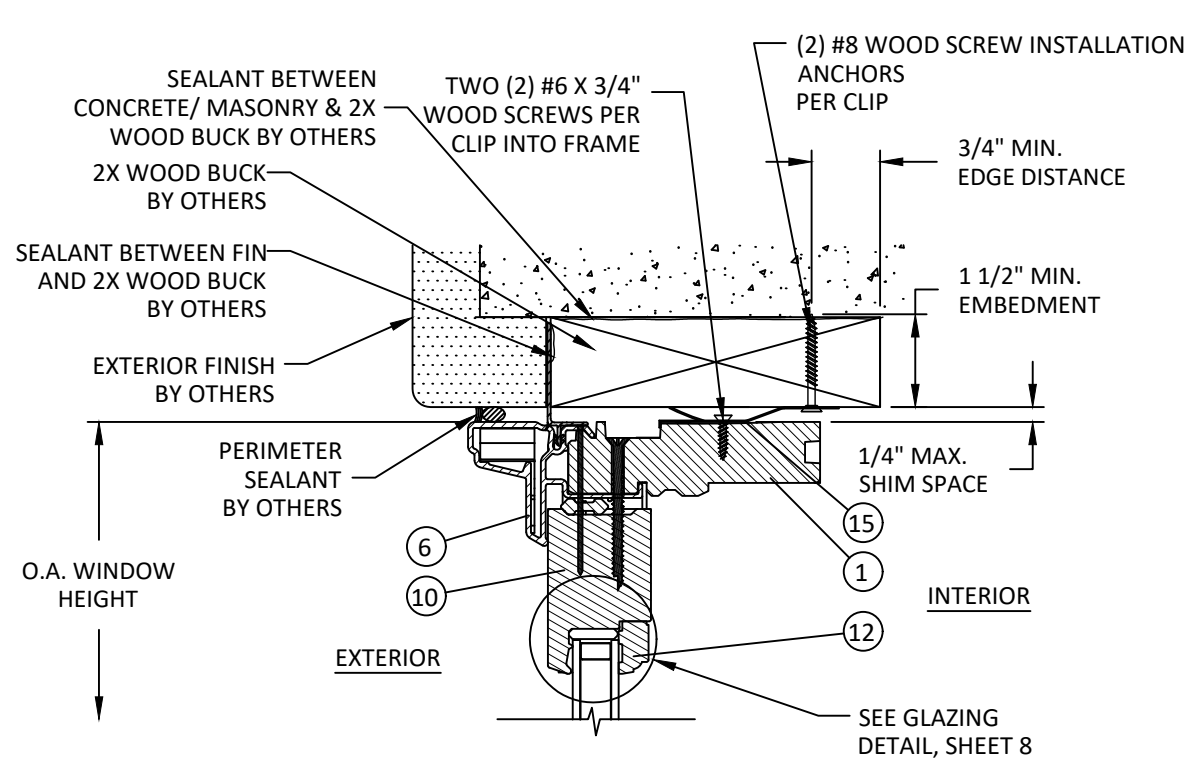


D
4 **VERTICAL SECTION**
HEAD - 2X WOOD BUCK
INSTALLATION CLIP

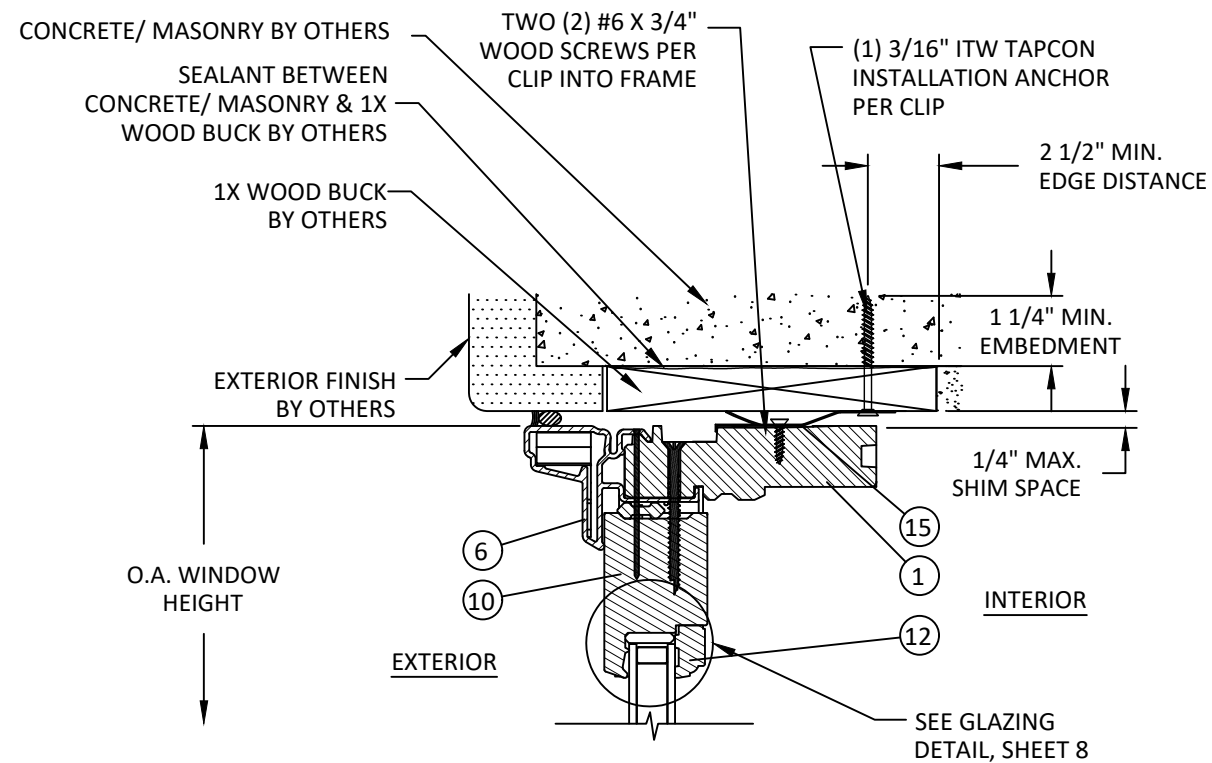

F
4 **VERTICAL SECTION**
HEAD - 1X WOOD/CONCRETE/MASONRY
INSTALLATION CLIP

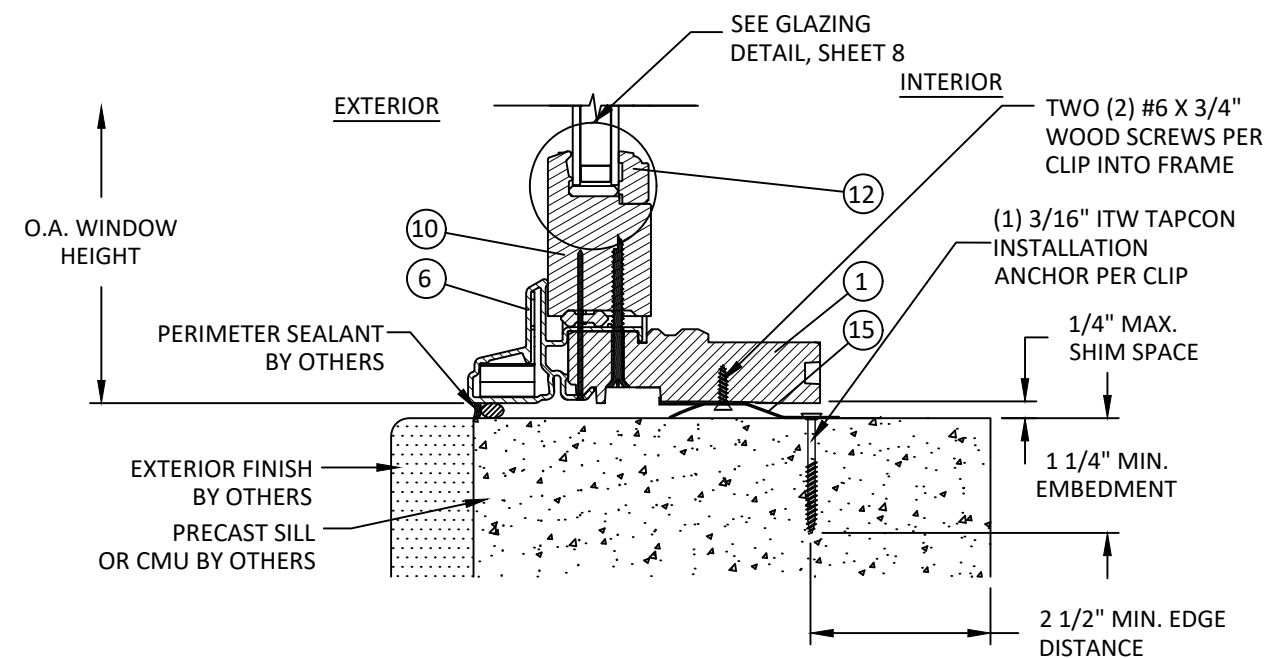

E
4 **VERTICAL SECTION**
SILL - PRECAST CONCRETE/MASONRY
INSTALLATION CLIP

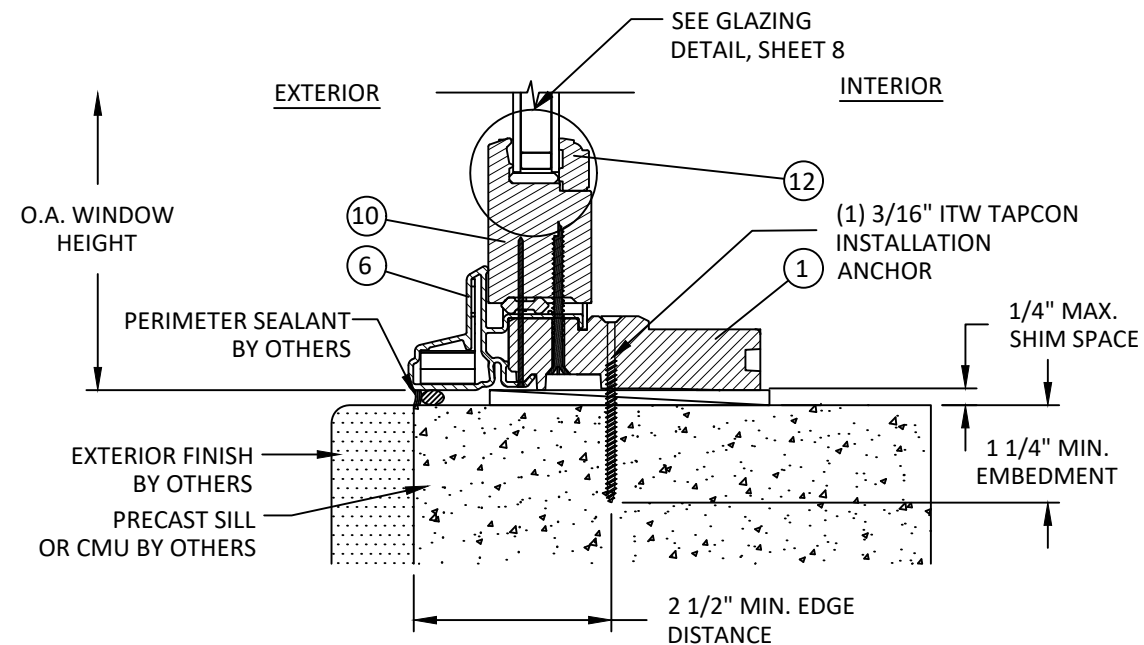

G
4 **VERTICAL SECTION**
SILL - PRECAST CONCRETE
THROUGH FRAME



ANDERSEN
WINDOWS & DOORS

100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
VERTICAL SECTIONS (TRANSOM)

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN
ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS
OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION
TO DEVIATE
FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED
ENGINEER OR ARCHITECT SHALL
PREPARE SITE SPECIFIC DOCUMENTS FOR USE
WITH THIS DOCUMENT



FL #:

FL14431

DATE: **08.09.17**

DWG. BY:
HR

CHK. BY:
HFN

SCALE: **NTS**

DWG. #: **AWD121**


SHEET:

4


OF 11

6/16/2023 12:10 PM


s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg

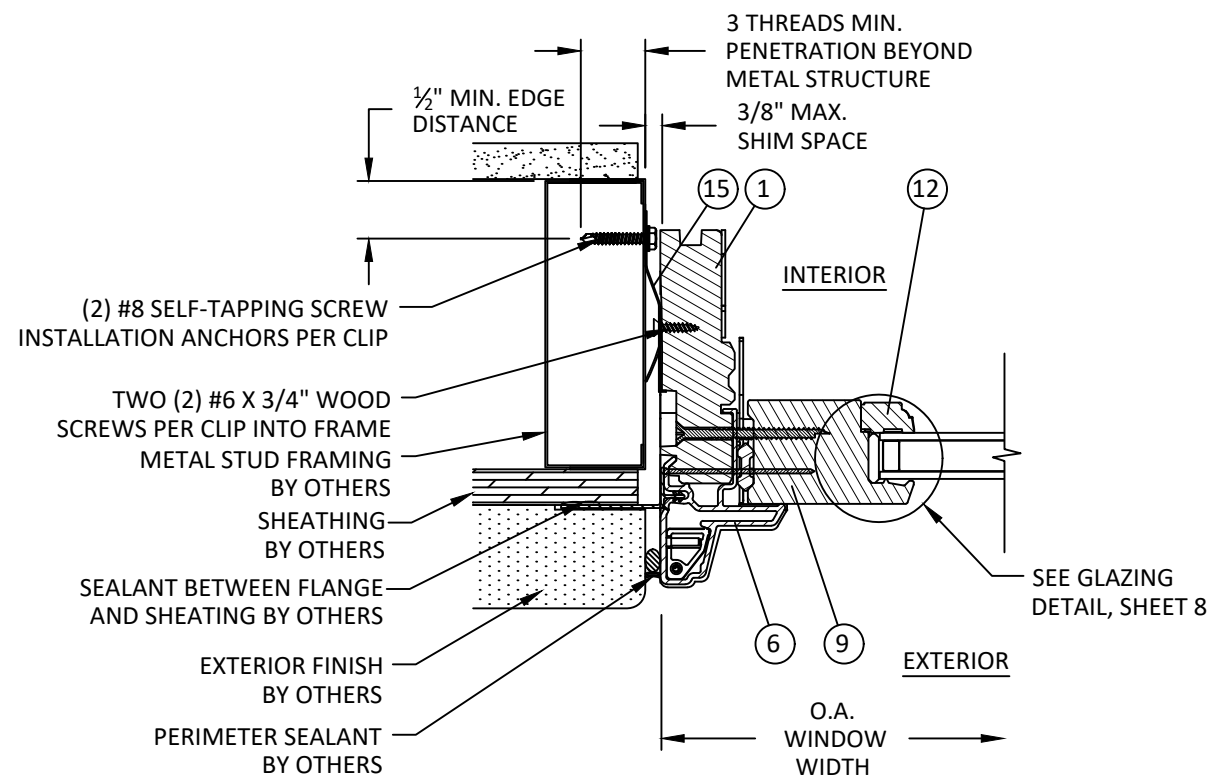


H
5 **HORIZONTAL SECTION**
JAMB - METAL STUD FRAME
INSTALLATION CLIP

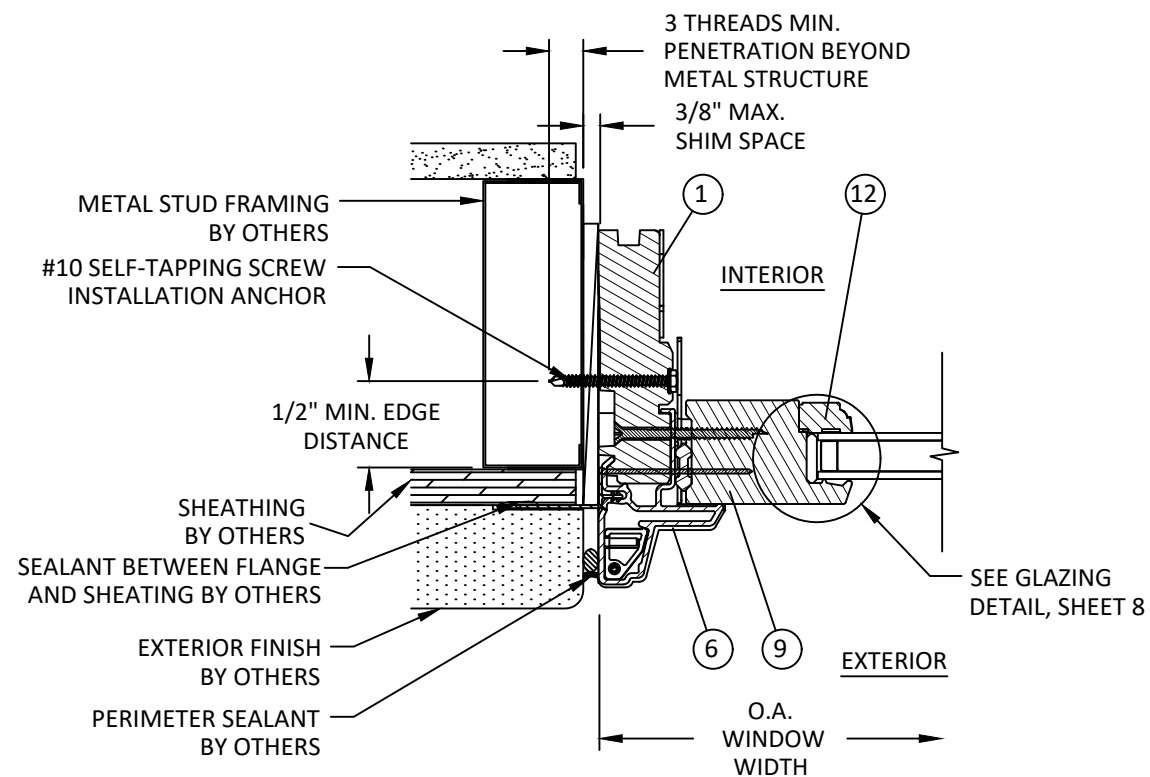

I
5 **HORIZONTAL SECTION**
JAMB - METAL STUD FRAME
THROUGH FRAME

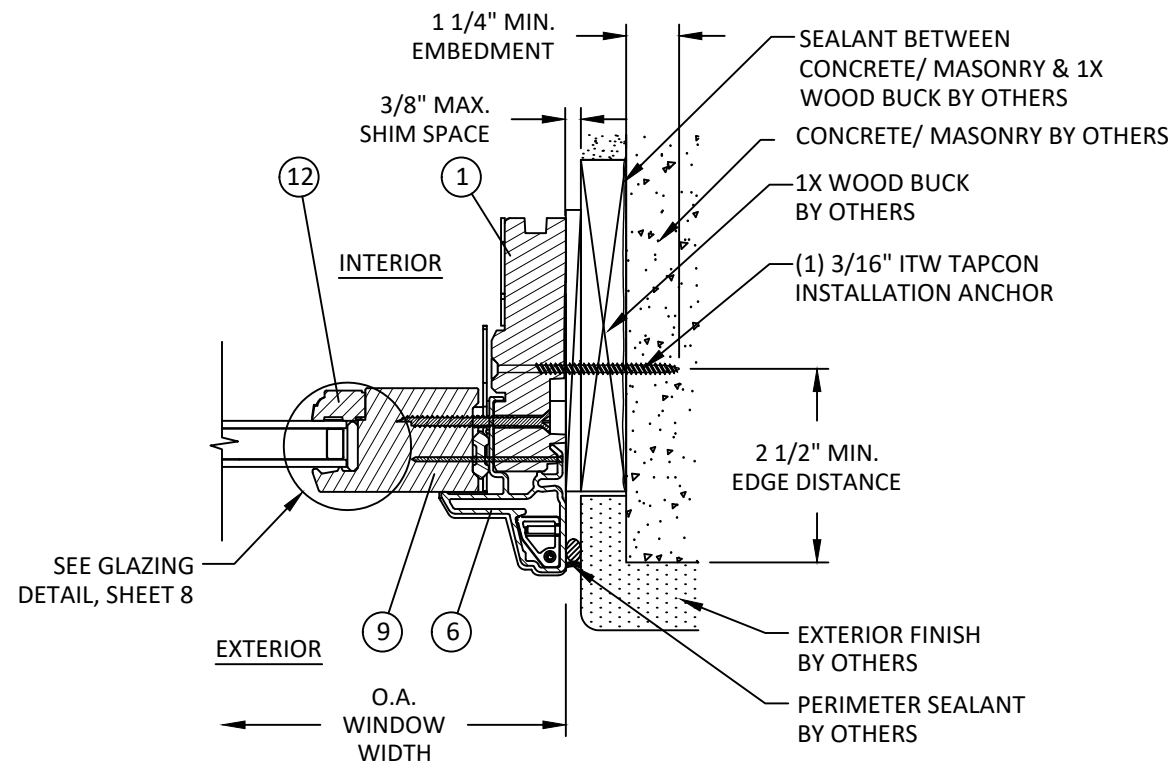

J
5 **HORIZONTAL SECTION**
JAMB - 1X WOOD/CONCRETE/MASONRY
THROUGH FRAME

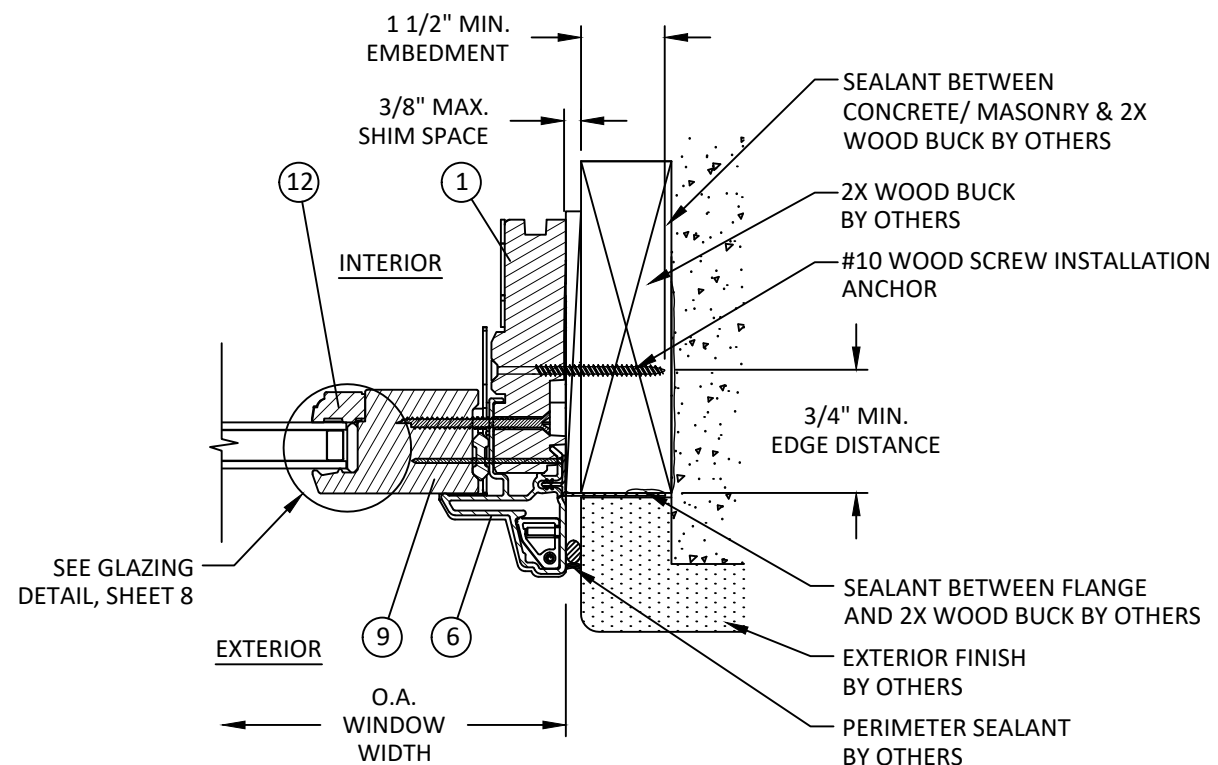

K
5 **HORIZONTAL SECTION**
JAMB - 2X WOOD BUCK
THROUGH FRAME



ANDERSEN
WINDOWS & DOORS

100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
HORIZONTAL SECTIONS (SIDELITE)

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT



FL #:
FL14431

DATE: **08.09.17**

DWG. BY: **HR** CHK. BY: **HFN**

SCALE: **NTS**

DWG. #: **AWD121**


SHEET:

5


OF 11

6/16/2023 12:10 PM


s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg

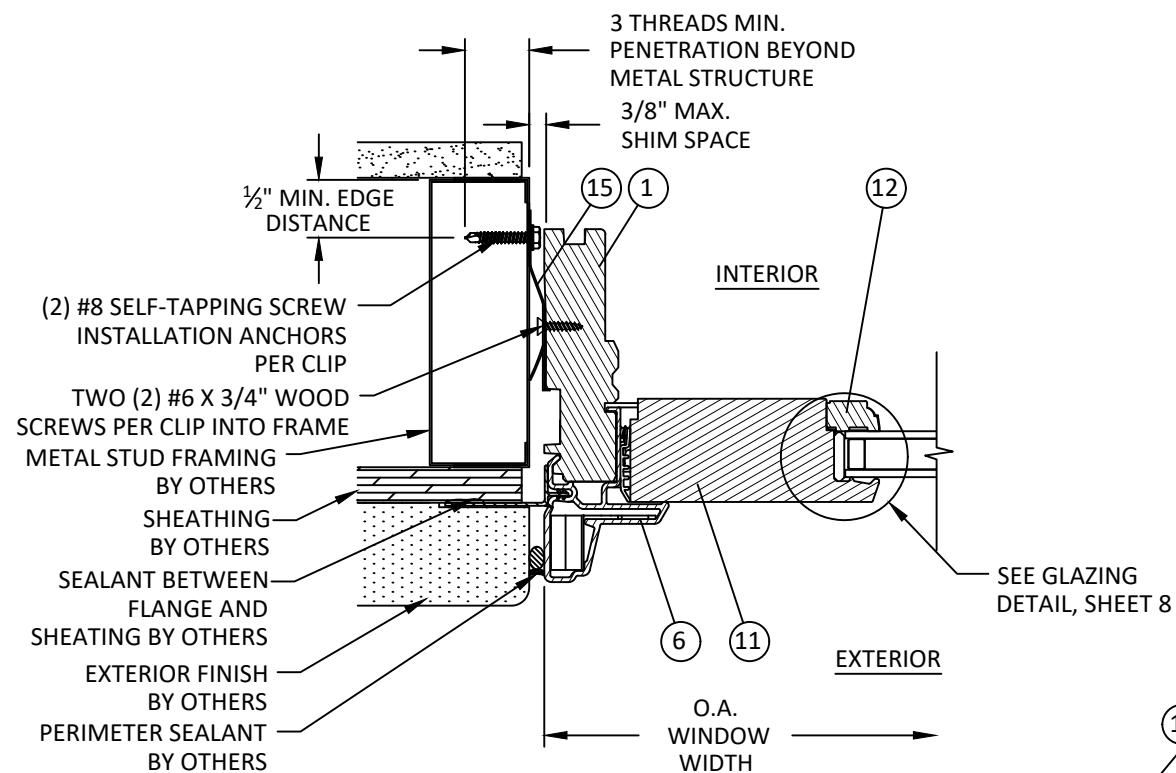


L
6 **HORIZONTAL SECTION**
JAMB - METAL STUD FRAME
INSTALLATION CLIP

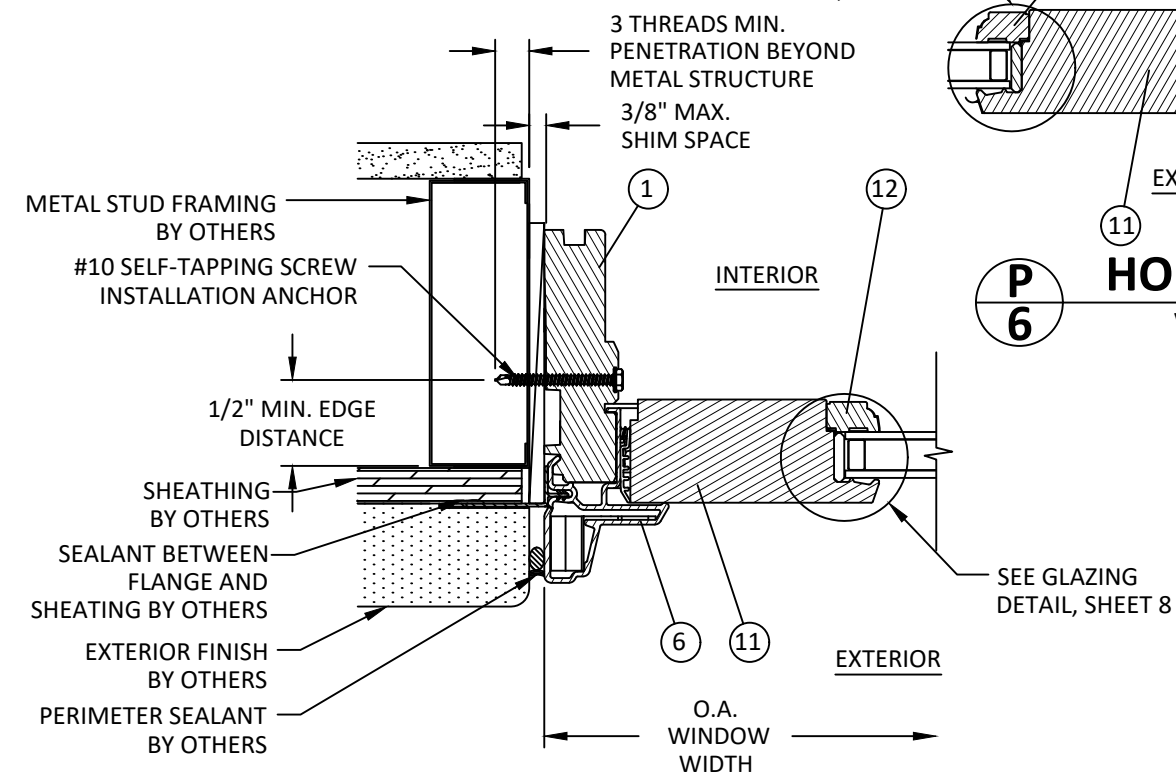


M
6 **HORIZONTAL SECTION**
JAMB - METAL STUD FRAME
THROUGH FRAME

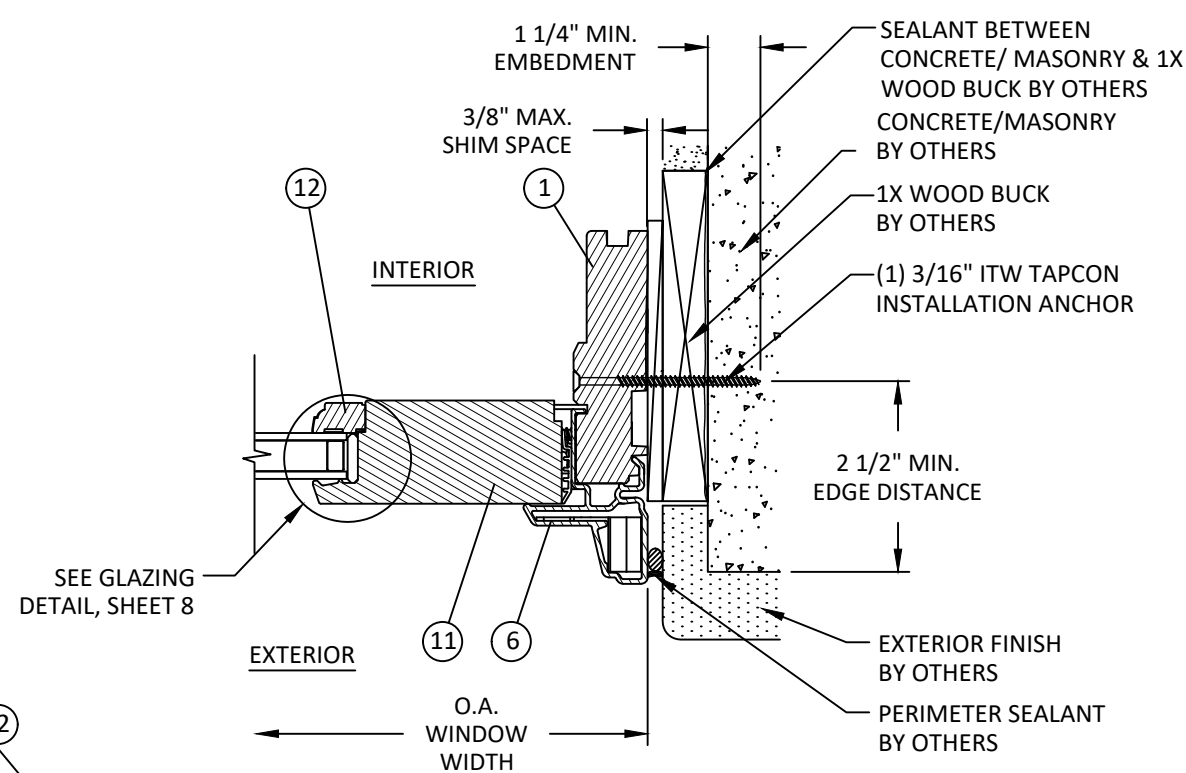

N
6 **HORIZONTAL SECTION**
JAMB - 1X WOOD/CONCRETE/MASONRY
THROUGH FRAME

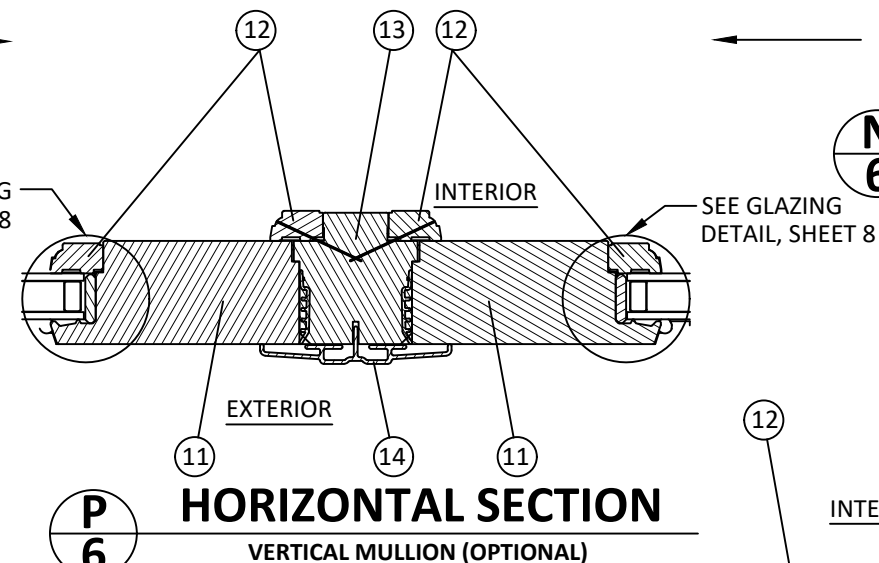

P
6 **HORIZONTAL SECTION**
VERTICAL MULLION (OPTIONAL)

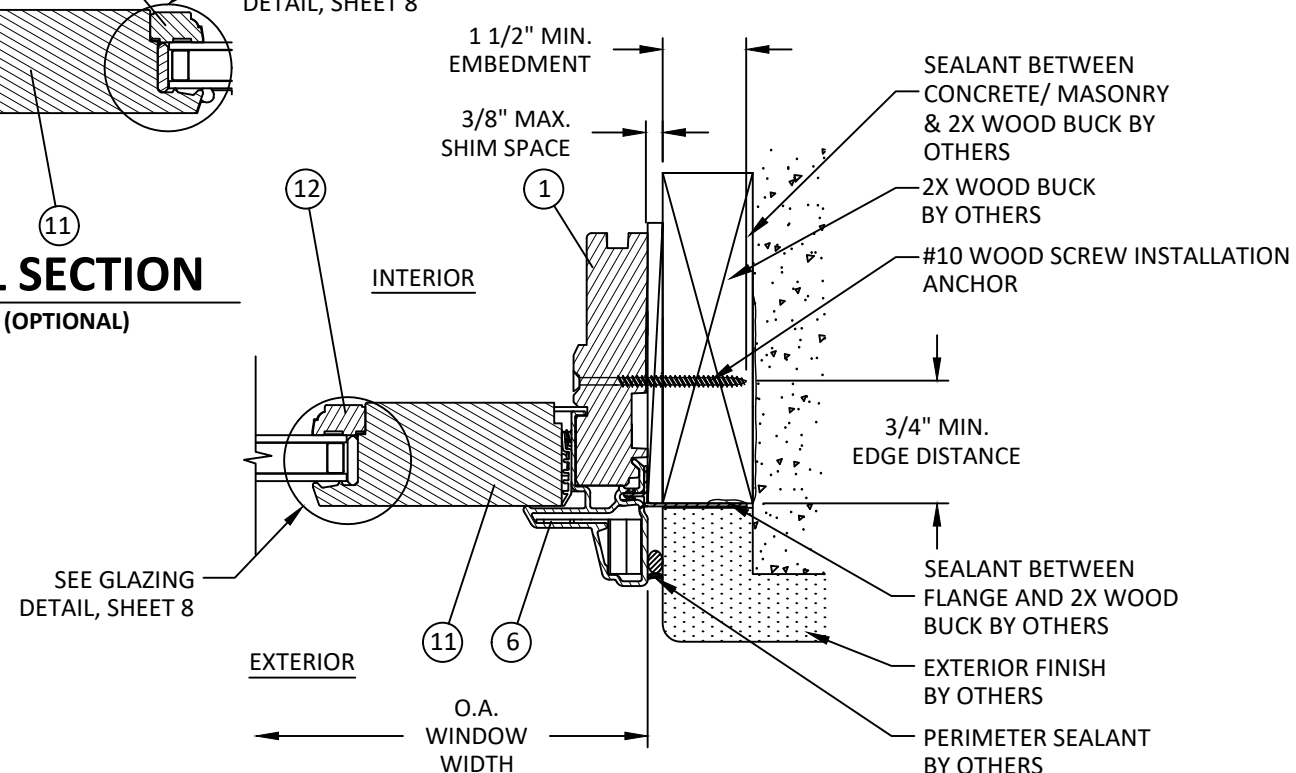

O
6 **HORIZONTAL SECTION**
JAMB - 2X WOOD BUCK
THROUGH FRAME



100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485


TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
HORIZONTAL SECTIONS (TRANSOM)

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN
ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS
OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION
TO DEVIATE
FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED
ENGINEER OR ARCHITECT SHALL
PREPARE SITE SPECIFIC DOCUMENTS FOR USE
WITH THIS DOCUMENT

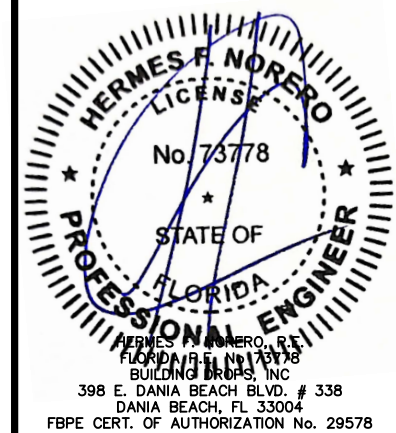


FL #:	FL14431
DATE:	08.09.17
DWG. BY:	HR
CHK. BY:	HFN
SCALE:	NTS
DWG. #:	AWD121
SHEET:	6


6/16/2023 12:10 PM
s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg

BILL OF MATERIALS			
NO	DESCRIPTION	MATERIAL	MANUFACTURER
1	FRAME	WOOD	ANDERSEN
2	SIDELITE SILL	PVC	ANDERSEN
3	SIDELITE SILL STOP	WOOD	ANDERSEN
4	SIDELITE FRAME	WOOD	ANDERSEN
5	EXT. THRESHOLD CLADDING	ALUMINUM	ANDERSEN
6	FRAME CLADDING	FIBERGLASS	ANDERSEN
7	SIDELITE BOTTOM RAIL	WOOD	ANDERSEN
8	SIDELITE TOP RAIL	WOOD	ANDERSEN
9	SIDELITE STILE	WOOD	ANDERSEN
10	TRANSOM TOP/BOTTOM RAIL	WOOD	ANDERSEN
11	TRANSOM STILE	WOOD	ANDERSEN
12	GLAZING BEAD	WOOD	ANDERSEN
13	TRANSOM MULLION	WOOD	ANDERSEN
14	MULLION CLADDING	FIBERGLASS	ANDERSEN
15	INSTALLATION CLIP	304 SS	ANDERSEN
16	EXTERIOR TRIM STOP	VINYL	ANDERSEN
17	NON-REINFORCING JOINING STRIP	ALUMINUM	ANDERSEN
18	END PLATE	ALUMINUM	ANDERSEN

7 SIDELITE BOTTOM RAIL
WOOD

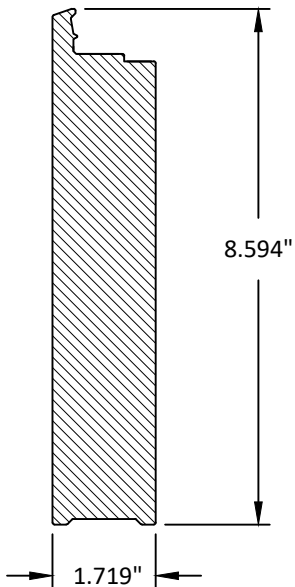


8 SIDELITE TOP RAIL
WOOD

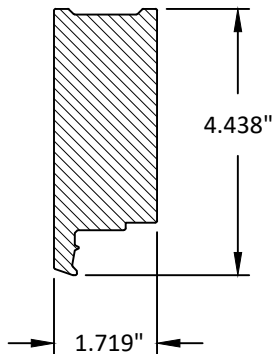


NOTE:
ALL WOOD TO BE PONDEROSA PINE
OR EQUAL (MIN. S.G. = 0.40)


1 FRAME HEAD/SILL/JAMB
WOOD

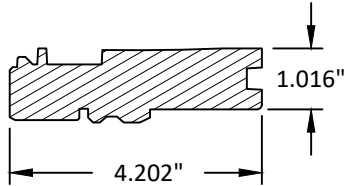


2 SIDELITE SILL
PVC

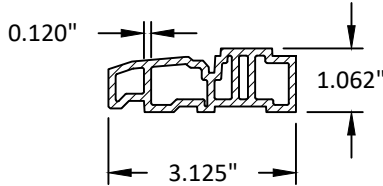


3 SIDELITE SILL STOP
WOOD

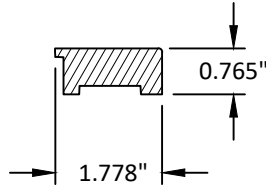


4 SIDELITE FRAME
WOOD

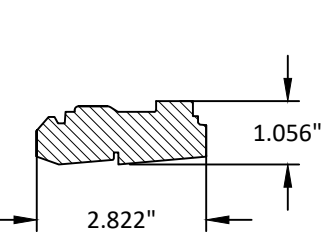


5 EXT. SILL
ALUMINUM

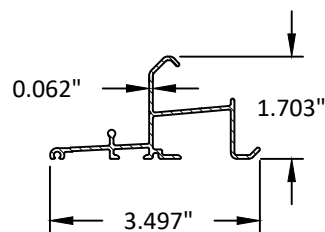


6 FRAME CLADDING
FIBERGLASS

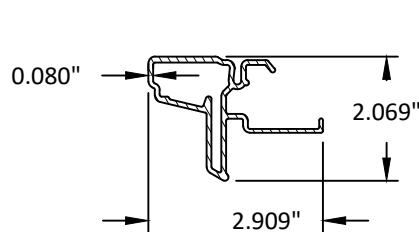


9 SIDELITE STILE
WOOD

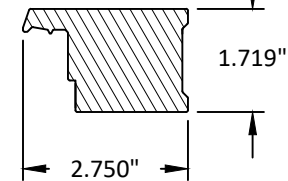


10 TRANSOM TOP/BOTTOM RAIL
WOOD

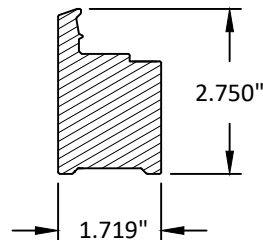

11 TRANSOM STILE
WOOD

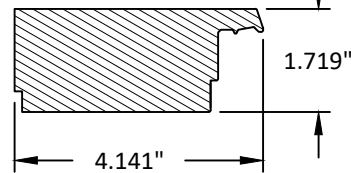

12 GLAZING STOP
WOOD

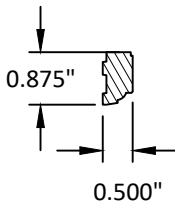



ANDERSEN
WINDOWS & DOORS

100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)


COMPONENTS & BILL OF MATERIALS

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN
ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS
OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION
TO DEVIATE
FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED
ENGINEER OR ARCHITECT SHALL
PREPARE SITE SPECIFIC DOCUMENTS FOR USE
WITH THIS DOCUMENT

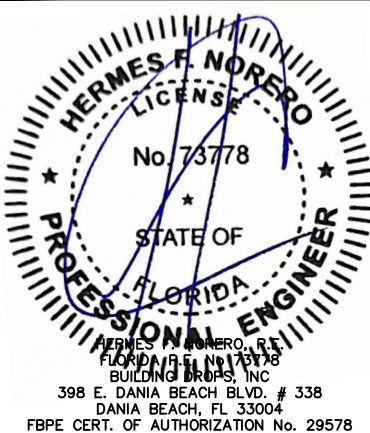


HERMES F. NORERO, P.E.
FLORIDA LICENSE NO. 73778
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD. # 338
DANIA BEACH, FL 33004
FBPE CERT. OF AUTHORIZATION No. 29578


FL #:	FL14431
DATE:	08.09.17
DWG. BY:	CHK. BY:
HR	HFN
SCALE:	NTS
DWG. #:	AWD121
SHEET:	

6/16/2023 12:10 PM
s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg


13 TRANSOM MULLION
WOOD

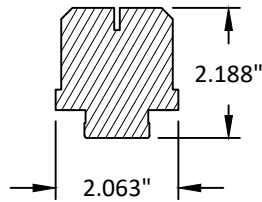


14 MULLION CLADDING
FIBERGLASS

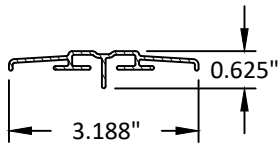


15 INSTALLATION CLIP
304 SS

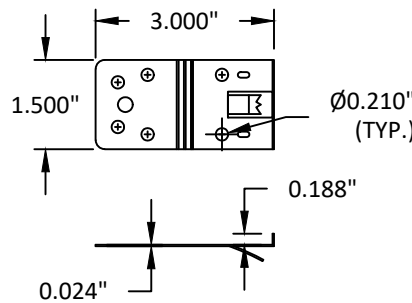


15A INSTALLATION CLIP
304 SS

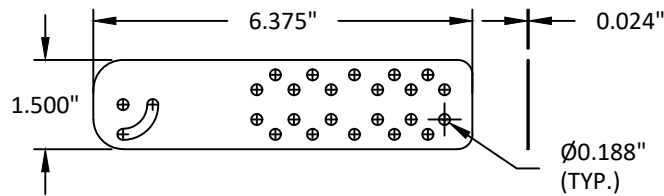


16 EXTERIOR TRIM STOP
VINYL



17 NON-REINFORCING JOINING STRIP
ALUMINUM




18 END PLATE
6063-T6 ALUMINUM

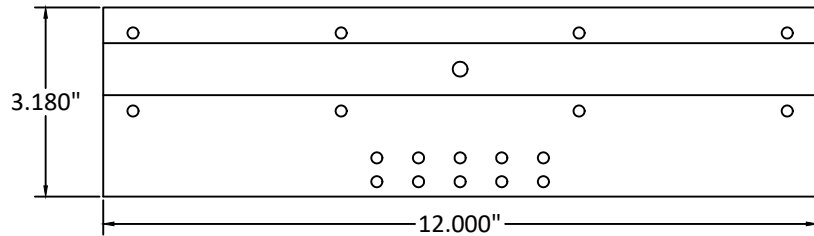

NOTE:

1. ALL GLAZING SHALL MEET ASTM E1300 REQUIREMENTS AND SAFETY GLAZING REQUIREMENTS AS PER CH 24 OF THE FBC.
2. SETTING BLOCK DUROMETER HARDNESS OF 70-90 (SHORE A) AS REFERENCED IN CHAPTER 24.
3. SETTING BLOCKS TO BE LOCATED AT 1/4 SPAN LENGTH FOR GLASS WIDER THAN 36" AS PER CHAPTER 24.
4. D.L.O. MAY NOT EXCEED MAX DIMENSIONS SHOWN IN ELEVATIONS.

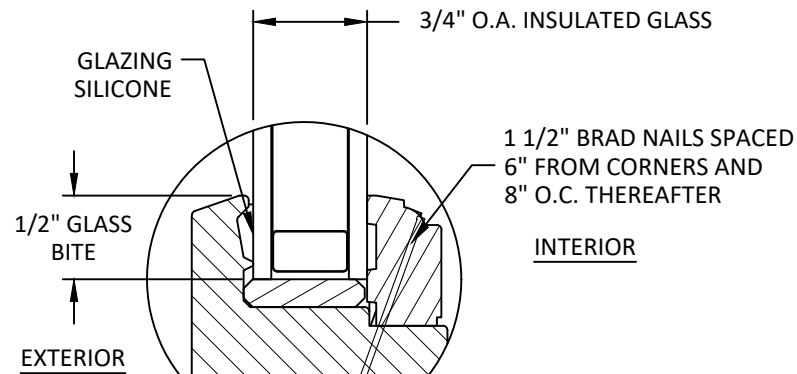

GLAZING DETAIL



100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
COMPONENTS (CONTINUED)
& GLAZING DETAIL

PREPARED BY:

BUILDING DROPS, INC.

398 E. DANIA BEACH BLVD., STE. 338

DANIA BEACH, FL 33004

PH: (954) 399-8478


FAX: (954) 744-4738

WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN
ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS
OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION
TO DEVIATE
FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED
ENGINEER OR ARCHITECT SHALL
PREPARE SITE SPECIFIC DOCUMENTS FOR USE
WITH THIS DOCUMENT

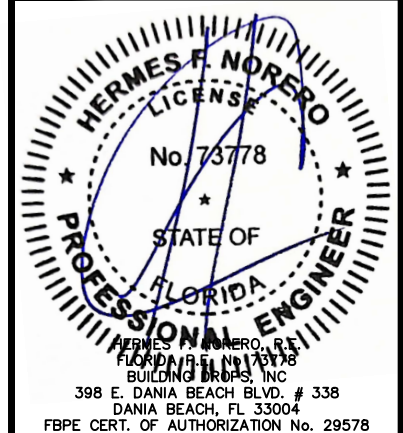

FL #:
FL14431

DATE: **08.09.17**

DWG. BY:
HR

CHK. BY:
HFN

SCALE: **NTS**

DWG. #: **AWD121**


SHEET:

8


OF 11

One Way Load Table (FWH-Sidelite)							
(A+B)/2	48	46.22	42.53	39.28	35.30	31.71	27.65
	45	48.50	44.69	41.31	37.10	33.36	29.12
	42	51.19	47.22	43.70	39.20	35.28	30.83
	39	54.37	50.20	46.46	41.68	37.54	32.84
	36	58.16	53.76	49.70	44.62	40.23	35.22
	33	62.72	58.02	53.59	48.16	43.44	38.07
	30	68.28	63.21	58.34	52.46	47.35	41.53
	27	75.17	69.64	64.21	57.78	52.18	45.80
	24	80.00	77.74	71.63	64.49	58.27	51.17
	21	80.00	80.00	80.00	73.20	66.17	58.14
	18	80.00	80.00	80.00	80.00	76.77	67.48
	15	80.00	80.00	80.00	80.00	80.00	80.00
		80	83	86	89	92	96
L - Mullion Length							

- NOTE:
- MULLION CHART APPLIES TO MULLION ASSEMBLIES, SEE TYP. DETAIL P/9, WHEN USED TO MULL WINDOWS IN CONFIGURATIONS SHOWN IN ELEVATION A AT RIGHT .
 - DESIGN PRESSURE VALUES ARE POSITIVE AND NEGATIVE IN PSF.
 - MAXIMUM DEFLECTION HAS BEEN LIMITED TO L/175.
 - DESIGN PRESSURE OF ASSEMBLY IS LIMITED TO THE LESSER DESIGN PRESSURE OF THE JAMB-TO-JAMB WOOD MULLION OR THE INDIVIDUAL WINDOW UNIT OF INSTALLATION.
 - MULLION CHART ABOVE APPLIES TO MULLED ASSEMBLIES CONSISTING OF 400 SERIES FRENCHWOOD SIDELITE OR FRENCHWOOD INSWING AND OUTSWING DOOR UNITS.
 - ADJACENT WINDOWS SHALL BE FASTENED TO THE ROUGH OPENING WITH ADDITIONAL ANCHORS IN ACCORDANCE WITH DETAILS S/11 & T/11, SHEET 11.

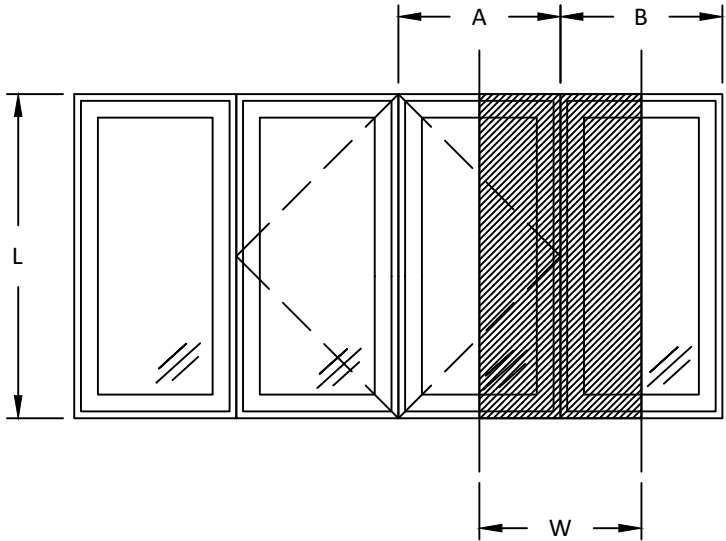

ELEVATION A
TRIBUTARY WIDTH = $W = (A+B)/2$

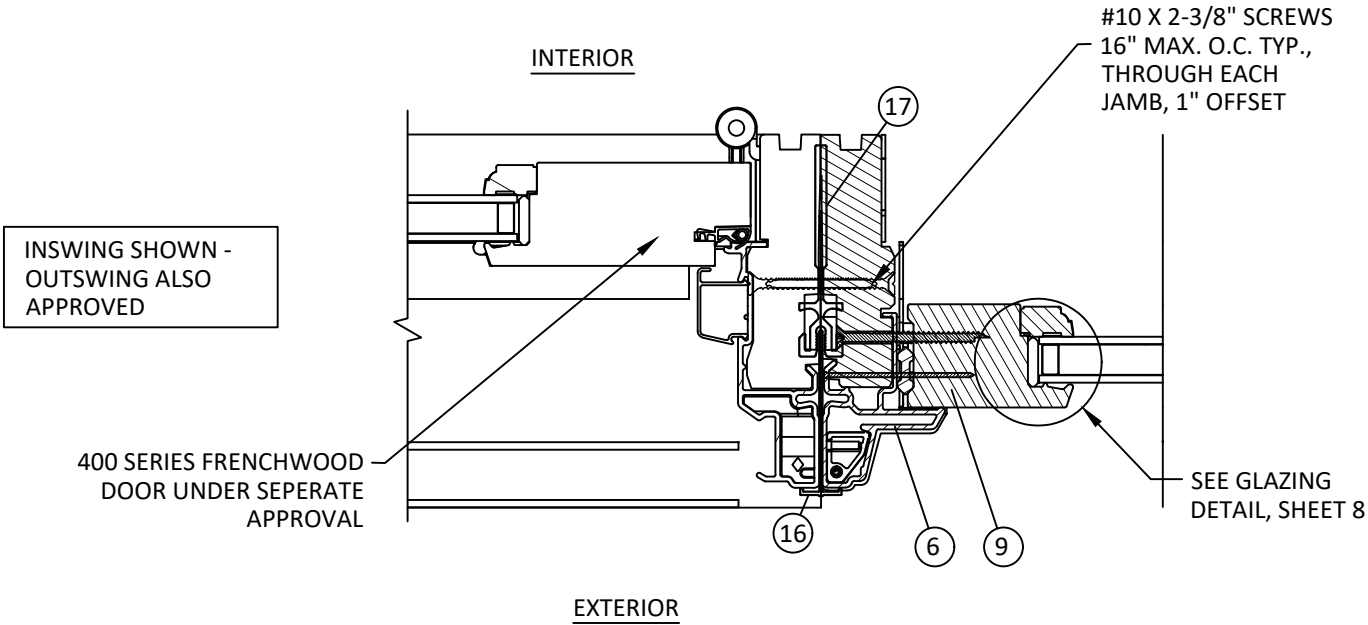

P
9

HORIZONTAL SECTION

JAMB TO JAMB MULLION
TYP.



100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
SIDELITE MULL TABLE (ONE-WAY)

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23


THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT



FL #:	FL14431
DATE:	08.09.17
DWG. BY:	HR
CHK. BY:	HFN
SCALE:	NTS
DWG. #:	AWD121
SHEET:	9


Two Way Load Table (FWH-Transom)									
(A+B)/2	68	100.00	100.00	88.19	49.61	39.19	31.75	27.90	22.05
	64	100.00	100.00	93.70	52.71	41.64	33.73	29.65	23.42
	60	100.00	100.00	99.95	56.22	44.42	35.98	31.62	24.99
	56	100.00	100.00	100.00	60.24	47.59	38.55	33.88	26.77
	52	100.00	100.00	100.00	64.87	51.25	41.52	36.49	28.83
	48	100.00	100.00	100.00	70.27	55.53	44.98	39.53	31.23
	44	100.00	100.00	100.00	76.66	60.57	49.06	43.12	34.07
	40	100.00	100.00	100.00	84.33	66.63	53.97	47.44	37.48
	36	100.00	100.00	100.00	93.70	74.03	59.97	52.71	41.64
		30	33	36	48	54	60	64	72
L - Mullion Length									

- NOTE:
- 1) MULLION CHART APPLIES TO MULLION ASSEMBLIES, SEE TYP. DETAIL Q/10 , WHEN USED TO MULL WINDOWS IN CONFIGURATIONS SHOWN IN TYP. ELEVATIONS B & C AT RIGHT.
 - 2) DESIGN PRESSURE VALUES ARE POSITIVE AND NEGATIVE IN PSF.
 - 3) MAXIMUM DEFLECTION HAS BEEN LIMITED TO L/175.
 - 4) DESIGN PRESSURE OF ASSEMBLY IS LIMITED TO THE LESSER DESIGN PRESSURE OF THE NARROW WOOD MULLION OR THE INDIVIDUAL WINDOW UNIT OF INSTALLATION.
 - 5) MULLION CHART ABOVE APPLIES TO MULLED ASSEMBLIES CONSISTING OF 400 SERIES FRENCHWOOD SIDELITE/TRANSOM UNITS OR FRENCHWOOD INSWING AND OUTSWING DOOR UNITS.
 - 6) ADJACENT UNITS SHALL BE FASTENED TO THE ROUGH OPENING WITH ADDITIONAL ANCHORS IN ACCORDANCE WITH DETAIL R/11, SHEET 11.

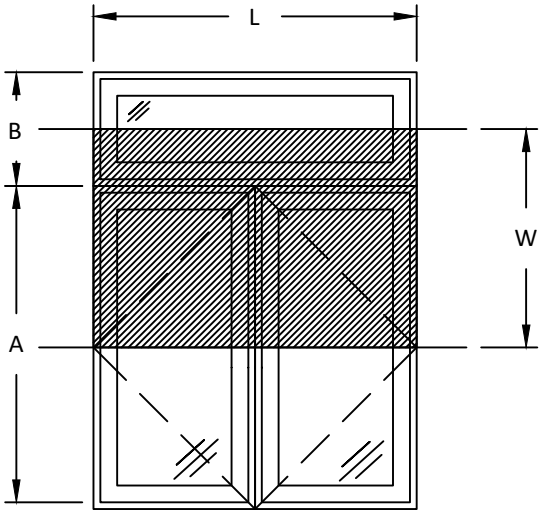


ELEVATION B

TRIBUTARY WIDTH = W = (A+B)/2

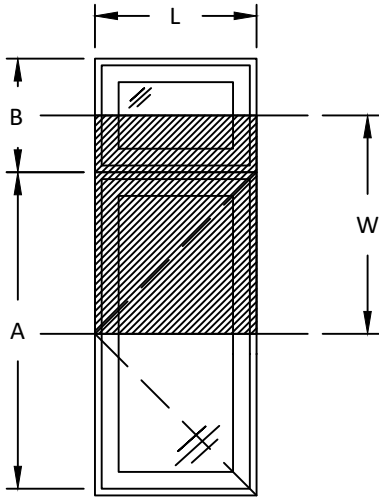

ELEVATION C

TRIBUTARY WIDTH = W = (A+B)/2

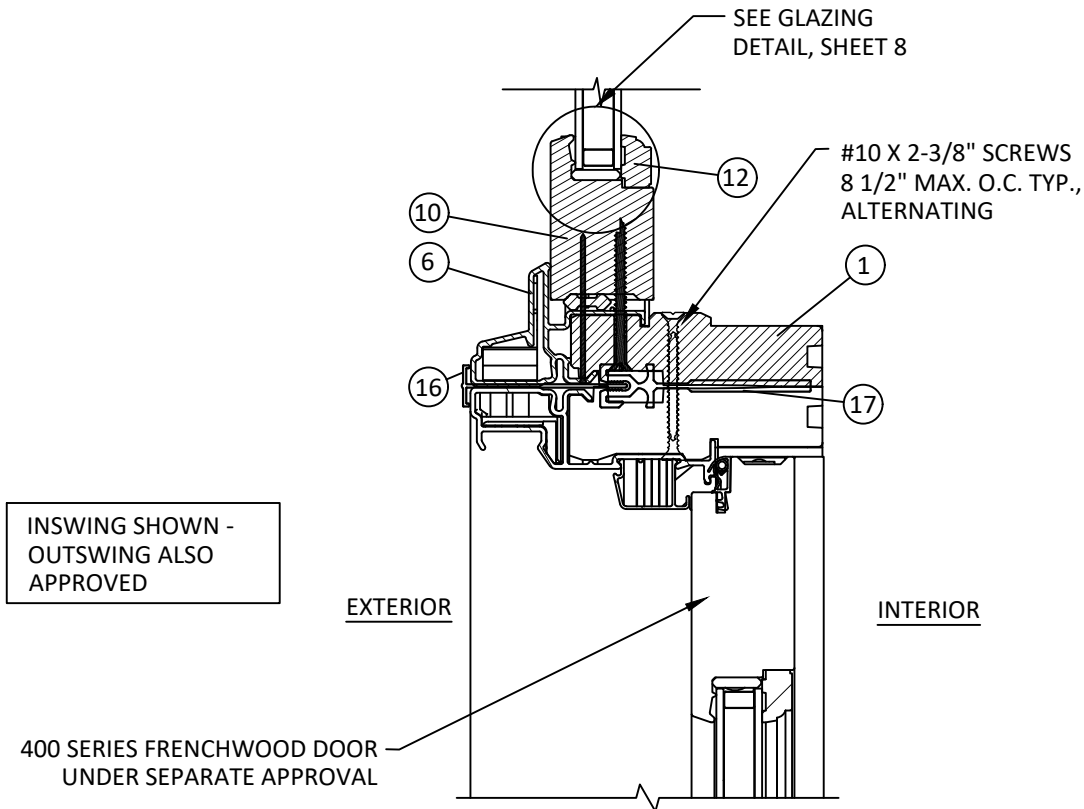

Q
10

HORIZONTAL SECTION

SILL JAMB TO 400 SERIES FRENCHWOOD DOOR
TYP.



100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)
TRANSOM MULL TABLE (TWO-WAY)

PREPARED BY:
BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION TO DEVIATE FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED ENGINEER OR ARCHITECT SHALL PREPARE SITE SPECIFIC DOCUMENTS FOR USE WITH THIS DOCUMENT



FL #: FL14431

DATE: 08.09.17

DWG. BY: HR
CHK. BY: HFN

SCALE: NTS


DWG. #: AWD121

SHEET:

10


OF 11

s:\projects\andersen windows\cc-23-0347 - fbc 2023 code change (8th edition)\dwgs\114431\awd121.dwg 6/16/2023 12:10 PM

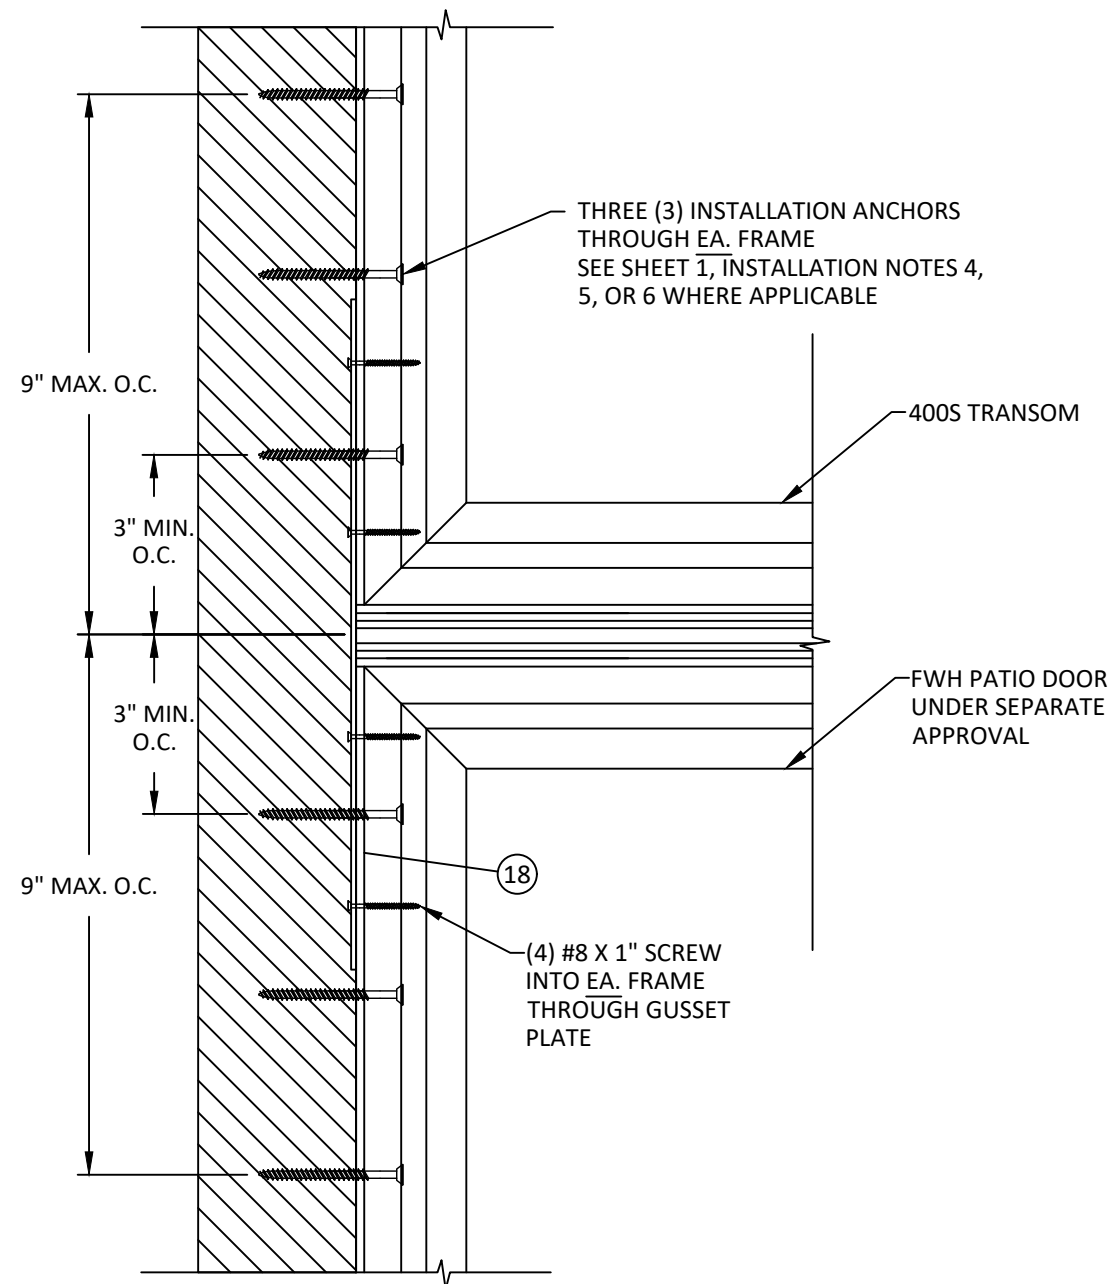


R
11

EXTERIOR VIEW
MULLION ANCHOR DETAIL - JAMB
THROUGH FRAME - TYP.

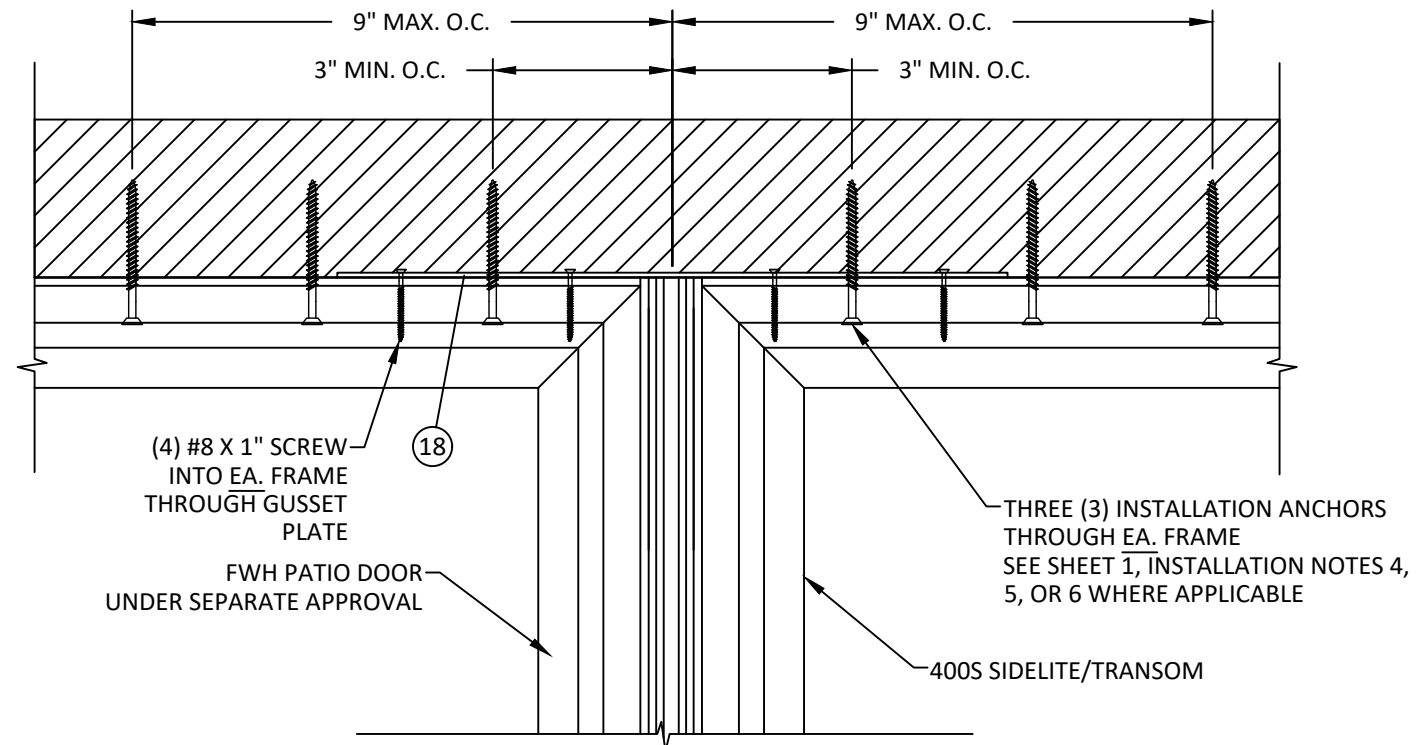

S
11

EXTERIOR VIEW
MULLION ANCHOR DETAIL - HEAD
THROUGH FRAME - TYP.

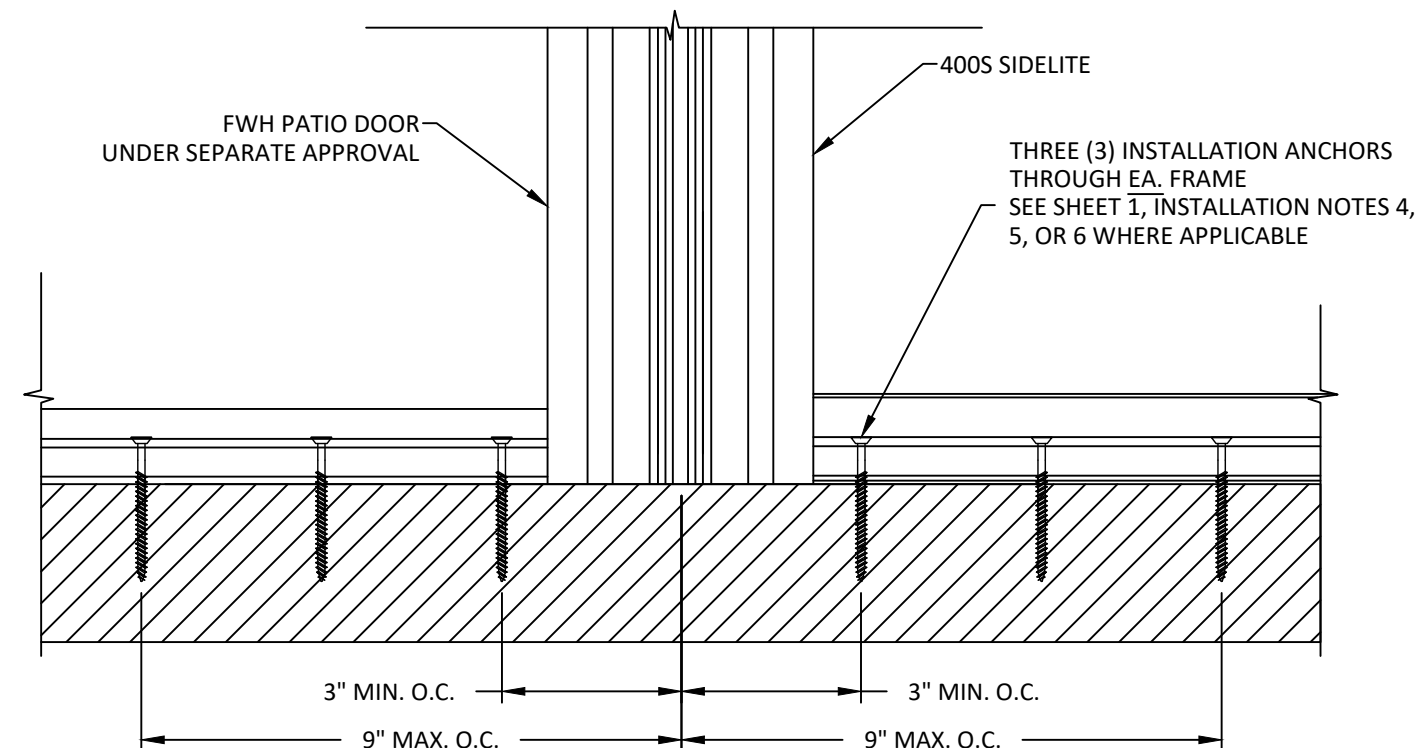

T
11

EXTERIOR VIEW
MULLION ANCHOR DETAIL - SILL
THROUGH FRAME - TYP.



ANDERSEN
WINDOWS & DOORS

100 FOURTH AVE NORTH
BAYPORT, MN 55003-1096
PH: (651) 264-5150 FX: (651) 264-5485

TITLE: 400 SERIES PATIO DOOR
SIDELITE & TRANSOM
(NON-HVHZ)/(NON-IMPACT)

MULLION DETAILS

PREPARED BY: BUILDING DROPS, INC.
398 E. DANIA BEACH BLVD., STE. 338
DANIA BEACH, FL 33004
PH: (954) 399-8478
FAX: (954) 744-4738
WEB: www.buildingdrops.com



REMARKS	BY	DATE
5TH FBC CODE CHANGE	SM	4.10.15
6TH FBC CODE CHANGE	HR	8.9.17
7TH FBC CODE CHANGE	SR	3.18.20
8TH FBC CODE CHANGE	SH	5.24.23

THE INSTALLATION DETAILS DESCRIBED HEREIN
ARE GENERIC AND MAY NOT REFLECT ACTUAL CONDITIONS
OR A SPECIFIC SITE. IF SITE CONDITIONS CAUSE INSTALLATION
TO DEVIATE
FROM THE REQUIREMENTS DETAILED HEREIN, A LICENSED
ENGINEER OR ARCHITECT SHALL
PREPARE SITE SPECIFIC DOCUMENTS FOR USE
WITH THIS DOCUMENT



FL #:
FL14431

DATE: **08.09.17**

DWG. BY: **HR** CHK. BY: **HFN**

SCALE: **NTS**

DWG. #: **AWD121**

SHEET:

11

OF 11