

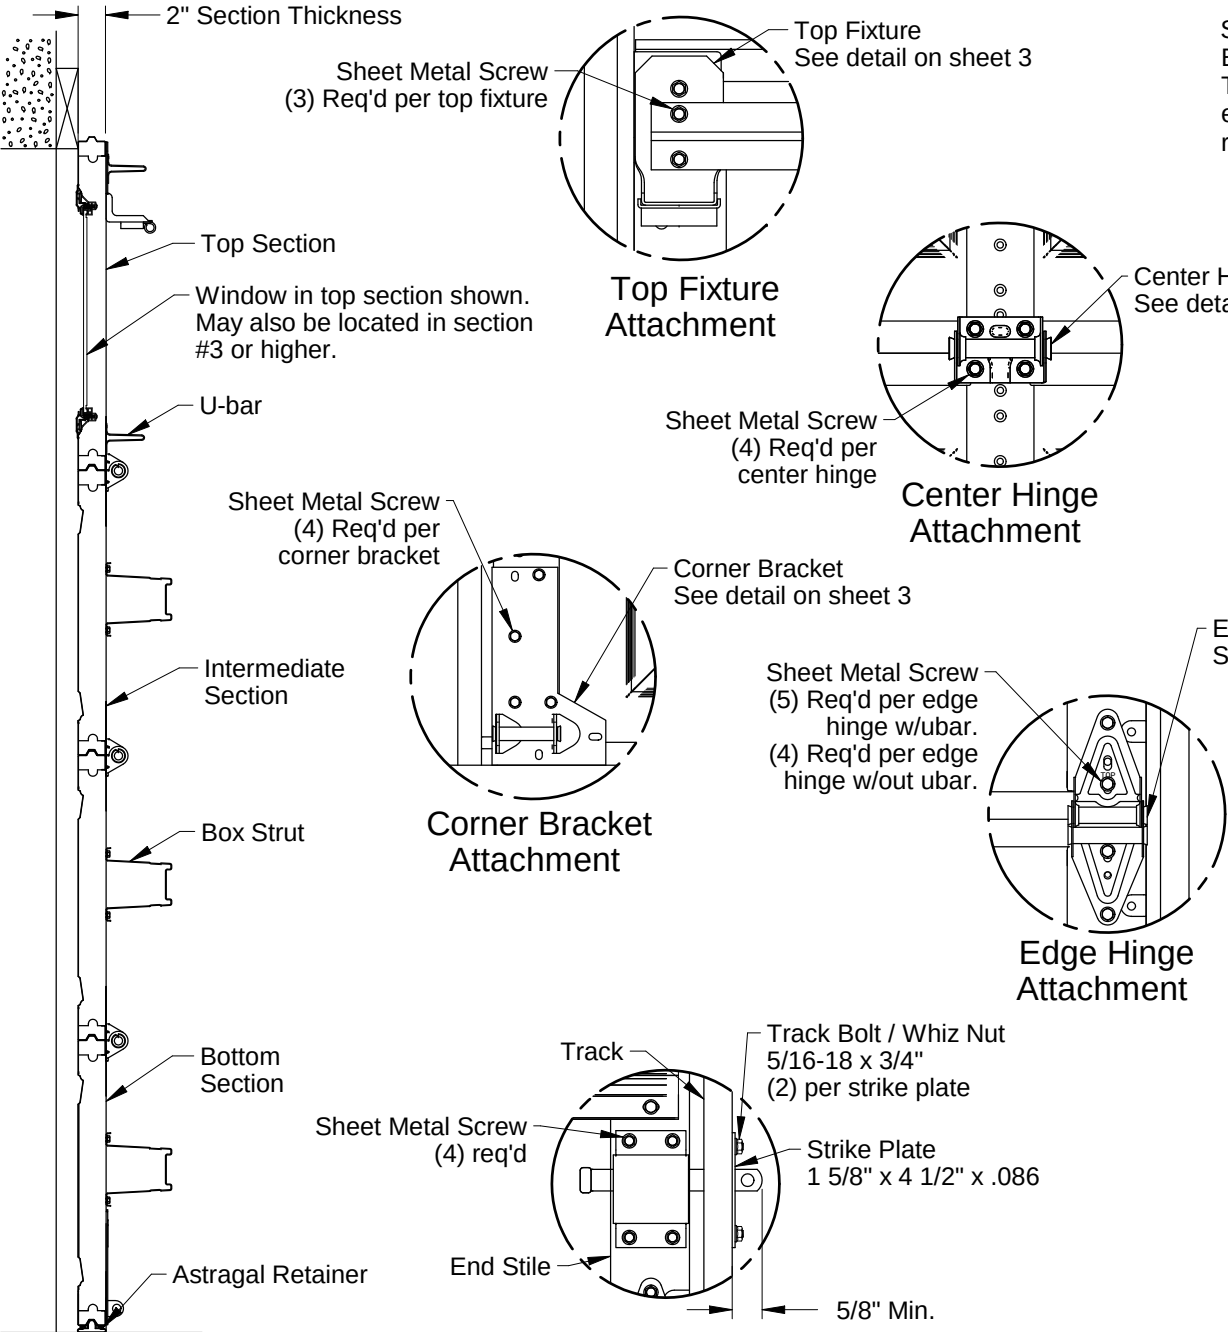
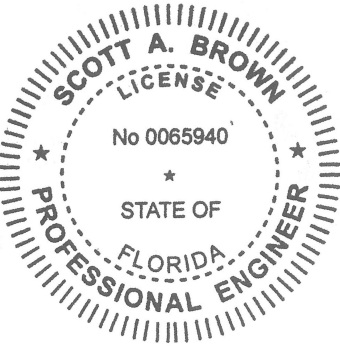


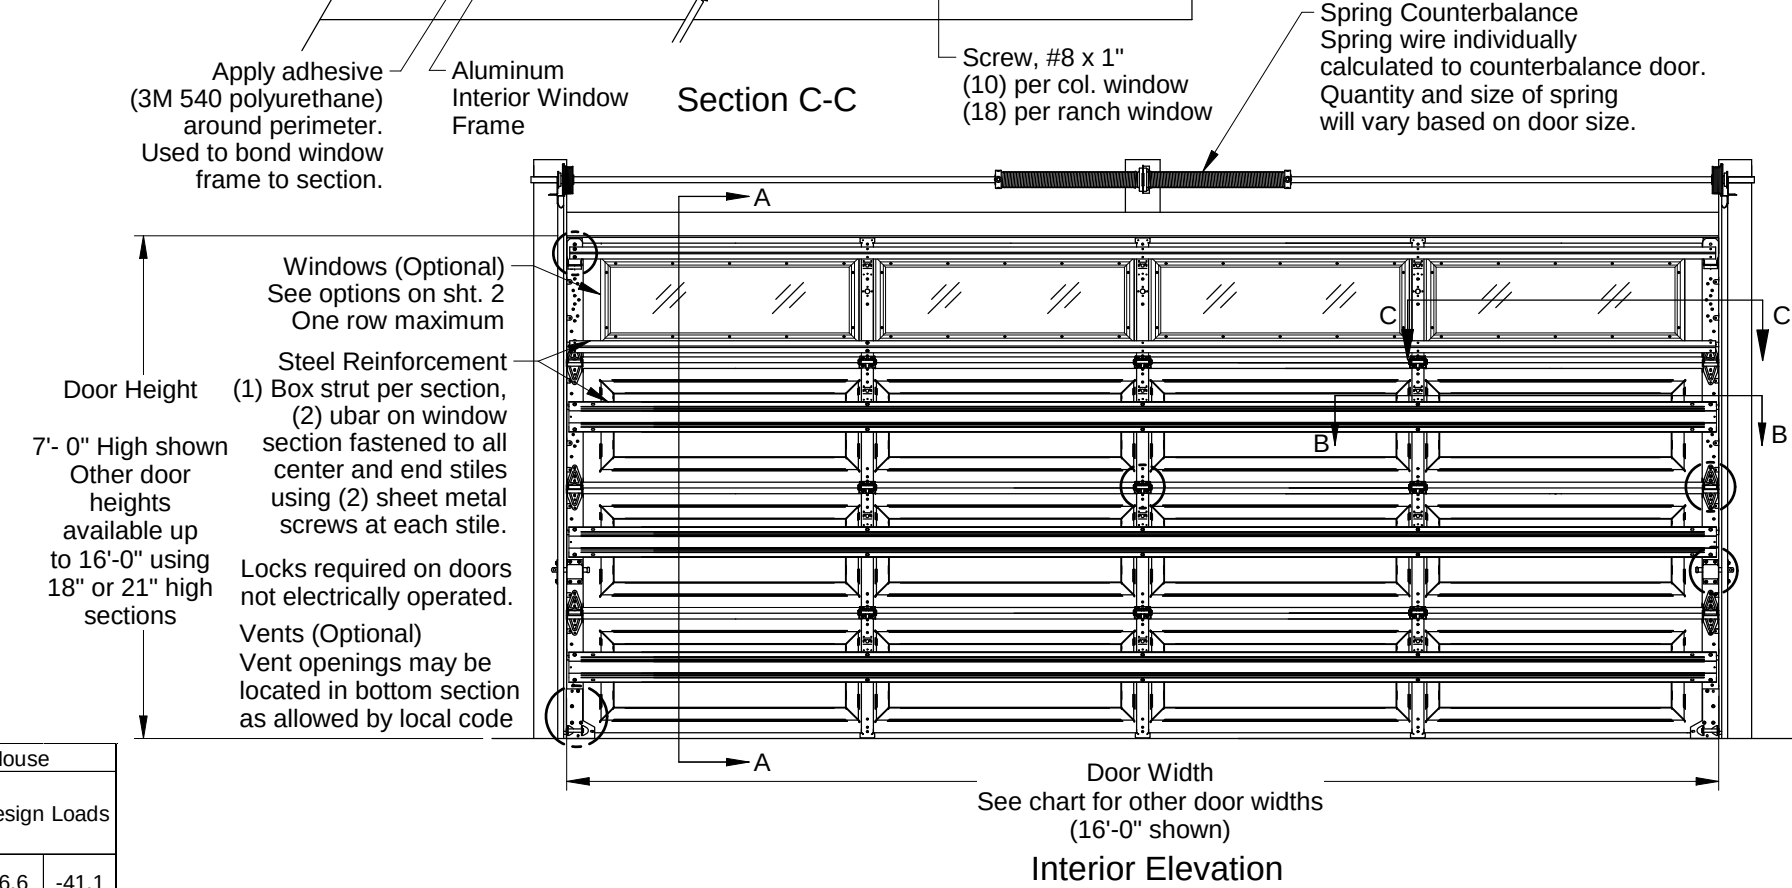

Section A-A

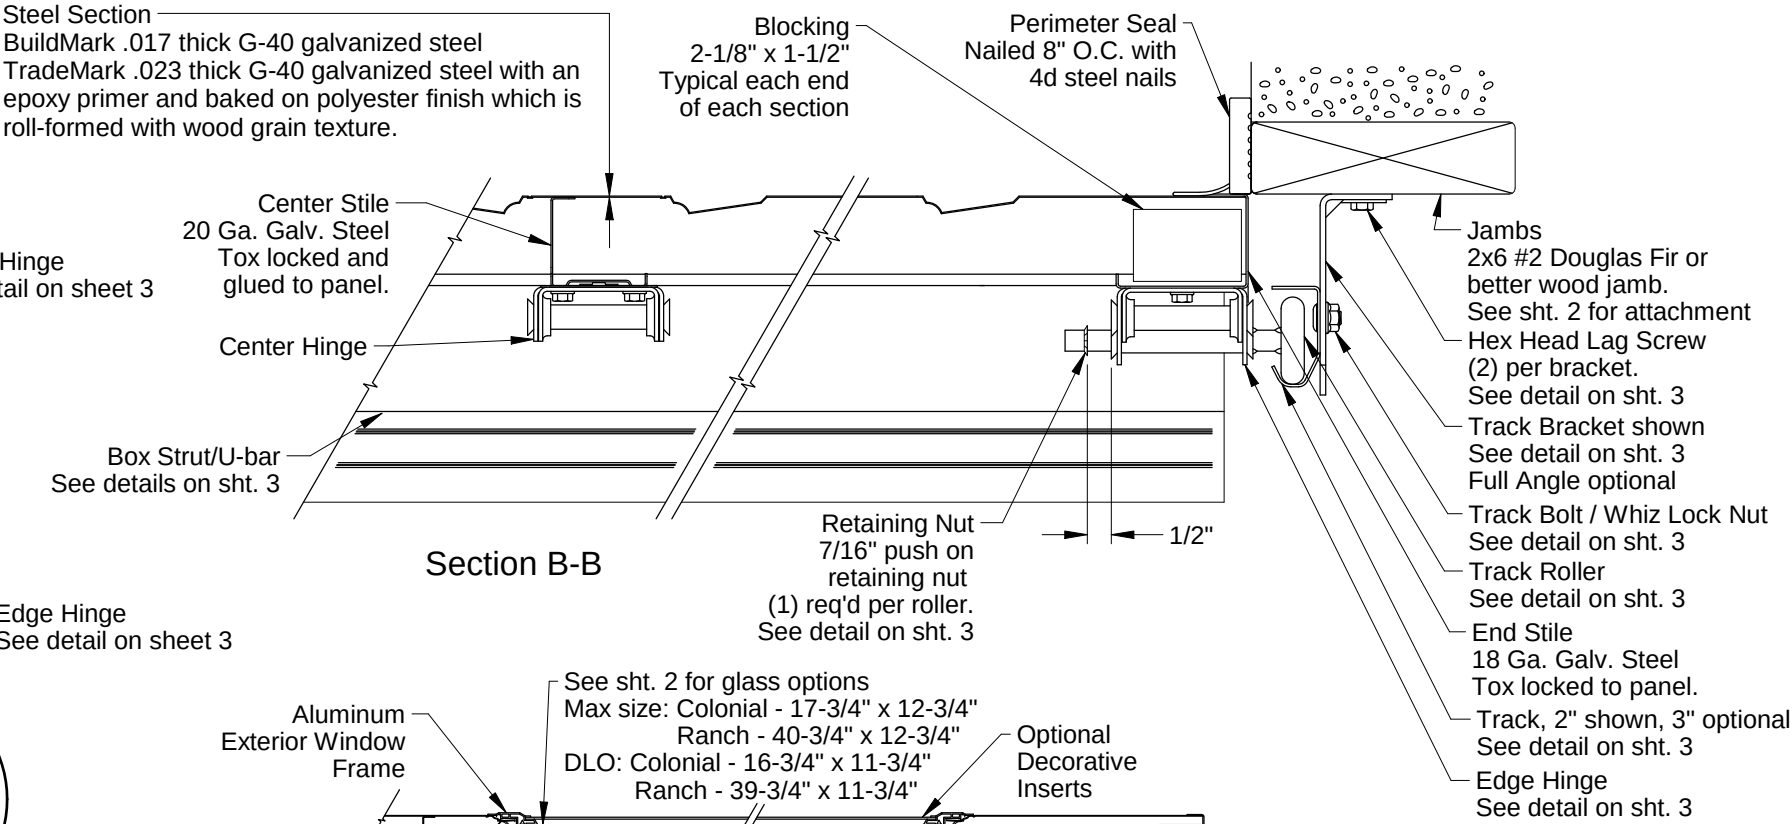

Scott A. Brown, P.E. Lic. No. 65940
Wendler Engineering Services, Inc.
698 Timber Creek Road, Dixon, IL 61021
FBPE CA Lic. No. 31544
Structural Adequacy for Wind Load


Digitally signed by Scott A Brown, PE
Date: 2019-08-12 15:06:51

Doors tested per
ANSI/DASMA 108
for static air pressure
and
ANSI/DASMA 115
for large missile impact and
cyclic wind pressure


Max. Door Width	Colonial				Ranch				Carriage House			
	Stiles per Sect.	Hinges per Sect.	Design Loads		Stiles per Sect.	Hinges per Sect.	Design Loads		Stiles per Sect.	Hinges per Sect.	Design Loads	
8'-0"	1	1	36.6	-41.1	1	1	36.6	-41.1	1	1	36.6	-41.1
9'-0"	1	1			1	1			1	1		
10'-0"	2	2			1	1			1	1		
12'-0"	3	3	23.3	-28.0	2	2	23.3	-28.0	2	2	23.3	-28.0
14'-0"	4	4			2	2			2	2		
16'-0"	3	3			3	3			3	3		

Printed copies of this document are not considered signed and sealed and the SHA authentication code must be verified on any electronic copies.

				Drawn by: R. Frey	 1101 East River Road Dixon, IL. 61021	Spec, Wind Load BuildMark / TradeMark		
				Checked by: G. Wedekind				
A	New release for production.	8205.01	07/09/19	Date: 07/09/19				
Rev.	Description	ECO	Date	ECO: 8205.01		No. P-3348	Sheet 1 of 3	Rev A

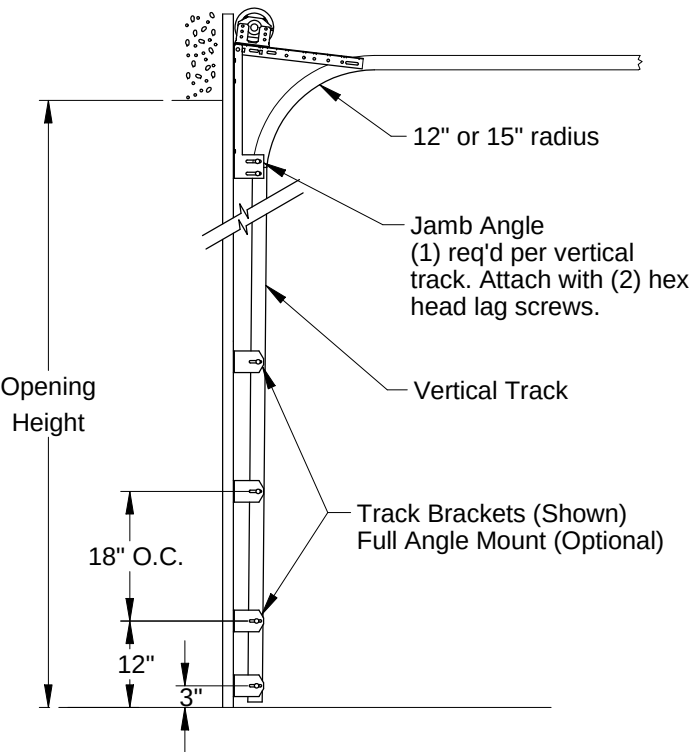


Typical Track Installation
Normal headroom track shown, low headroom, lift clearance and verical lift track available

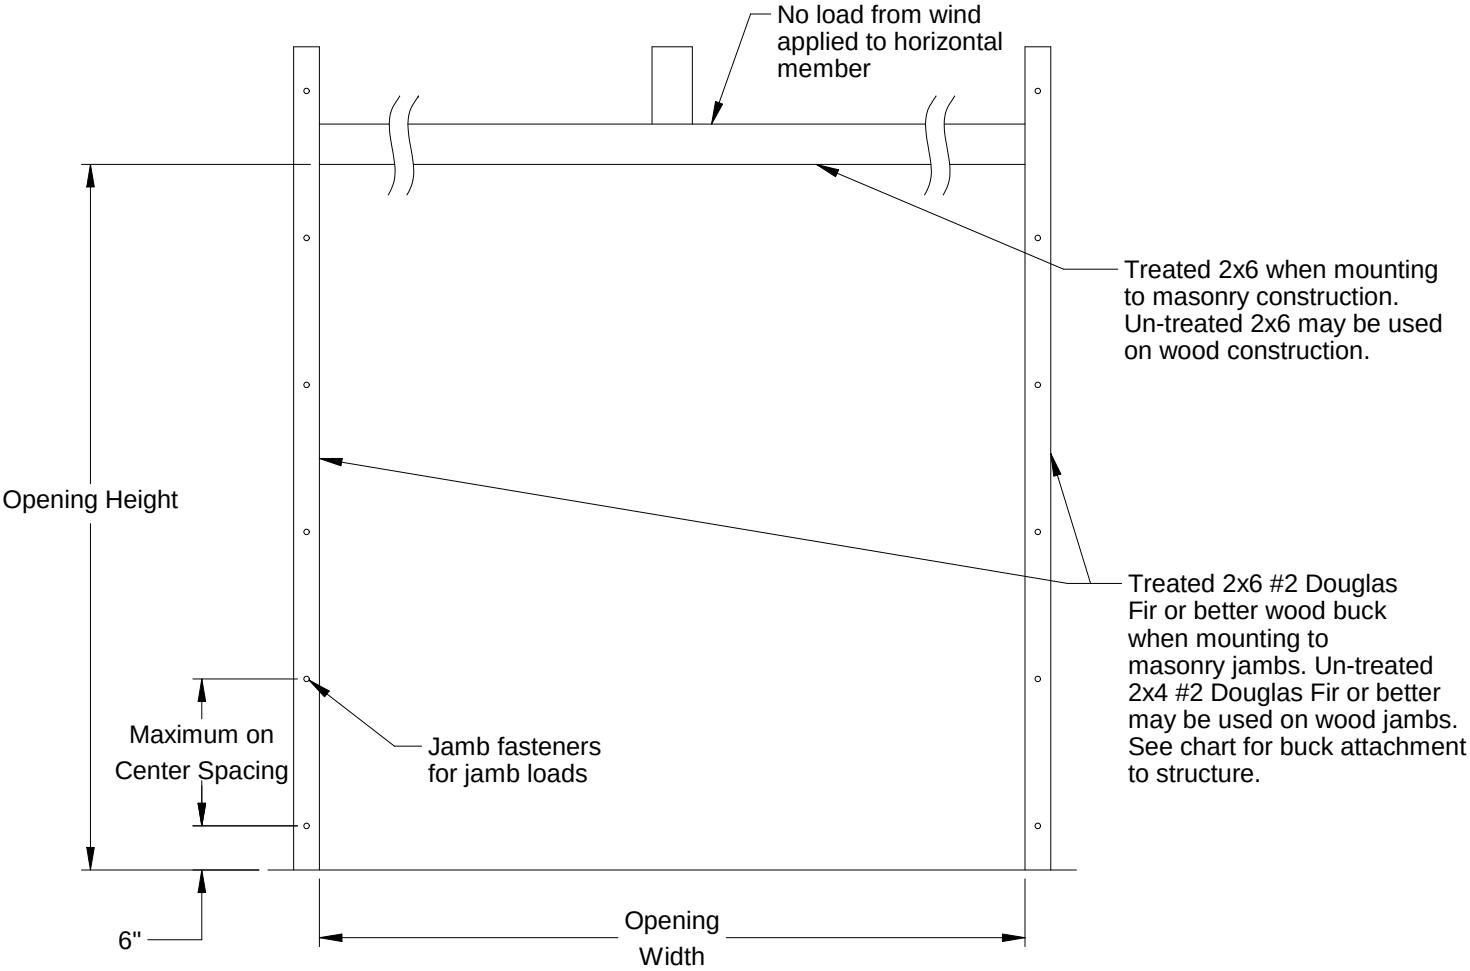

Jamb Attachment Notes:


1. Maximum Positive Load per Jamb = (16'-0" x 23.3 PSF) / 2 = 187 lbs. per foot.
2. Maximum Negative Load per Jamb = (16'-0" x -28.0 PSF) / 2 = 224 lbs. per foot.
3. Design of the supporting structure shall be the sole responsibility of the building designer and shall be designed for the jamb loads listed in notes 1 and 2.
4. Alternate jamb attachments may be used if approved by a registered Professional Engineer.
5. DASMA Technical Data Sheet TDS-161 may be used for alternate jamb attachments.
6. 3/8" diameter lag screws required 1/16" pilot hole and 1-1/2" minimum required distance.

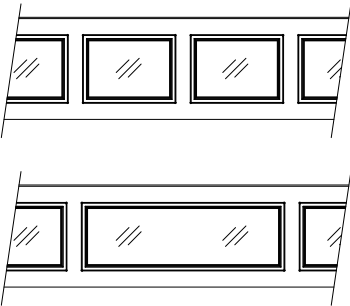

Colonial windows:
1/4" Polycarbonate

Ranch windows:
1/4" Polycarbonate

Window Options

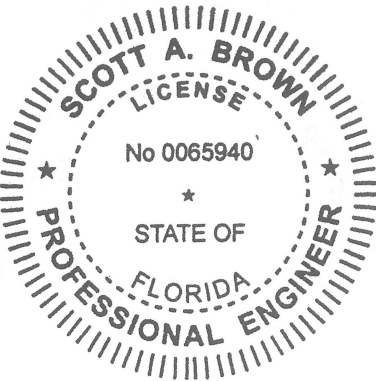





















Scott A. Brown, P.E. Lic. No. 65940
Wendler Engineering Services, Inc.
698 Timber Creek Road, Dixon, IL 61021
FBPE CA Lic. No. 31544
Structural Adequacy for Wind Load

Digitally signed by Scott A Brown, PE
Date: 2019-08-12 15:07:19

Printed copies of this document are not considered signed and sealed and the SHA authentication code must be verified on any electronic copies.

2x6 Attachment to Structure						
Structure Type	Fastener Type	Minimum Embedment	Minimum Edge Distance	Minimum on Center Spacing	Maximum on Center Spacing	Allowable Tension Load
2500 PSI Min. Concrete	1/4" Tapcon+ (Plus) with 1-1/8" OD Washer	2"	2.5	6"	24"	526
Southern Pine	3/8" x 3" Lag with 1-1/8" OD Washer	1.50"	1.50"	1.50"	24"	655
Spruce Pine Fir	3/8" x 3" LAG with 1-1/8" OD Washer	1.50"	1.50"	1.50"	24"	482

Scale: None	 1101 East River Road Dixon, IL. 61021	Title: Spec, Wind Load BuildMark / TradeMark		
Drawn by: R. Frey		No. P-3348	Sheet 2	Rev A
Checked by: G. Wedekind				
Date: 07/09/19				
ECO: 8205.01				

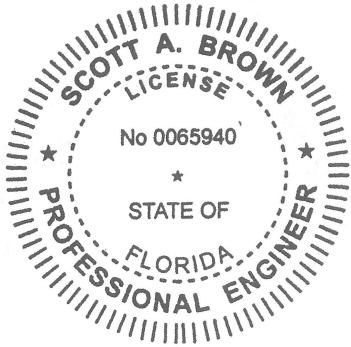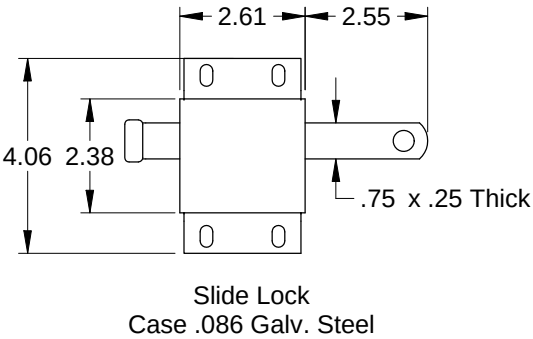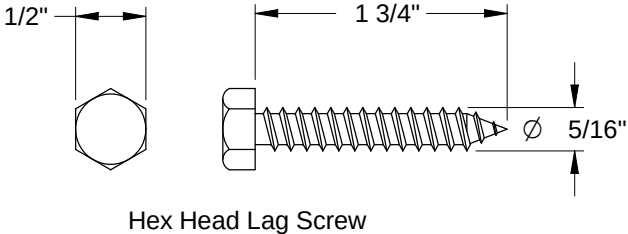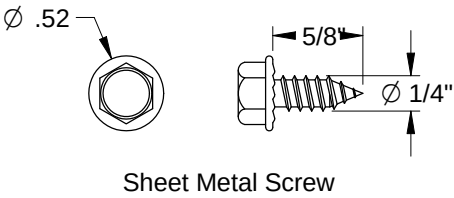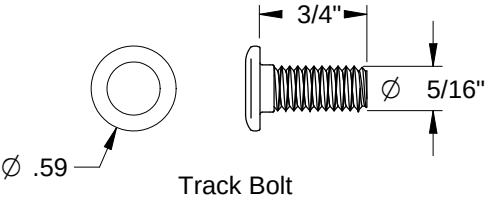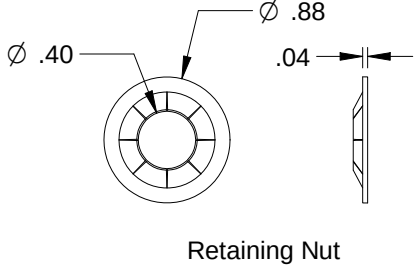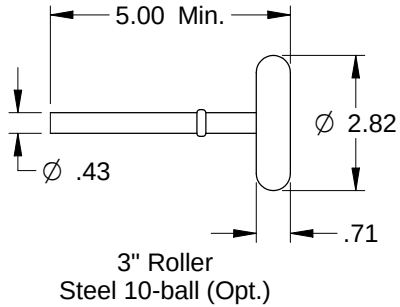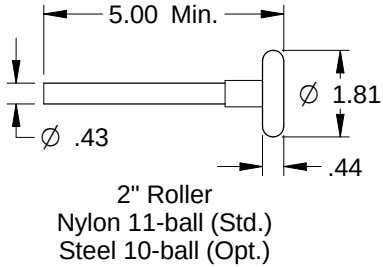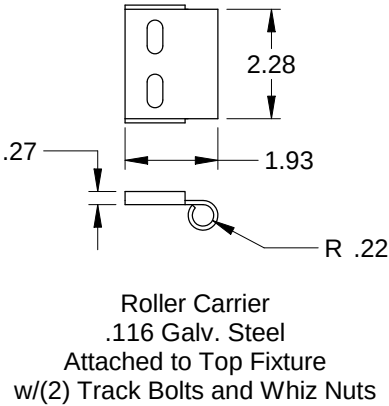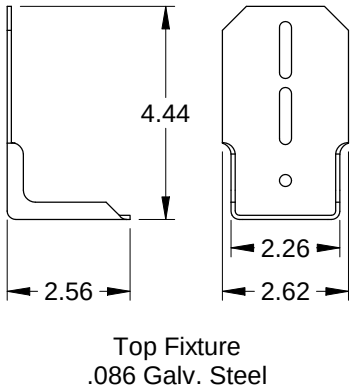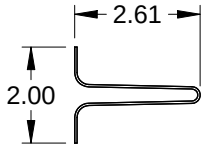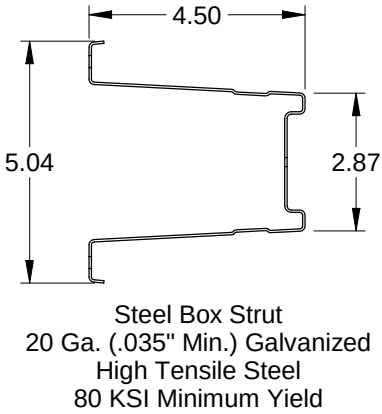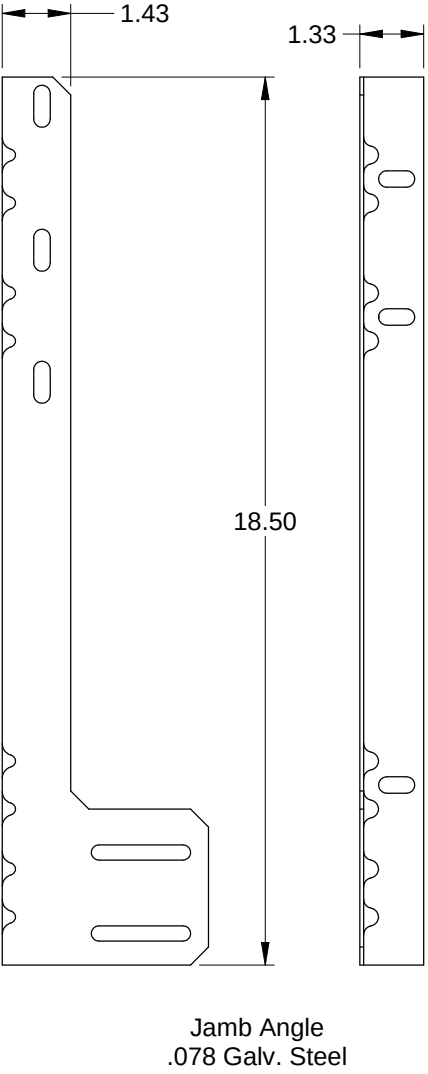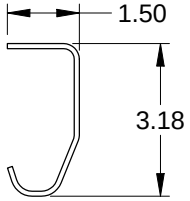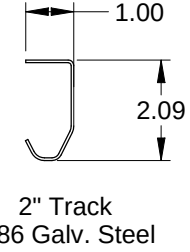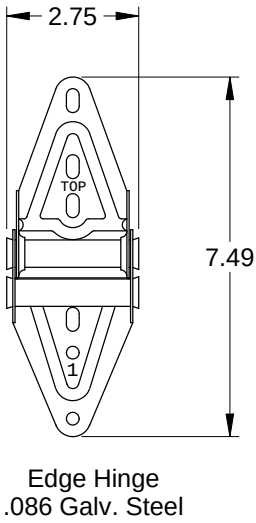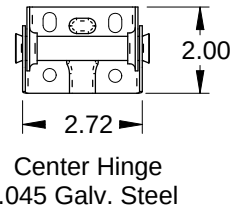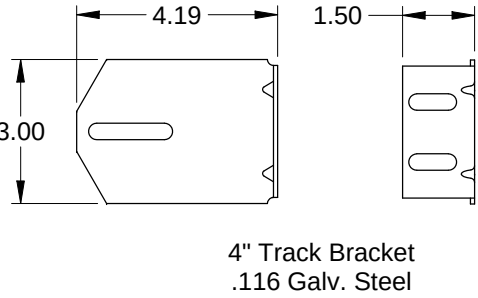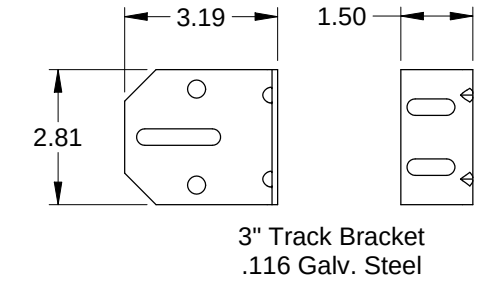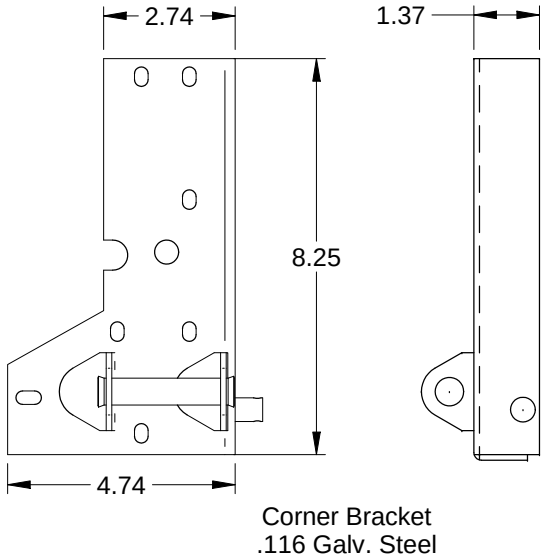

Scott A. Brown, P.E. Lic. No. 65940
Wendler Engineering Services, Inc.
698 Timber Creek Road, Dixon, IL 61021
FBPE CA Lic. No. 31544
Structural Adequacy for Wind Load

Digitally signed by Scott A Brown, PE
Date: 2019-08-12 15:07:54

Printed copies of this document are not considered signed and sealed and the SHA authentication code must be verified on any electronic copies.

Scale: None
Drawn by: R. Frey
Checked by: G. Wedekind
Date: 07/09/19
ECO: 8205.01



Title:
Spec, Wind Load
BuildMark / TradeMark

No. P-3348

Sheet
3

Rev
A