

[illegible]

SHEET 2 OF 8

NewSouth

ELEVATION

Lyndon F. Schmidt
P.E. No. 43409

Reich BUILDING CONSULTANTS, INC.

P.O. Box 230, Valrico, FL 33595





Phone No.: 813.659.9197

FBPE Registry No. 9813

U.S. Patent and Trademark Office

© 2018 R.W. BUILDING CONSULTANTS INC.

\\dc01\vwbc\Clients\New South Windows PERMANENT\VA - Florida Product Approvals\FL 15449 Sliding Door\C - Drawings\FL-15449 (2020) R5\FL-15449.12.dwg

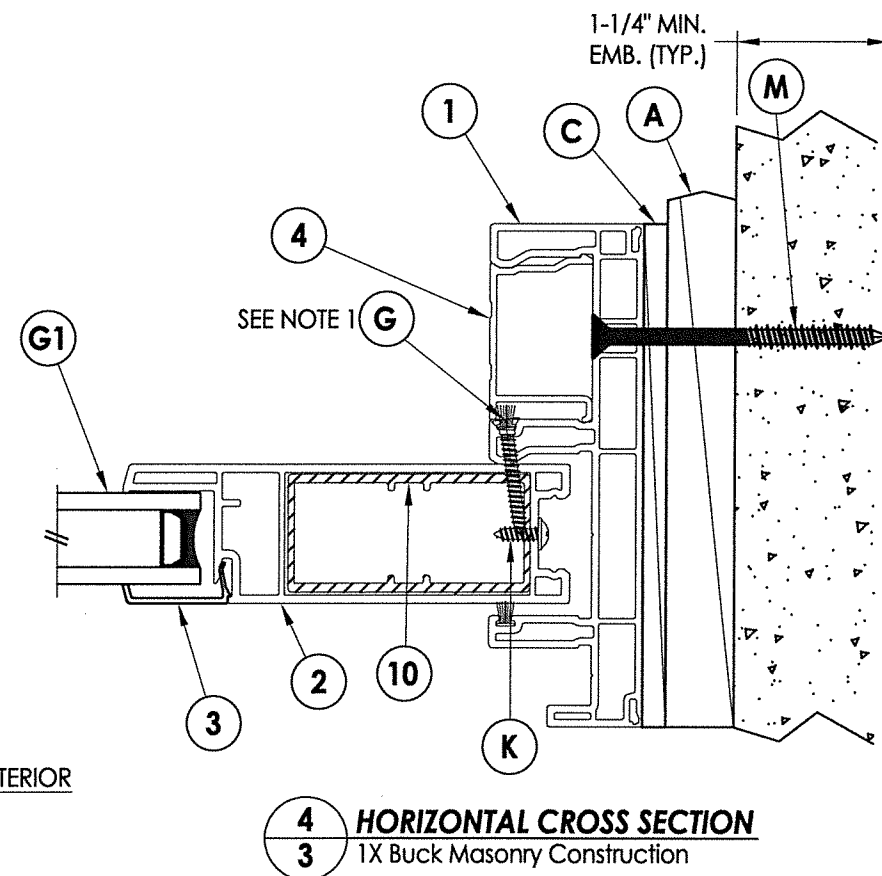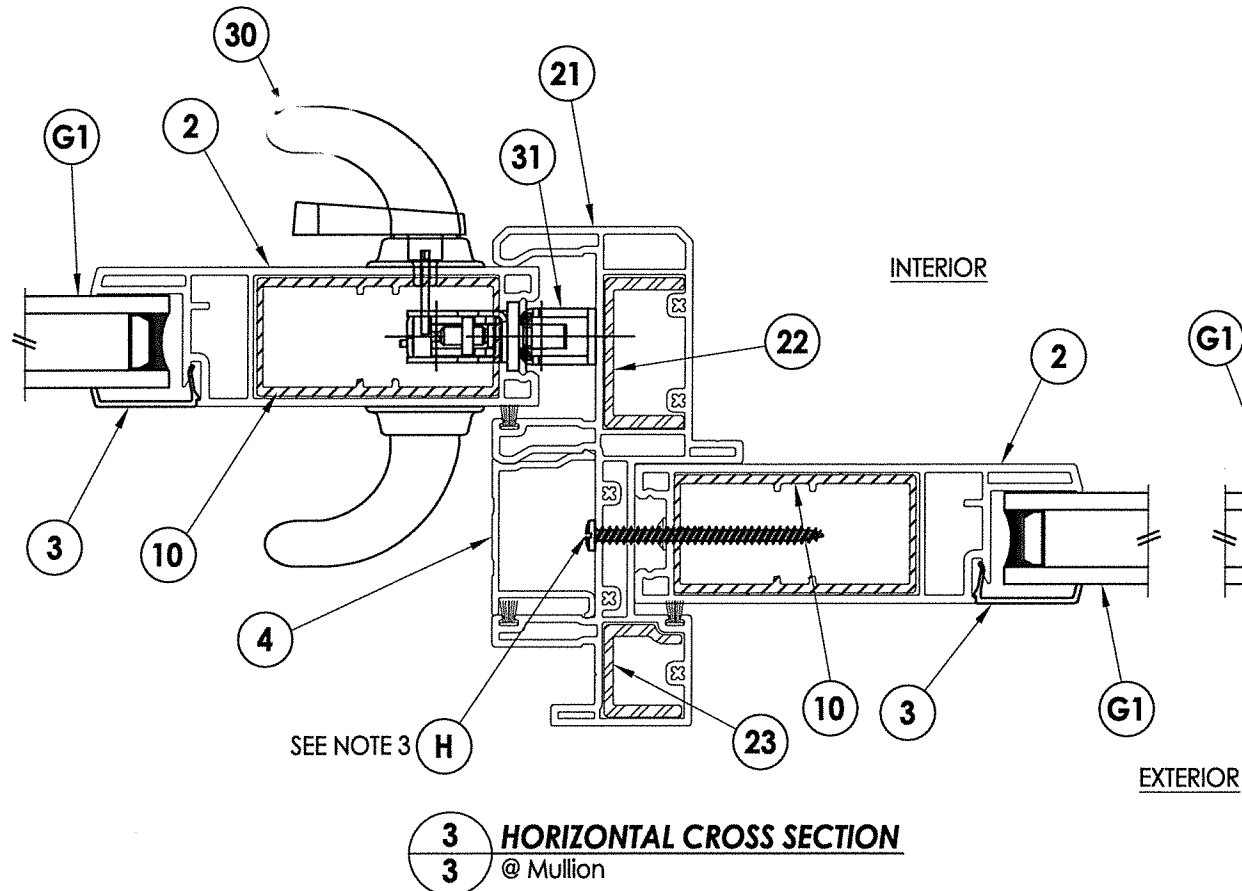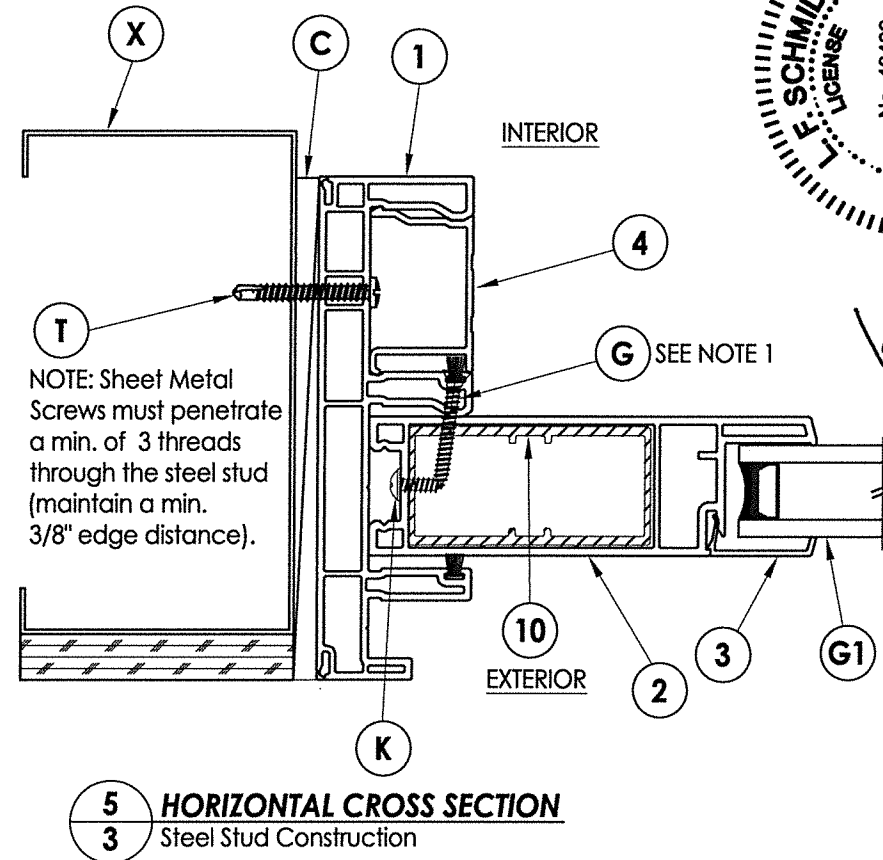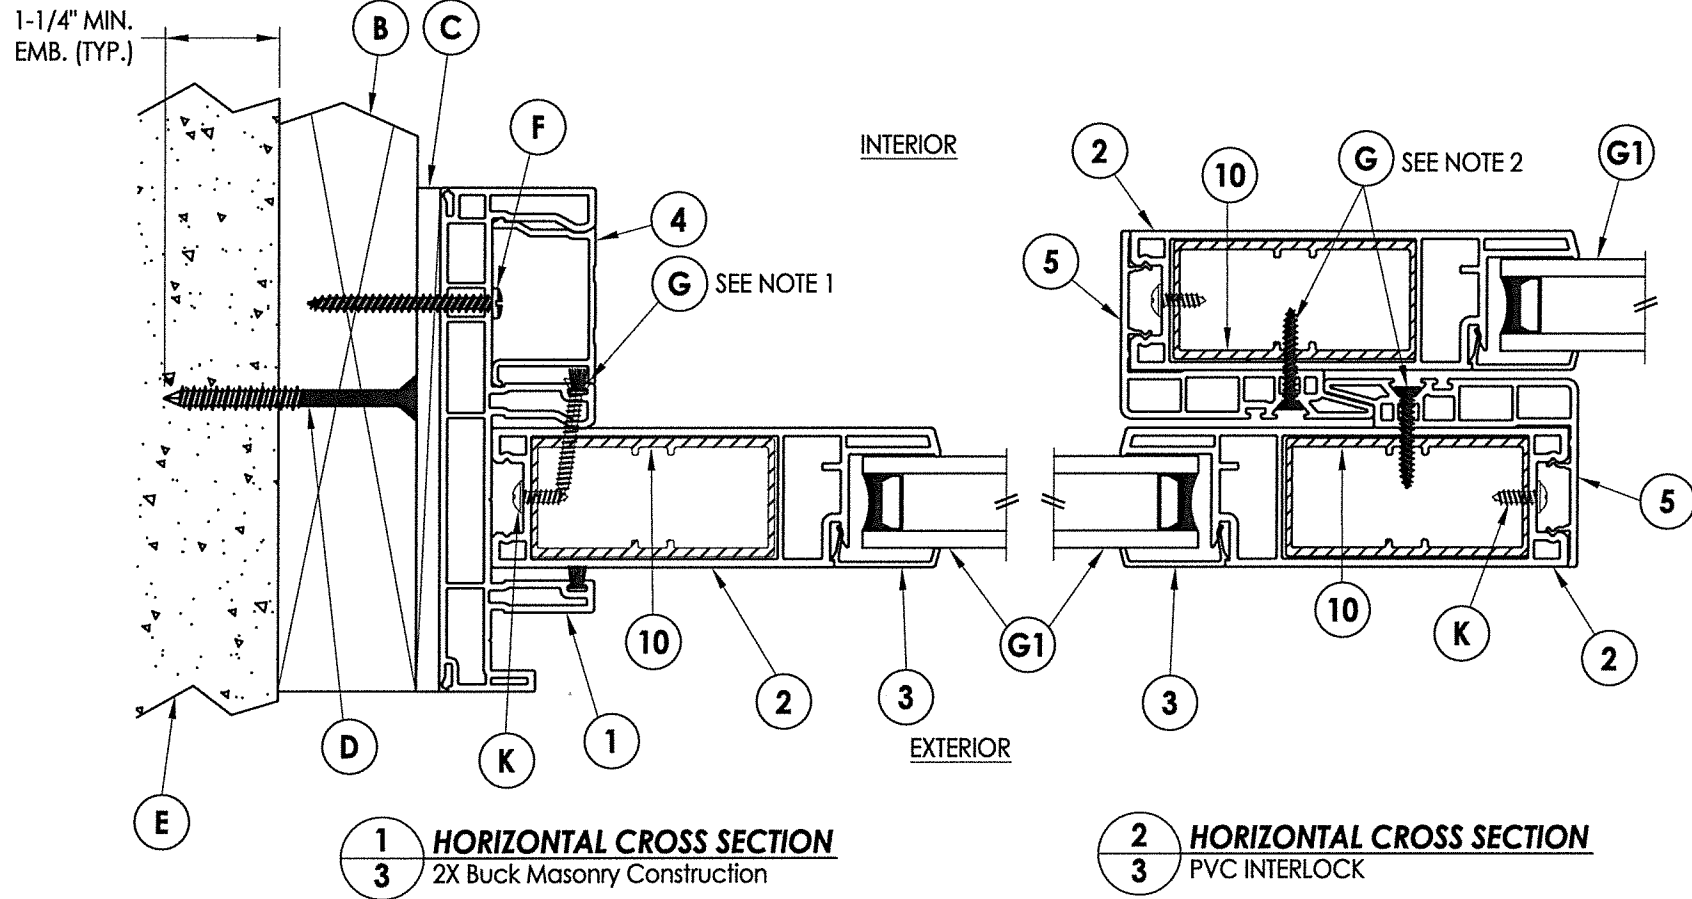

- NOTES:
- Item #G located 6" from each end then 4 more equally spaced (6 total).
 - Item #G located 3" from each end then 8 more equally spaced (10 total).
 - Item #H located 6" from each end and 12" o.c. (8 total).

07/29/2020

Lyndon F. Schmidt
P.E. No. 43409

STATE OF FLORIDA
PROFESSIONAL ENGINEER
No. 43409

Building Consultants, Inc.
P.O. Box 230, Valrico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

PRODUCT: NewSouth

PART OR ASSEMBLY: HORIZONTAL CROSS SECTIONS

NO.	DATE	REVISIONS
1	7/29/20	UPDATE TO 7th ED. (2020) FBC

DATE: 1/29/18

SCALE: N.T.S.

DWG. BY: JK


CHK. BY: LFS

DRAWING NO.: FL-15449.12


SHEET 3 OF 8

© 2018 R.W. BUILDING CONSULTANTS INC.


\\dc01\rbw\clients\New South Windows PERMANENT\A - Florida Product Approvals\FL 15449 Sliding Door\C - Drawings\FL-15449 (2020) R5\FL-15449.12.dwg

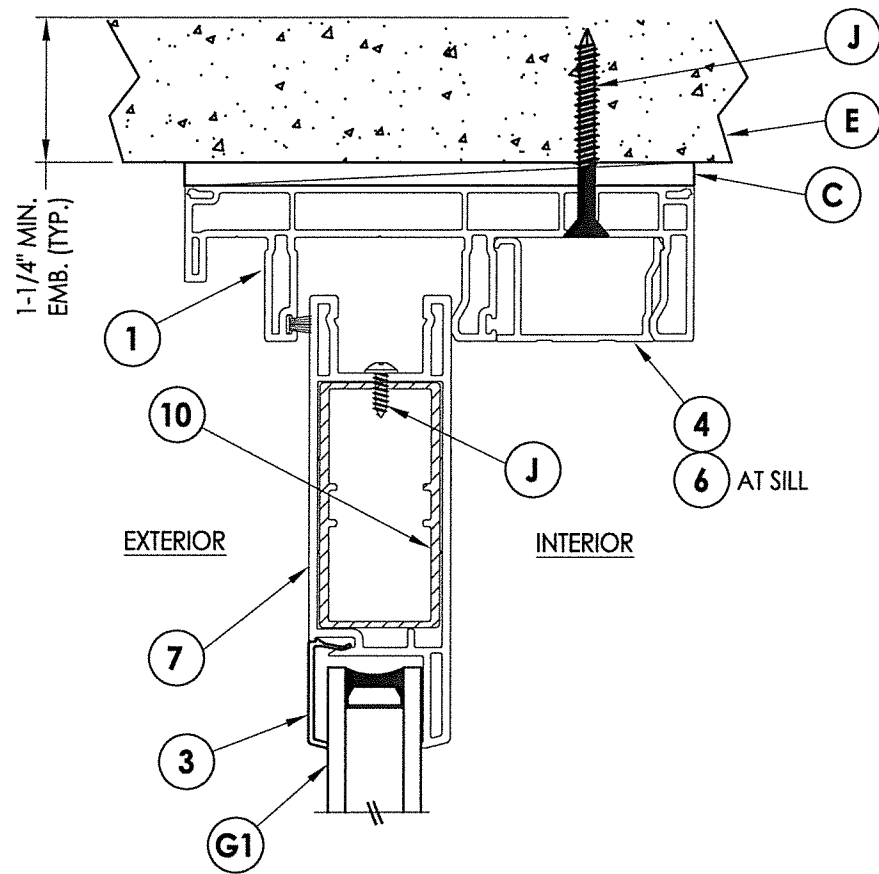


1
4 **VERTICAL CROSS SECTION**
Direct to Masonry Construction

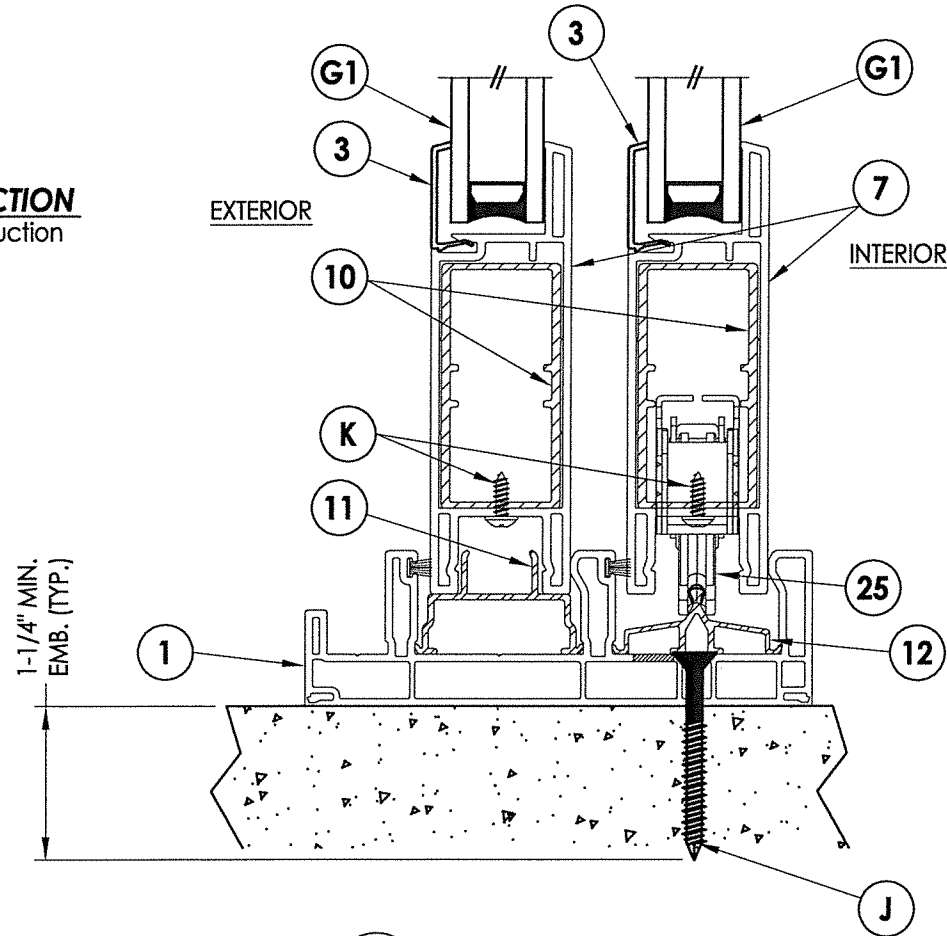

3
4 **VERTICAL CROSS SECTION**

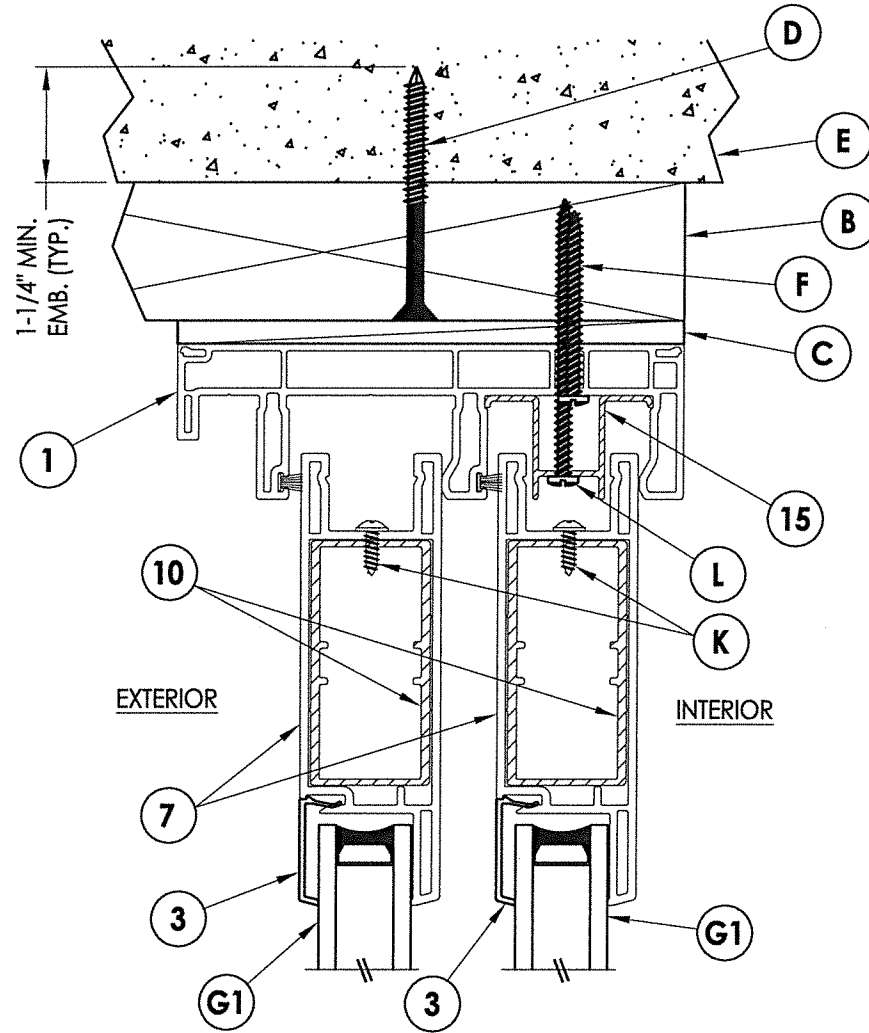

2
4 **VERTICAL CROSS SECTION**
2X Buck Masonry Construction

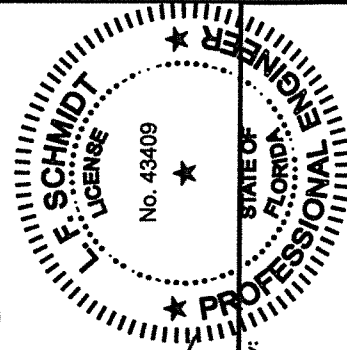

07/29/2020

Documents Prepared By:
Lyndon F. Schmidt
P.E. No. 43409

R.W. BUILDING CONSULTANTS, INC.
P.O. Box 230, Valrico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

PRODUCT: NewSouth

PART OR ASSEMBLY:
VERTICAL
CROSS SECTIONS

NO.	DATE	REVISIONS
1	7/29/20	UPDATE TO 7th ED. (2020) FBC
		DAC
		BY

DATE: 1/29/18

SCALE: N.T.S.


DWG. BY: JK

CHK. BY: LFS

DRAWING NO.:
FL-15449.12

SHEET 4 OF 8

©2010 R.W. BUILDING CONSULTANTS INC.

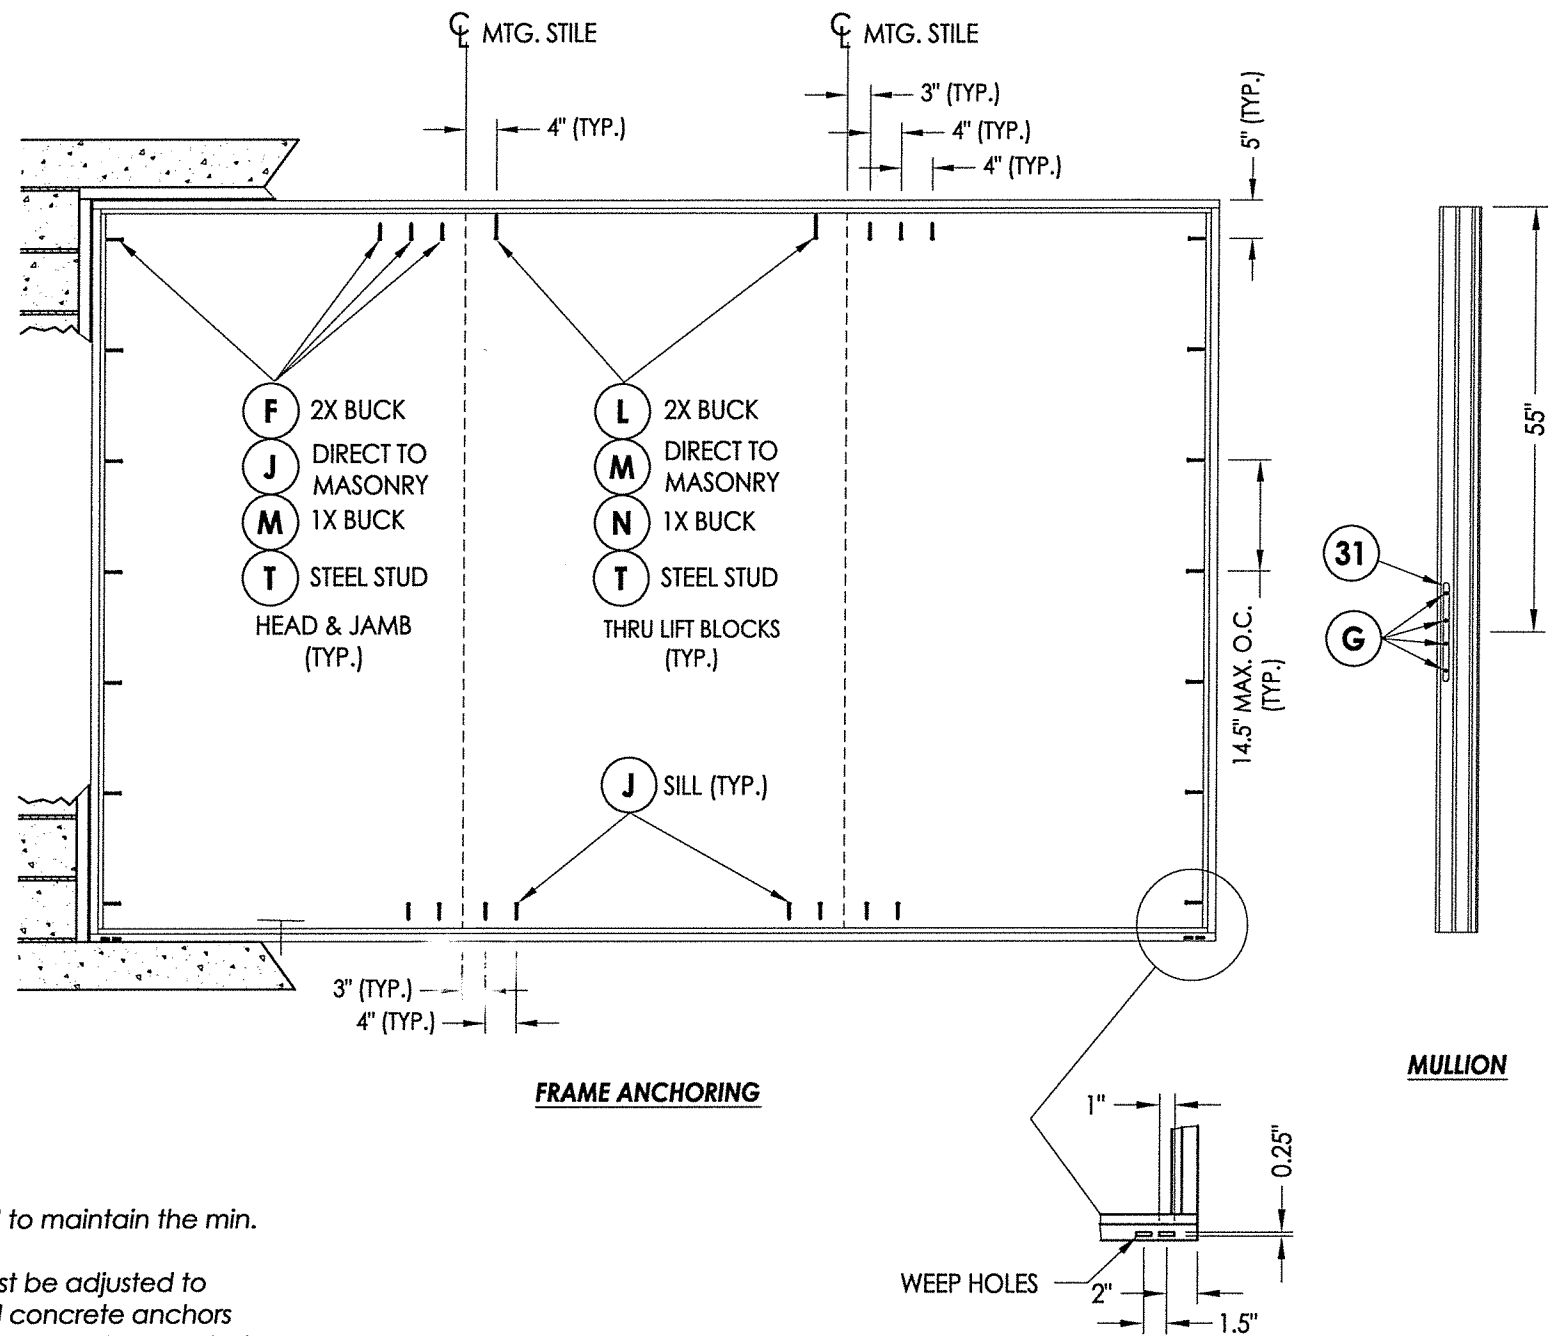


CONCRETE ANCHOR NOTES:


1. Concrete anchor locations at the corners may be adjusted to maintain the min. edge distance to mortar joints.
2. Concrete anchor locations noted as "MAX. ON CENTER" must be adjusted to maintain the min. edge distance to mortar joints, additional concrete anchors may be required to ensure the "MAX. ON CENTER" dimension are not exceeded.
3. Concrete anchor table:

ANCHOR TYPE	ANCHOR SIZE	MIN. EMBEDMENT	MIN. CLEARANCE TO MASONRY EDGE	MIN. CLEARANCE TO ADJACENT ANCHOR
ITW TAPCON®	1/4"	1-1/4"	2"	4"
ELCO ULTRACON®	1/4"	1-1/4"	1"	4"


WOOD SCREW INSTALLATION NOTES:

1. Maintain a minimum 5/8" edge distance, 1" end distance, & 1" o.c. spacing of wood screws to prevent the splitting of wood.

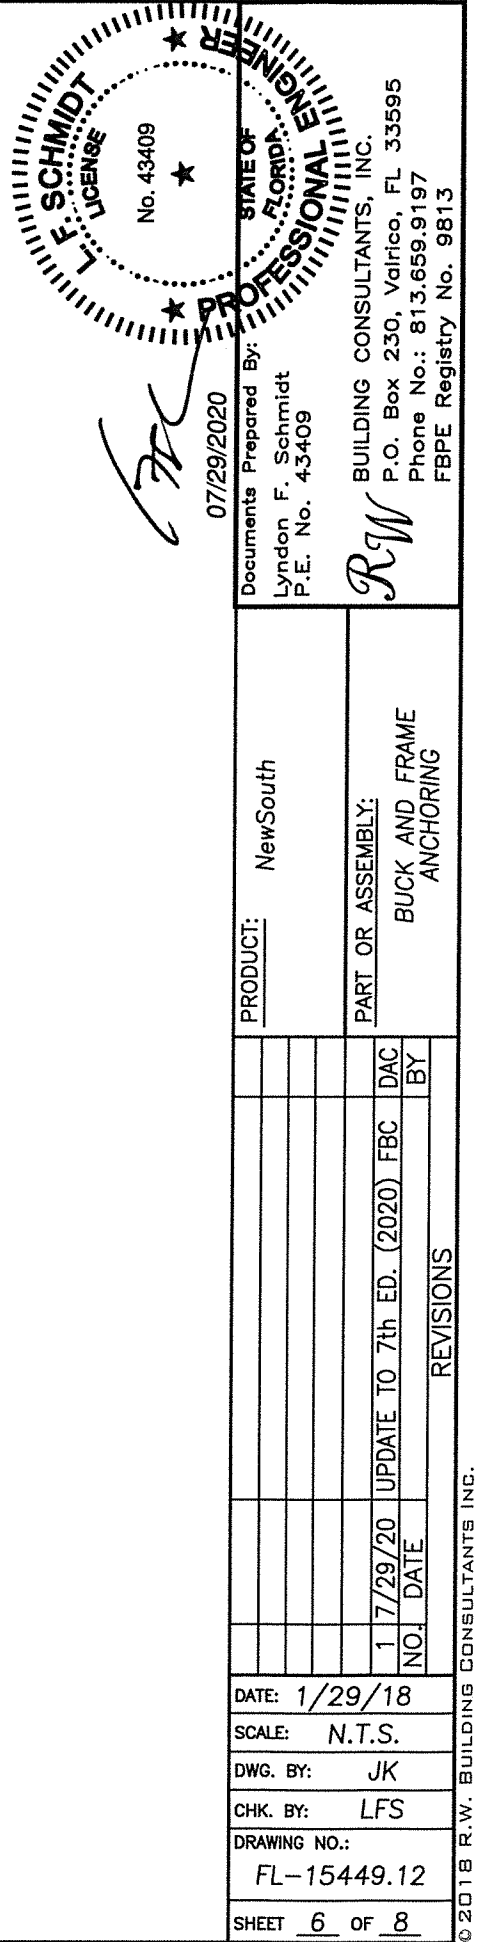


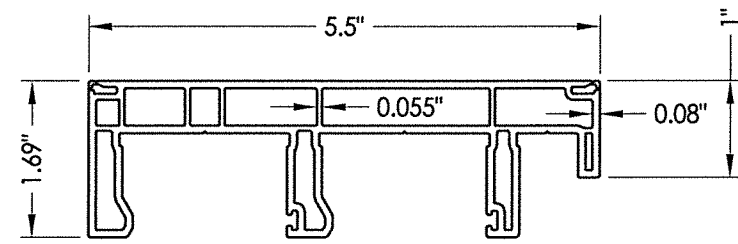


① FRAME
8572-356-D60

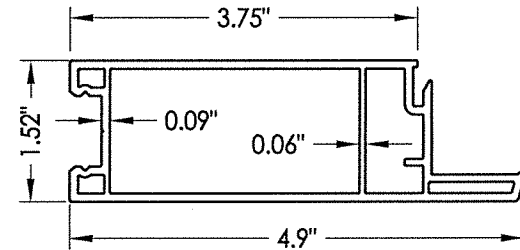


② STILE
8567-356-D54

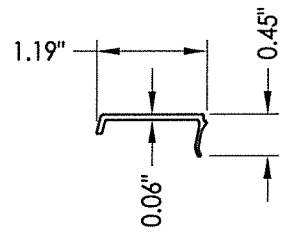


3 GLAZING BEAD
8570-356-D57

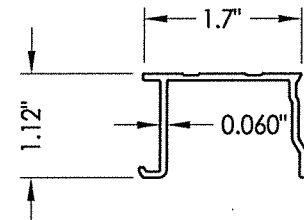


4 **FRAME CAP**
8571-356-D58

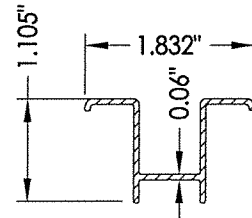


15 ANTI-LIFT-OUT BLOCKS

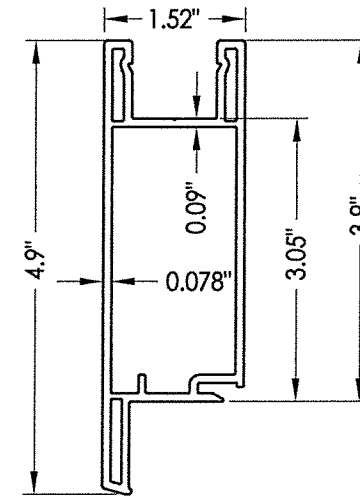


7 TOP AND BOTTOM RAIL
8568-356-D55

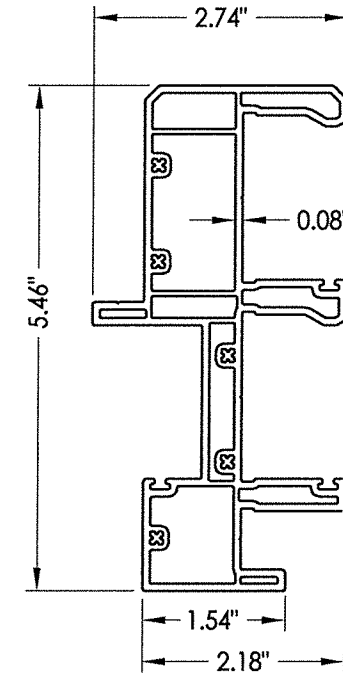


21 MULLION
356-A61

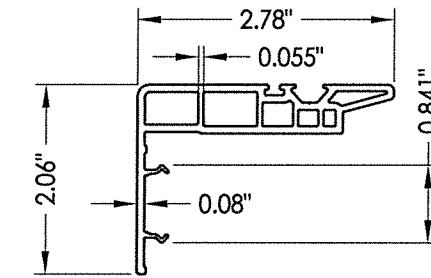


5 INTERLOCK
8573-356-D63

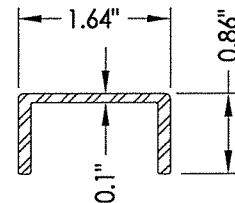


22 REINFORCEMENT
356-A61-A

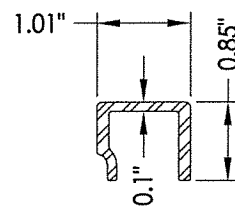


23 REINFORCEMENT
356-A61-B

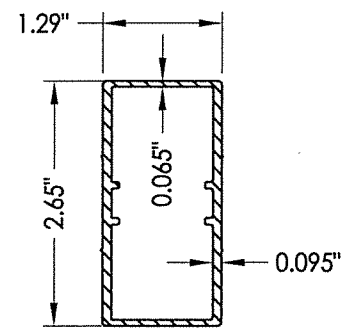


10 REINFORCEMENT
356-A54-55

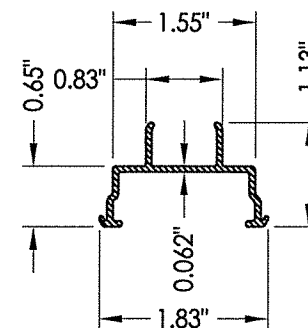

11 **FIXED TRACK**
356-A65

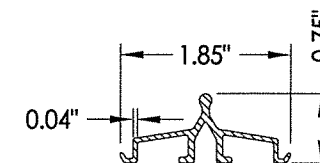

12 ROLLER TRACK
356-A51-52-TRK

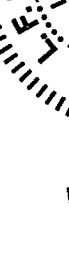

07/29/2020

Documents Prepared By:

Lyndon F. Schmidt

P.E. No. 43409

STATE OF FLORIDA

PROFESSIONAL ENGINEER

RW BUILDING CONSULTANTS, INC.

P.O. Box 230, Valrico, FL 33595

Phone No.: 813.659.9197

FBPE Registry No. 9813

PRODUCT:		New South	
PART OR ASSEMBLY:		COMPONENTS	
DATE: 1/29/18		SCALE: N.T.S.	
DWG. BY: JK		CHK. BY: LFS	
DRAWING NO.: FL-15449.12		SHEET 7 OF 8	
NO. DATE		REVISIONS	
1	7/29/20	UPDATE TO 7th ED. (2020)	FBC DAC BY

