

MILLWORK ARTISANS

145 KING STREET
CHARLESTON, SC 29401


ARCH DOUBLE HUNG WINDOW

"IMPACT"


GENERAL NOTES

1. This product has been evaluated and is in compliance with the 8th Edition (2023) Florida Building Code (FBC) structural requirements including the "High Velocity Hurricane Zone" (HVHZ).
2. Product anchors shall be as listed and spaced as shown on details. Anchor embedment to base material shall be beyond wall dressing or stucco.
3. When used in the "HVHZ" this product complies with FBC Section 1626 and does not require an impact resistant covering.
4. For 2x stud framing construction, anchoring of these units shall be the same as that shown for 2x buck masonry construction.
5. All window frame wood to be Sapele (Specific Gravity = 0.55).
6. Site conditions that deviate from the details of this drawing require further engineering analysis by a licensed engineer or registered architect.
7. This product meets water infiltration requirements for "HVHZ".

TABLE OF CONTENTS	
SHEET #	DESCRIPTION
1	Typical elevation, design pressures, & general notes
2	Horizontal cross sections
3	Vertical cross sections
4	Frame details
5	Buck and frame anchoring
6	Components
7	Bill of materials, glazing details & components

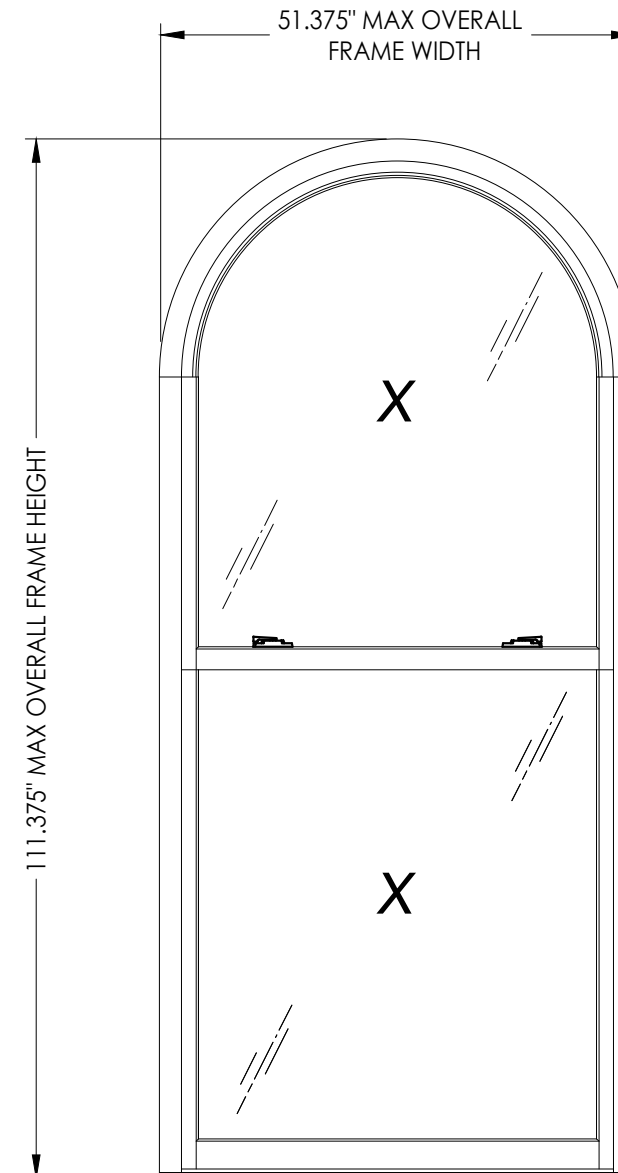

OVERALL FRAME DIMENSION	OVERALL D.L.O. DIMENSION	GLASS TYPE	DESIGN PRESSURE (PSF)	
			POSITIVE	NEGATIVE
51.375" x 111.375"	43.0" x 50.5"	G1	+50.0	-50.0
		G2	+60.0	-65.0

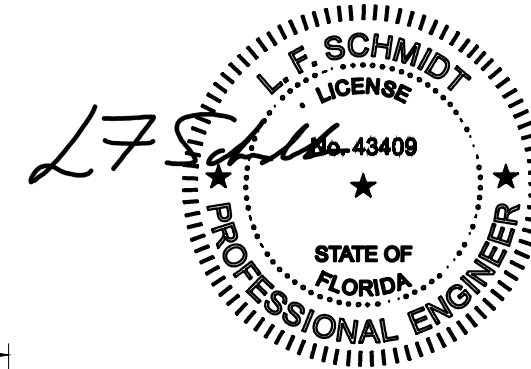

Digitally signed by Lyndon F Schmidt
Date: 2023.09.14 16:50:35 -04'00'

This item has been digitally signed and sealed by
L. F. Schmidt, P.E. on the date adjacent to the seal.

Printed copies of this document are not
considered signed and sealed and the signature
must be verified on any electronic copies.


THIS PRODUCT APPROVAL IS VALID
ONLY FOR THE STATE OF FLORIDA

[illegible]


© 2014 R.W. BUILDING CONSULTANTS INC.

Z:\2023 FBC Drawings\Millwork Artisans, LLC\FL-17038 R5\FL-17038.1-13.dwg


Z:\2023 FBC Drawings\Millwork Artisans, LLC\FL-17038 R5\FL-17038.1-13.dwg

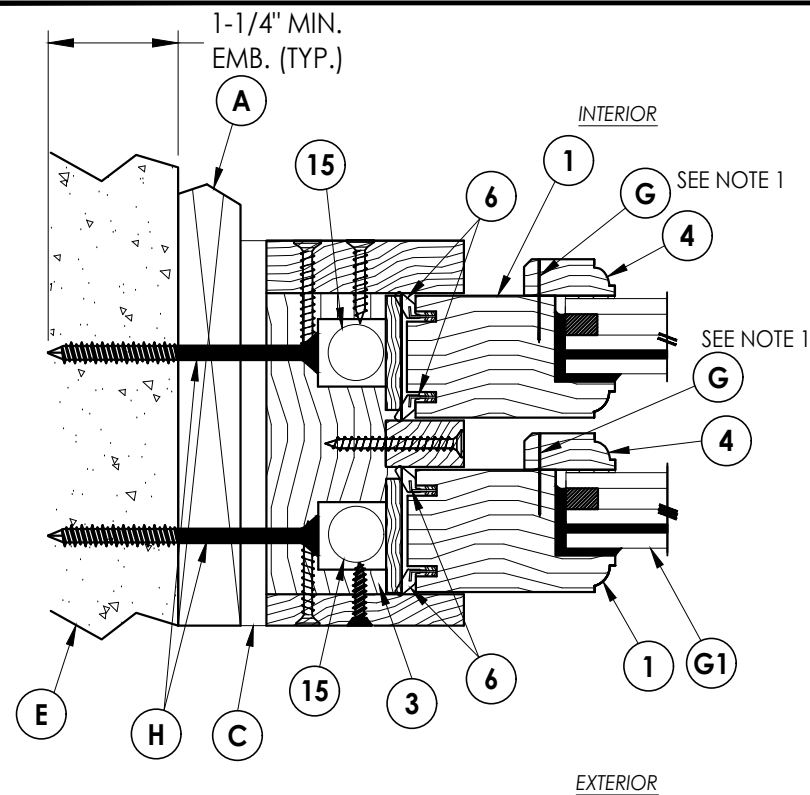


1 **HORIZONTAL CROSS SECTION**
2 1X Buck Construction
(Thru-the-Frame Installation)

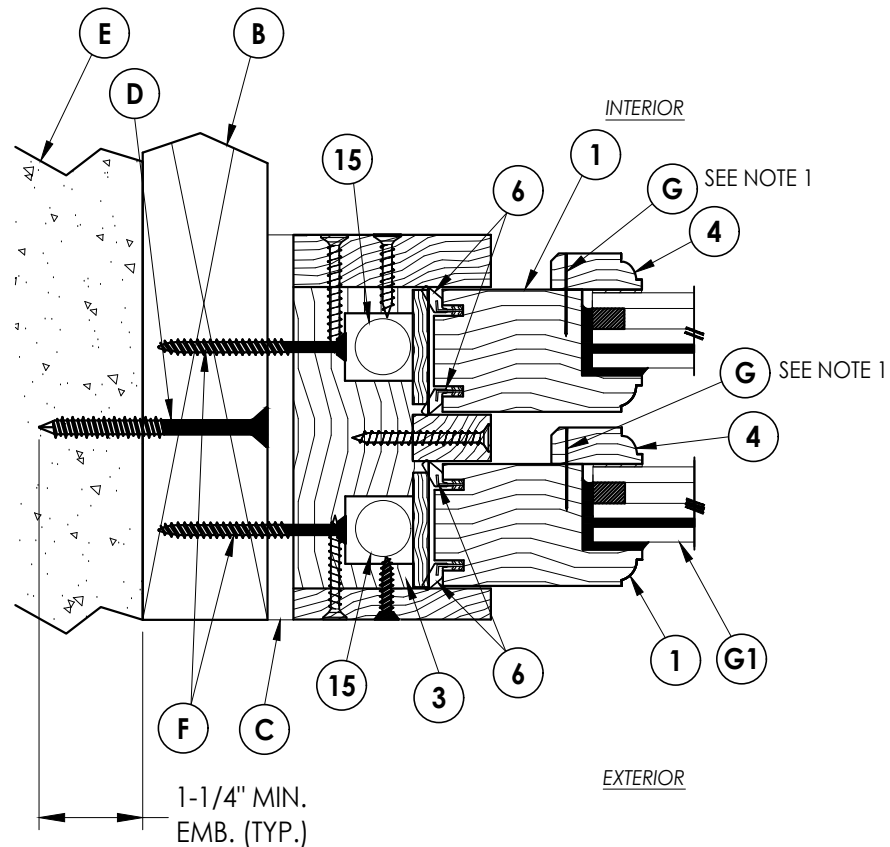

2 **HORIZONTAL CROSS SECTION**
2 2X Buck Construction
(Thru-the-Frame Installation)

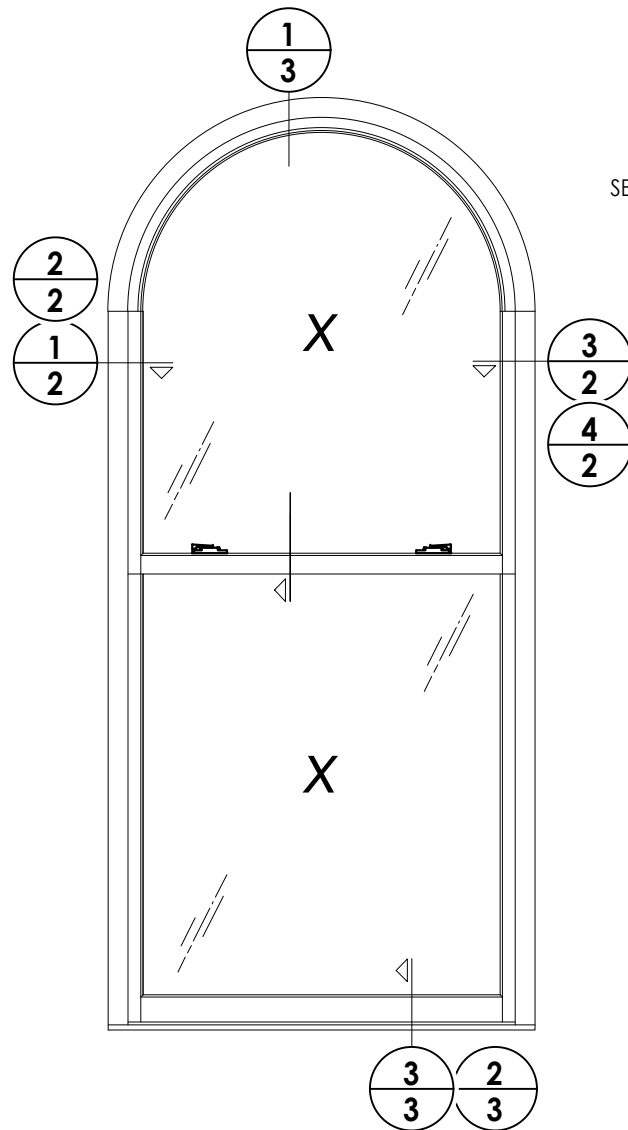

3 **HORIZONTAL CROSS SECTION**
2 2X Buck Construction
(Anchor Clip Installation)

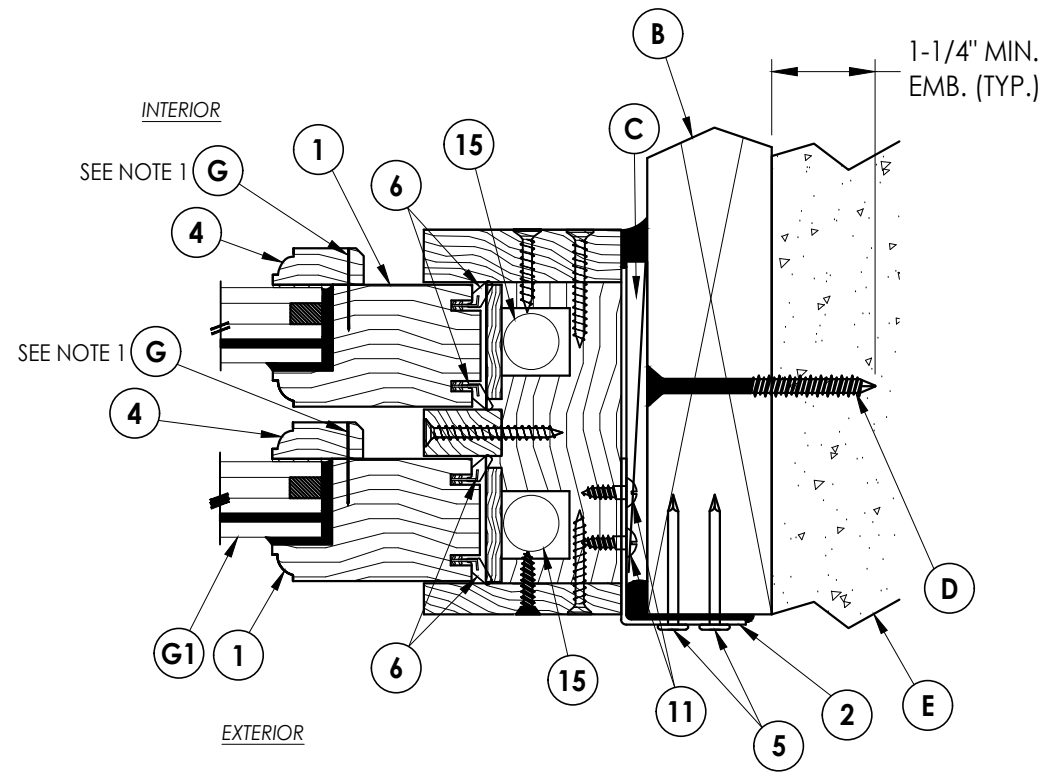

4 **HORIZONTAL CROSS SECTION**
2 2X Buck Construction
(Anchor Clip Installation)

NOTE:
1. Item #G located 1" from each end
then 10" on center.

Documents Prepared By:
Lyndon F. Schmidt
P.E. No. 43409

RW BUILDING CONSULTANTS, INC.
P.O. Box 230, Valrico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

PRODUCT:
MILLWORK ARTISANS
DOUBLE HUNG WINDOW

PART OR ASSEMBLY:
HORIZONTAL CROSS SECTIONS

NO.	DATE	REVISIONS
4	9/14/23	UPDATE TO 8TH ED. (2023) FBC LFS
3	9/29/20	UPDATE TO 7TH ED. (2020) FBC LFS
2	10/3/17	UPDATE TO 6TH ED. (2017) FBC JK
1	3/03/15	UPDATE TO 5TH ED. (2014) FBC JK

DATE: 5/7/14

SCALE: N.T.S.

DWG. BY: JK


CHK. BY: LFS

DRAWING NO.:



FL-17038.7

SHEET 2 OF 7

Z:\2023 FBC Drawings\Millwork Artisans, LLC\FL-17038 R5\FL-17038.1-13.dwg

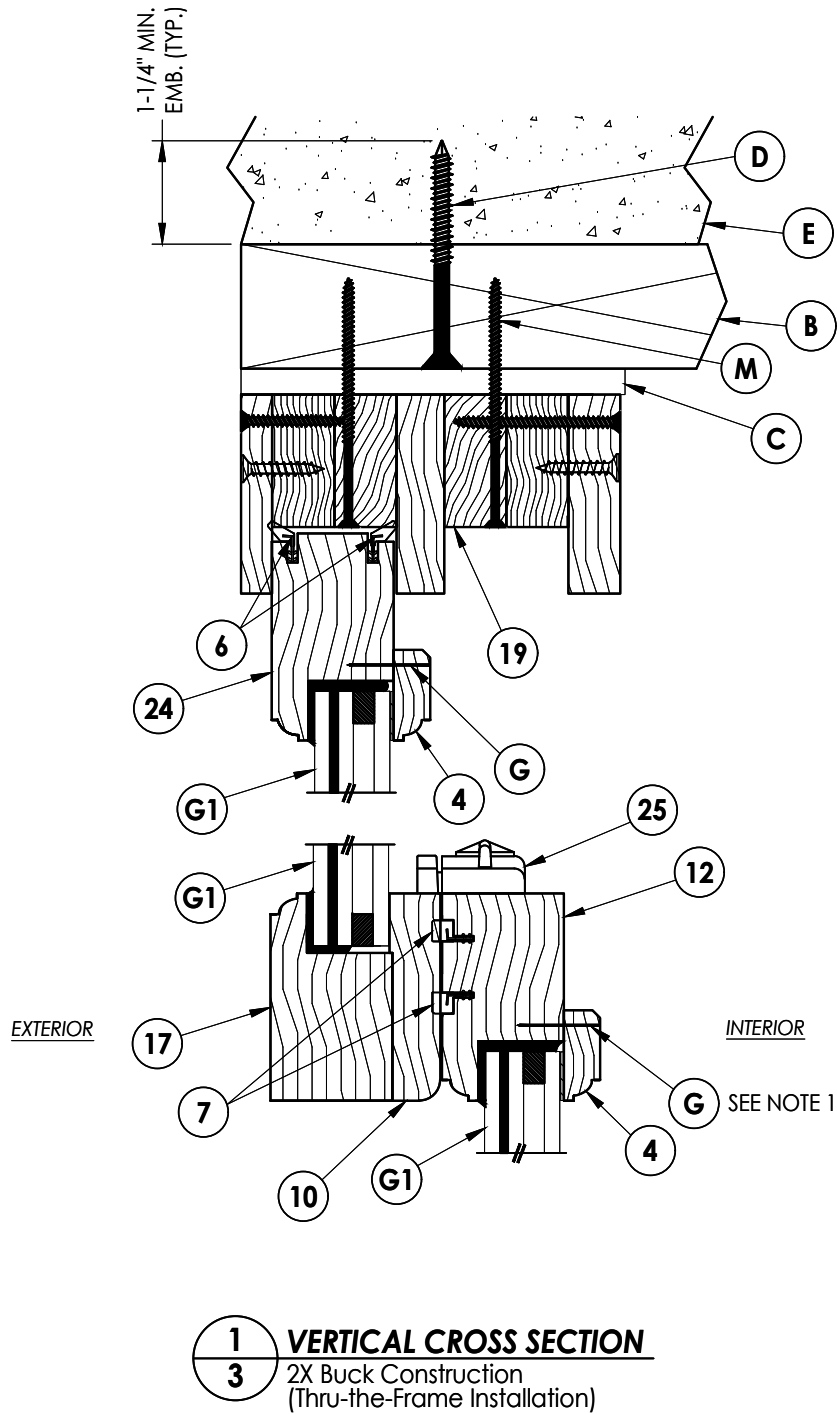

NOTE:
1. Item #G located 1" from each end
then 10" on center.

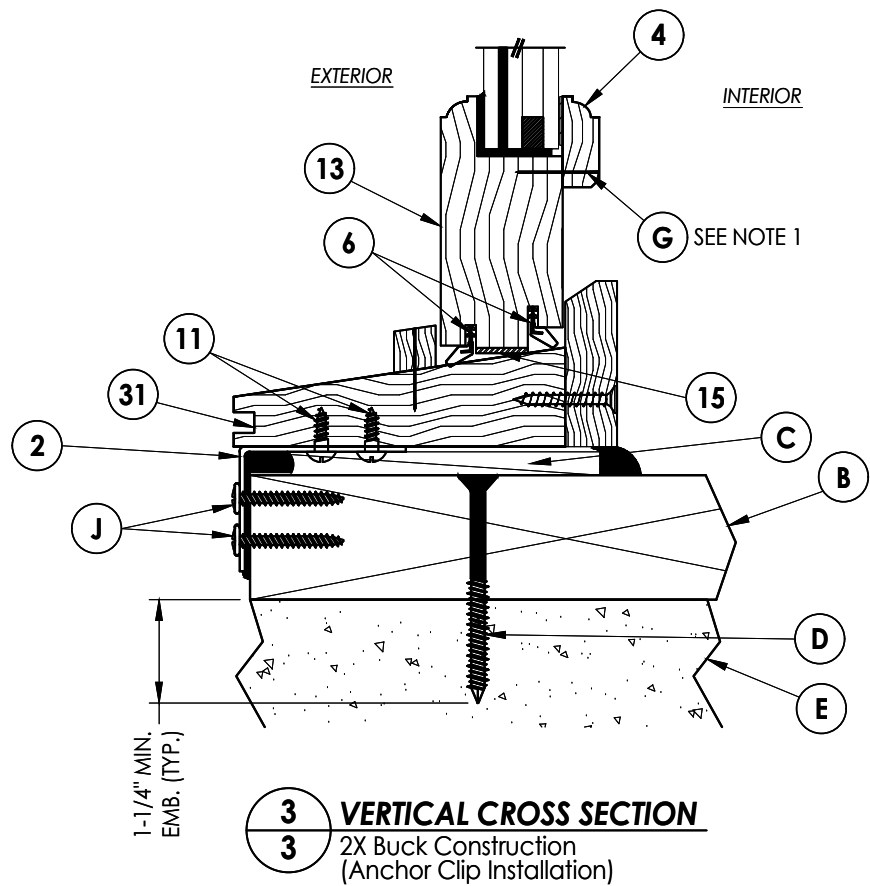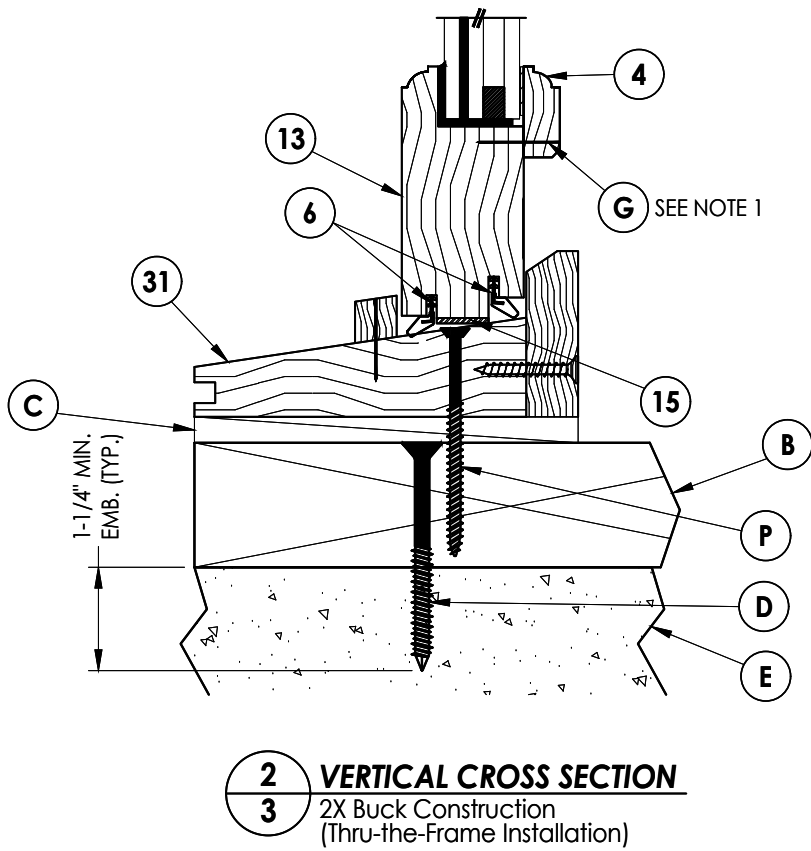

Documents Prepared By:
Lyndon F. Schmidt
P.E. No. 43409

PRODUCT:
MILLWORK ARTISANS
DOUBLE HUNG WINDOW

RW BUILDING CONSULTANTS, INC.
P.O. Box 230, Valrico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

PART OR ASSEMBLY:
VERTICAL CROSS SECTIONS

DATE: 5/7/14

SCALE: N.T.S.

DWG. BY: JK

CHK. BY: LFS


DRAWING NO.:

FL-17038.7


SHEET 3 OF 7

© 2014 R.W. BUILDING CONSULTANTS INC.


Z:\2023 FBC Drawings\Millwork Artisans, LLC\FL-17038 R5\FL-17038.1-13.dwg

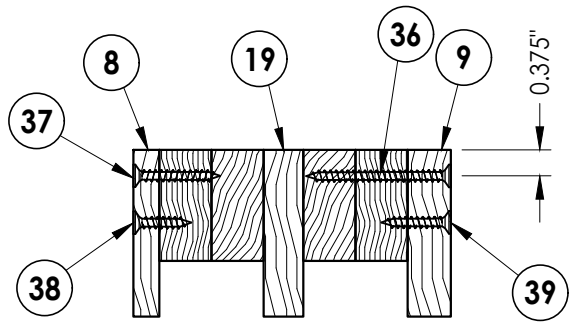





SECTION A-A

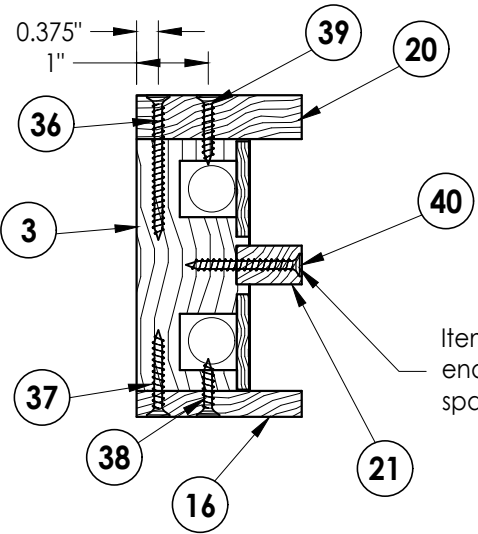

SECTION C-C

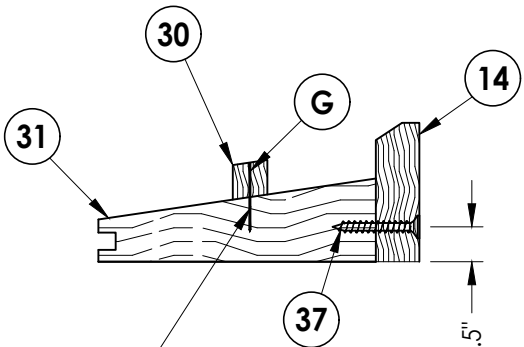

SECTION B-B

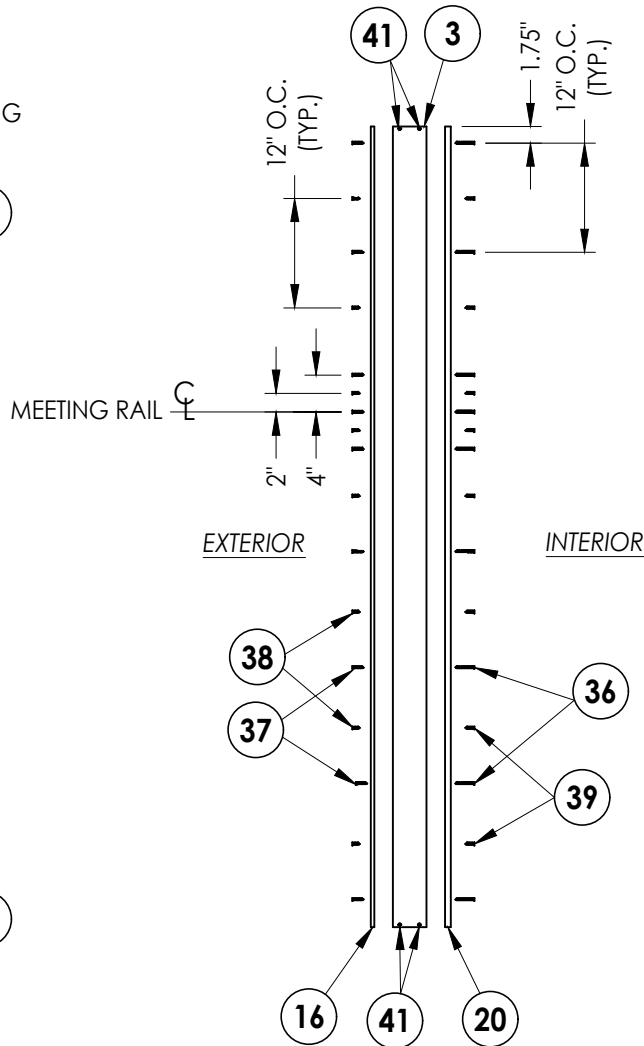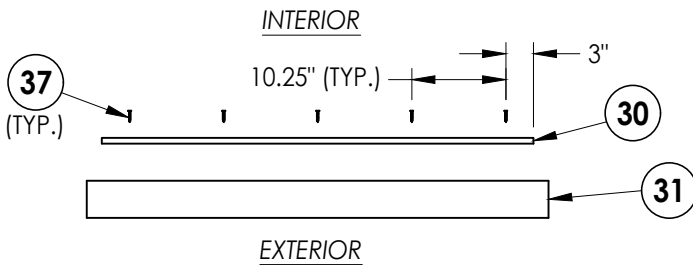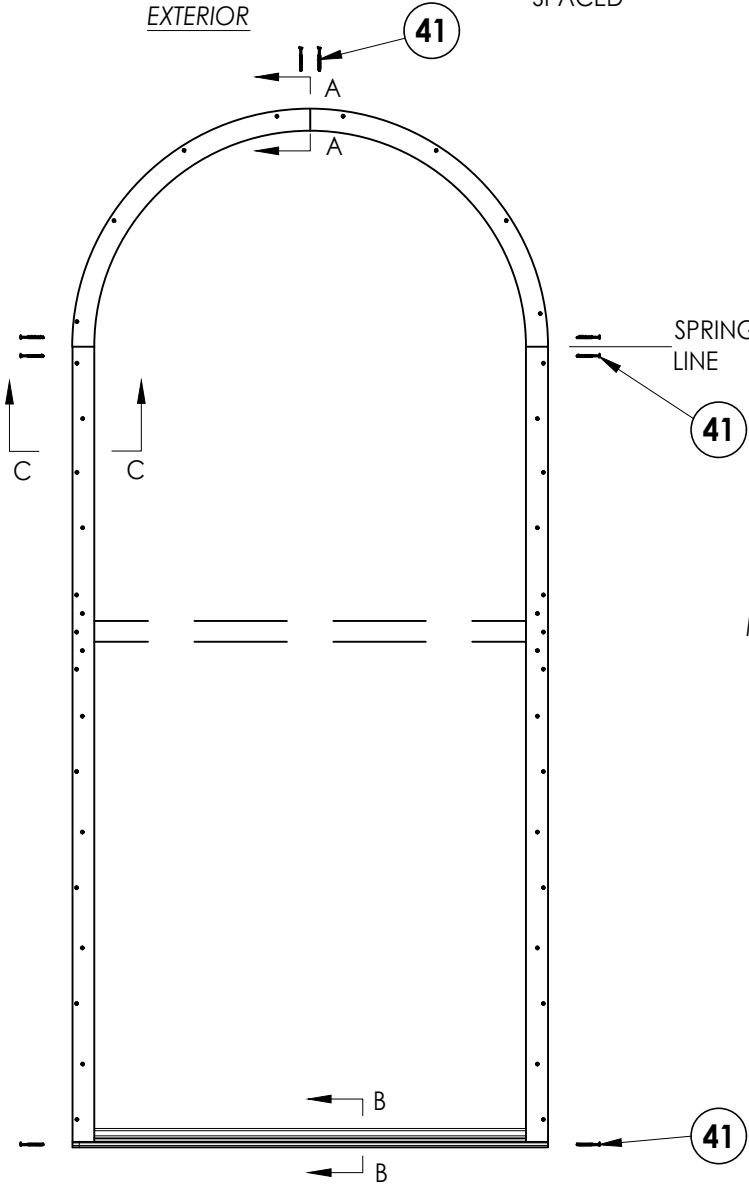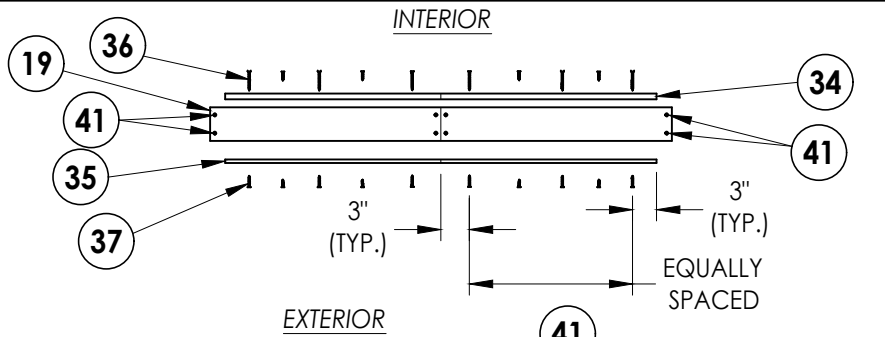

Documents Prepared By:
Lyndon F. Schmidt
P.E. No. 43409

RW BUILDING CONSULTANTS, INC.
P.O. Box 230, Vairico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

PRODUCT:
MILLWORK ARTISANS
DOUBLE HUNG WINDOW

PART OR ASSEMBLY:
FRAME DETAILS

NO.	DATE	REVISIONS
4	9/14/23	UPDATE TO 8TH ED. (2023) FBC LFS
3	9/29/20	UPDATE TO 7TH ED. (2020) FBC LFS
2	10/3/17	UPDATE TO 6TH ED. (2017) FBC JK
1	3/03/15	UPDATE TO 5TH ED. (2014) FBC JK

DATE: 5/7/14

SCALE: N.T.S.

DWG. BY: JK


CHK. BY: LFS

DRAWING NO.:


FL-17038.7

SHEET 4 OF 7


Z:\2023 EBC Drawings\Millwork Artisans - L17038 R5\F1-17038 1-13.dwg

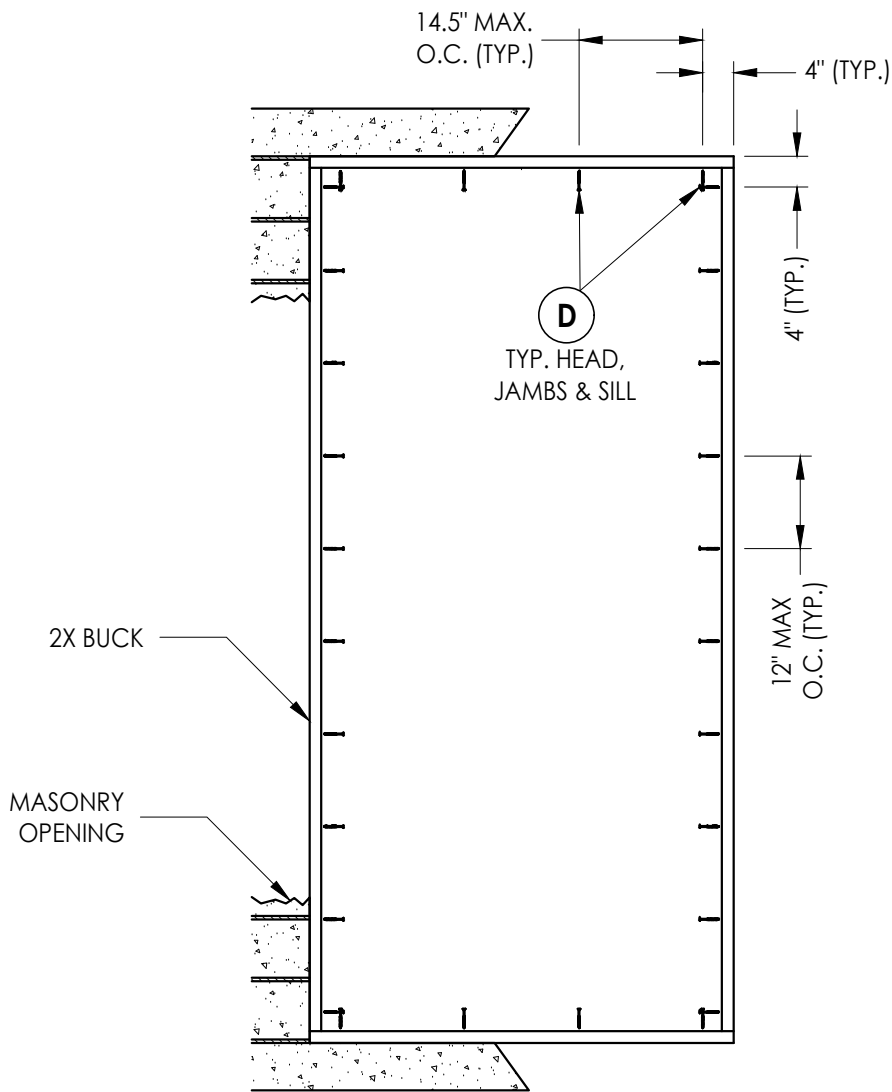

BUCK ANCHORING
Masonry construction

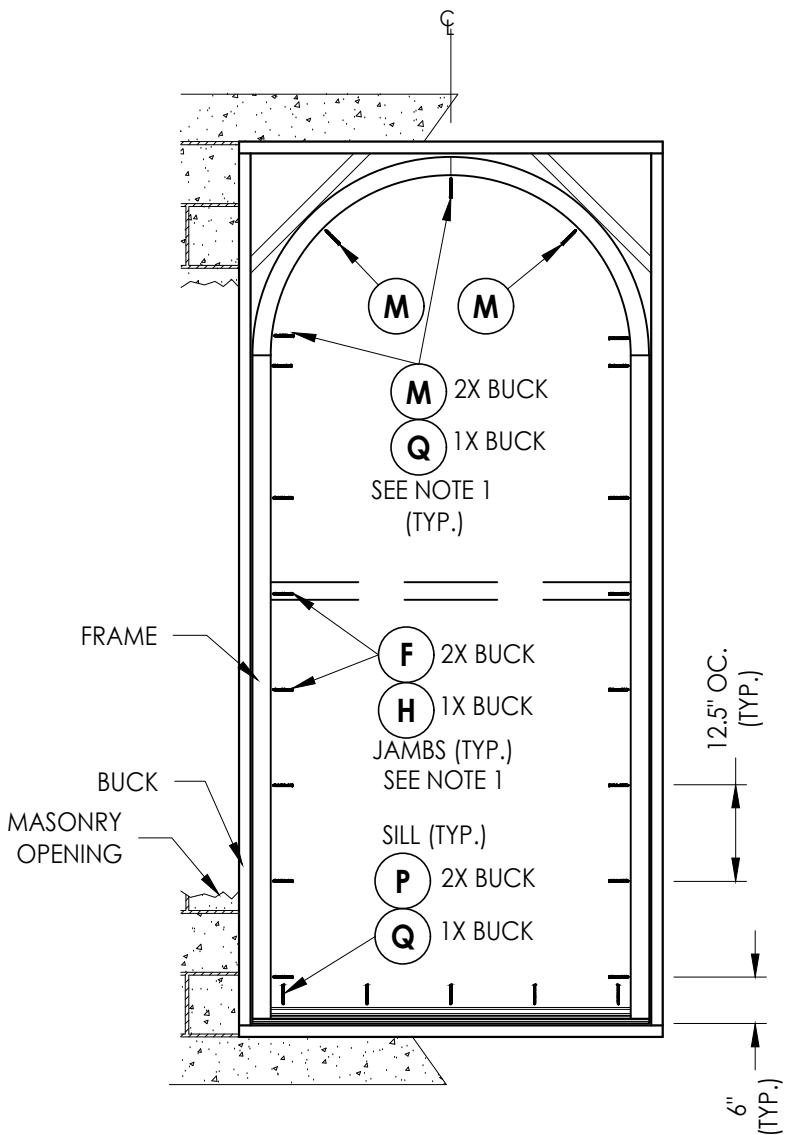

FRAME ANCHORING
(Thru-the-Frame Installation)

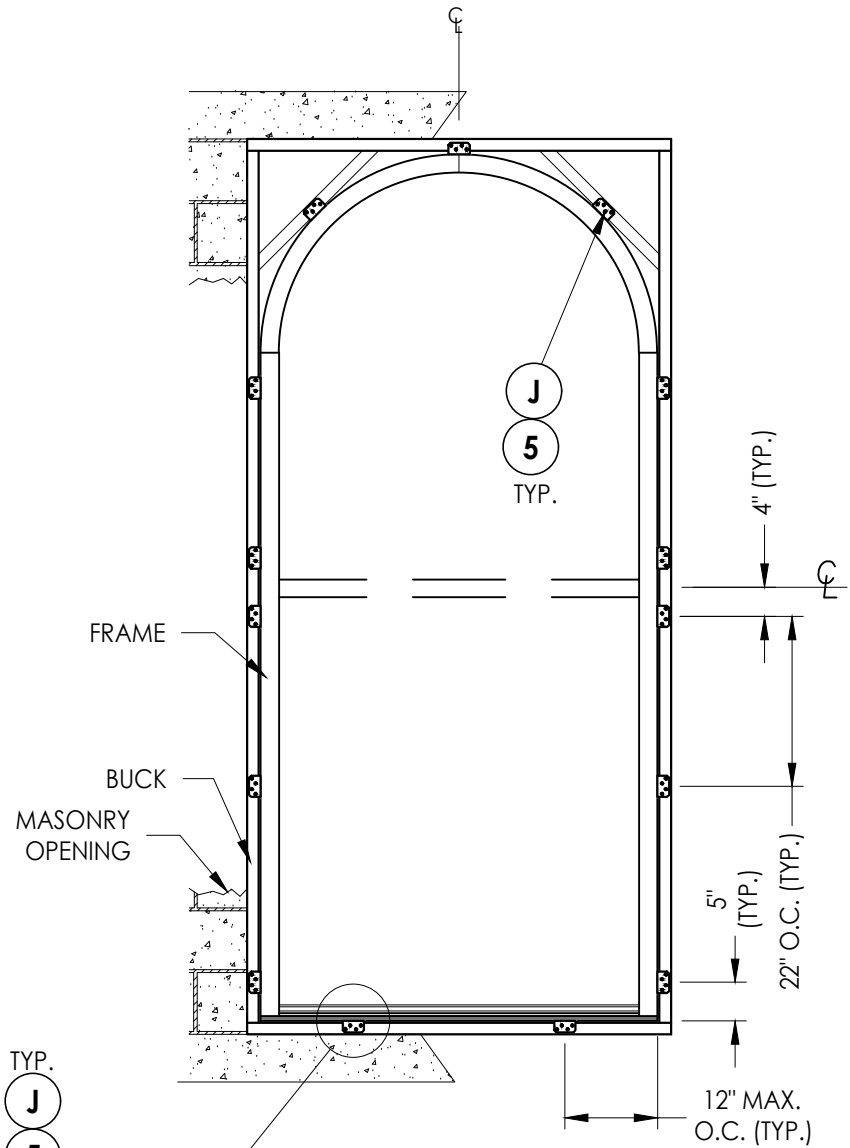

FRAME ANCHORING
(Anchor Clip Installation)

CONCRETE ANCHOR NOTES:

- Concrete anchor locations at the corners may be adjusted to maintain the min. edge distance to mortar joints.
- Concrete anchor locations noted as "MAX. ON CENTER" must be adjusted to maintain the min. edge distance to mortar joints, additional concrete anchors may be required to ensure the "MAX. ON CENTER" dimension are not exceeded.
- Concrete anchor table:

ANCHOR TYPE	ANCHOR SIZE	MIN. EMBEDMENT	MIN. CLEARANCE TO MASONRY EDGE	MIN. CLEARANCE TO ADJACENT ANCHOR
ITW BUILDEX TAPCON®	1/4"	1-1/4"	2"	4"
DeWALT ULTRA CON®	1/4"	1-1/4"	1"	4"

WOOD SCREW/NAIL INSTALLATION NOTES:

- Maintain a minimum 3/8" edge distance, 3/4" end distance, & 3/4" o.c. spacing of wood screws/nails to prevent the splitting of wood.

NOTE:

- Two (2) anchors required at each location shown at jambs. Stagger concrete anchors to maintain 4" min clearance to adjacent anchor.

Documents Prepared By:
Lyndon F. Schmidt
P.E. No. 43409

RW BUILDING CONSULTANTS, INC.

P.O. Box 230, Valrico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

PRODUCT:
MILLWORK ARTISANS
DOUBLE HUNG WINDOW

PART OR ASSEMBLY:
BUCK & FRAME ANCHORING

						REVISIONS	
						NO.	DATE
4	9/14/23	UPDATE TO 8TH ED. (2023)	FBC	LFS			
3	9/29/20	UPDATE TO 7TH ED. (2020)	FBC	LFS			
2	10/3/17	UPDATE TO 6TH ED. (2017)	FBC	JK			
1	3/03/15	UPDATE TO 5TH ED. (2014)	FBC	JK			

DATE: 5/7/14

SCALE: N.T.S.

DWG. BY: JK


CHK. BY: LFS

DRAWING NO.:


FL-17038.7

SHEET 5 OF 7


Z:\2023 FBC Drawings\Millwork Artisans, LLC\FL-17038 R5\FL-17038.1-13.dwg

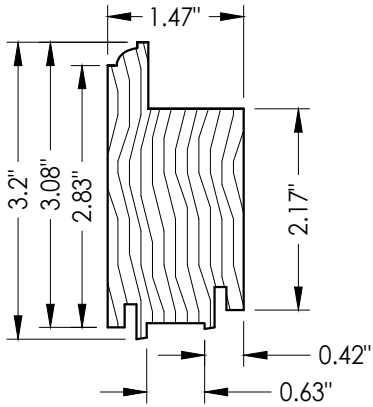


13 BOTTOM RAIL
Bottom sash

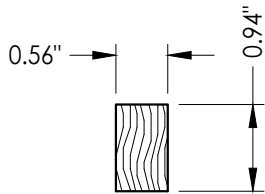


21 PARTING STOP

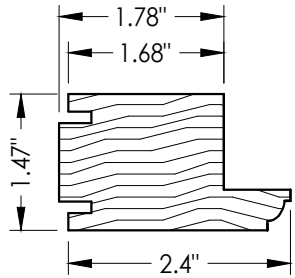


1 SASH STILE

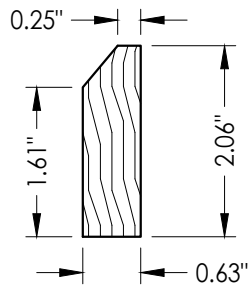


14 SILL EXTENDER

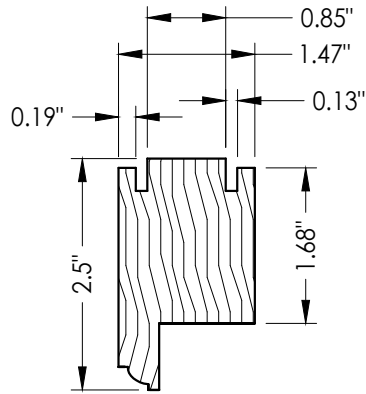


24 TOP RAIL
Top sash

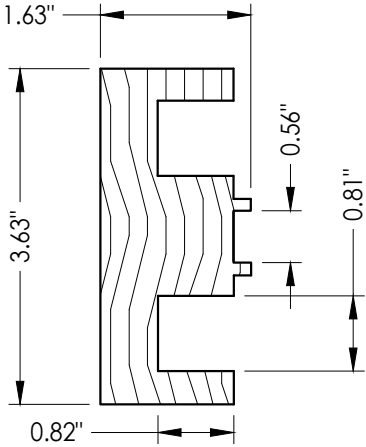


3 JAMB

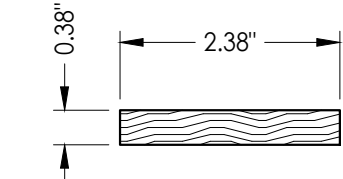


16 JAMB EXTERIOR SASH STOP

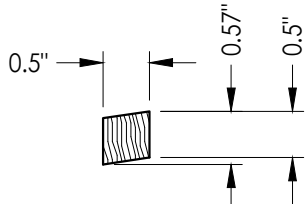


30 BOTTOM RAIL STOP

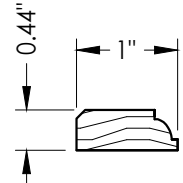


4 GLAZING BEAD

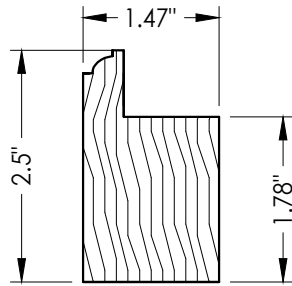


17 BOTTOM RAIL
Top sash

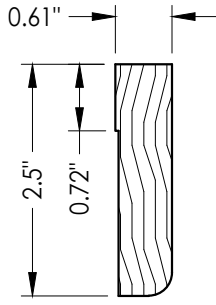


10 MEETING RAIL

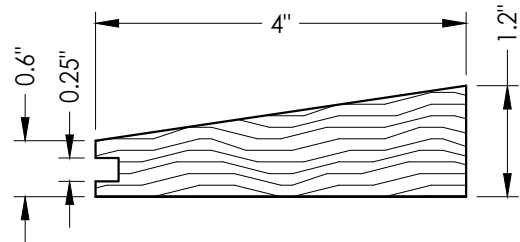

31 SILL

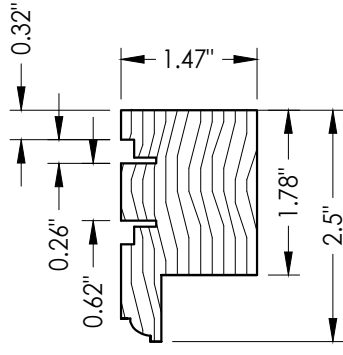

12 TOP RAIL
Bottom sash

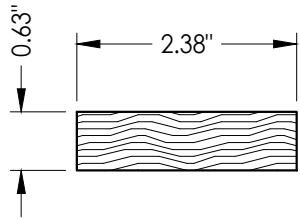

20 JAMB INTERIOR SASH STOP

DATE: 5/7/14

SCALE: N.T.S.

DWG. BY: JK

CHK. BY: LFS

DRAWING NO.:

FL-17038.7

SHEET 6 OF 7

PRODUCT:
MILLWORK ARTISANS
DOUBLE HUNG WINDOW






Documents Prepared By:
Lyndon F. Schmidt
P.E. No. 43409

PART OR ASSEMBLY:
COMPONENTS

RW BUILDING CONSULTANTS, INC.
P.O. Box 230, Valrico, FL 33595
Phone No.: 813.659.9197
FBPE Registry No. 9813

© 2014 R.W. BUILDING CONSULTANTS INC.

BILL OF MATERIALS		
ITEM #	DESCRIPTION	MATERIAL
A	1X BUCK G >= 0.42	
B	2X BUCK G >= 0.42	WOOD
C	1/4" MAX. SHIM SPACE	-
D	1/4" X 2-3/4" DeWALT OR ITW PFH CONCRETE SCREW	STEEL
E	MASONRY - 3,000 PSI MIN. CONCRETE CONFORMING TO ACI 301 OR HOLLOW BLOCK CONFORMING TO ASTM C90	CONCRETE
F	#10 X 2-1/4" PFH WOOD SCREW (1-5/16" MIN. EMBEDMENT)	STEEL
G	23GA X 1" BRAD	STEEL
H	1/4" X 3-1/4" DeWALT OR ITW PFH CONCRETE SCREW	STEEL
J	#8 X 1-1/2" WAFER HEAD SMS (1-3/8" MIN. EMBEDMENT)	STEEL
M	#10 X 3" PFH WOOD SCREW (1-1/8" MIN. EMBEDMENT)	STEEL
P	#10 X 2-3/4" PFH WOOD SCREW (1-3/8" MIN. EMBEDMENT)	STEEL
Q	1/4" X 4" DeWALT OR ITW PFH CONCRETE SCREW	STEEL
1	SASH STILE	WOOD
2	ANCHOR BRACKET (Simpson Strong-Tie A23Z)	STEEL
3	JAMB	WOOD
4	GLAZING BEAD	WOOD
5	#7 X 1-1/2" GALVANIZED NAIL (1-3/8" MIN. EMBEDMENT)	STEEL
6	WEATHERSTRIP QUEZD250 BY SCHLEGEL	FOAM
7	WEATHERSTRIP QUEZD260 BY SCHLEGEL	FOAM
8	EXTERIOR SASH STOP	WOOD
9	INTERIOR SASH STOP	WOOD
10	MEETING RAIL	WOOD
11	#8 X 3/4" LATH SCREWS	WOOD
12	BOTTOM SASH TOP RAIL	WOOD
13	BOTTOM SASH BOTTOM RAIL	WOOD
14	SILL EXTENDER	WOOD
15	ULTRA-LIFT SPIRAL TUBE BALANCE BY CALDWELL	-
16	EXTERIOR SASH STOP	WOOD
17	TOP SASH BOTTOM RAIL	WOOD
19	FRAME HEADER	WOOD
20	INTERIOR SASH STOP	WOOD
21	PARTING STOP	WOOD
24	TOP SASH TOP RAIL	WOOD
25	GATE HOUSE SASH LOCK, MOD #837773	-
26	EXTERIOR SASH STOP	WOOD
31	SILL	WOOD
36	#8 X 2" PFH WOOD SCREW	STEEL
37	#8 X 1-1/4" PFH WOOD SCREW	STEEL
38	#8 X 3/4" PFH WOOD SCREW	STEEL
39	#8 X 1" PFH WOOD SCREW	STEEL
40	#8 X 1-1/2" PFH WOOD SCREW	STEEL
41	#8 X 2-1/2" PFH WOOD SCREW	STEEL

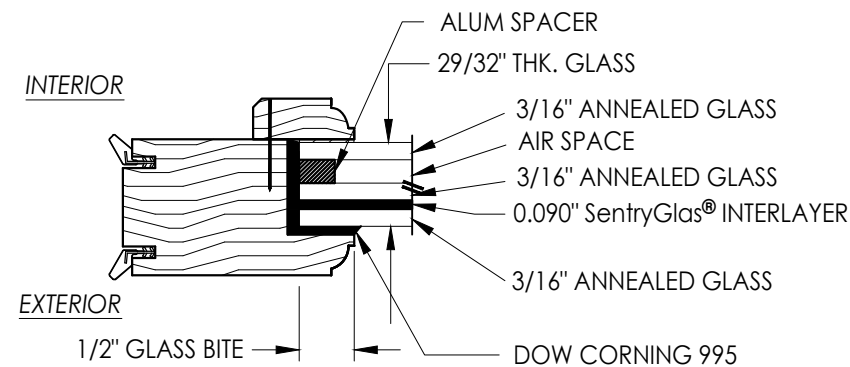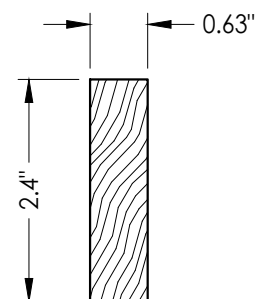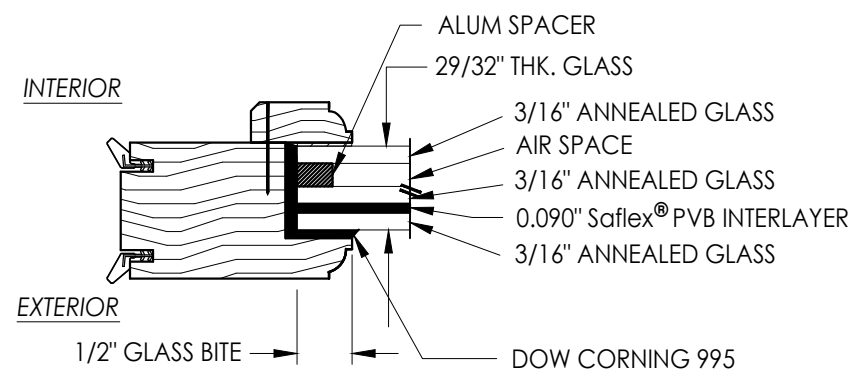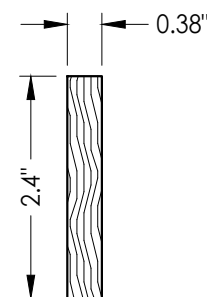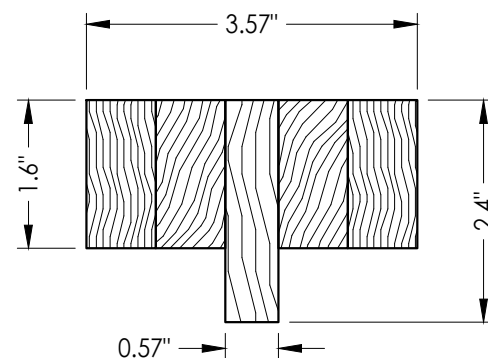

NOTE: GLAZING > 36" WIDE REQUIRES TWO (2) SETTING BLOCKS CONFORMING TO FBC SECTION 2411.3.3.1.

DATE: 5/7/14		DRAWING NO.: FL-17038.7		SHEET 7 OF 7	
CHK. BY: LFS		DWG. BY: JK		SCALE: N.T.S.	
NO.		DATE		REVISONS	
4	9/14/23	UPDATE TO 8TH ED. (2023)	FBC	LFS	
3	9/29/20	UPDATE TO 7TH ED. (2020)	FBC	LFS	
2	10/3/17	UPDATE TO 6TH ED. (2017)	FBC	JK	
1	3/03/15	UPDATE TO 5TH ED. (2014)	FBC	JK	
				BY	
PRODUCT: MILLWORK ARTISANS DOUBLE HUNG WINDOW					
PART OR ASSEMBLY: BILL OF MATERIALS, GLAZING DETAILS & COMPONENTS					
Documents Prepared By: Lyndon F. Schmidt P.E. No. 43409					
BUILDING CONSULTANTS, INC. P.O. Box 230, Vairico, FL 33595 Phone No.: 813.659.9197 FBPE Registry No. 9813					