


ITEM #	REC'D	PART #	DESCRIPTION	MFG.
1	1	1889	HEAD	EFCO
2	1	1890	SILL	EFCO
3	2	1891	JAMB	EFCO
4	4	18A1	GLAZING BEAD	EFCO
5	AS REQ'D	WNA1	ARROW SHIM	GENERAL PLASTICS
6	AS REQ'D	WNE1	DRIVE-IN	GENERAL PLASTICS
7	AS REQ'D	WS05	SEALANT DAM	GENERAL PLASTICS
8	16	SLO9	ASSEMBLY SCREWS	REC'D
9	4	H10G	CORNER GASKET	REC'D
11	4	18A0	GLAZING STOP	EFCO
12	30	STK0	GLAZING STOP SCREWS	EFCO

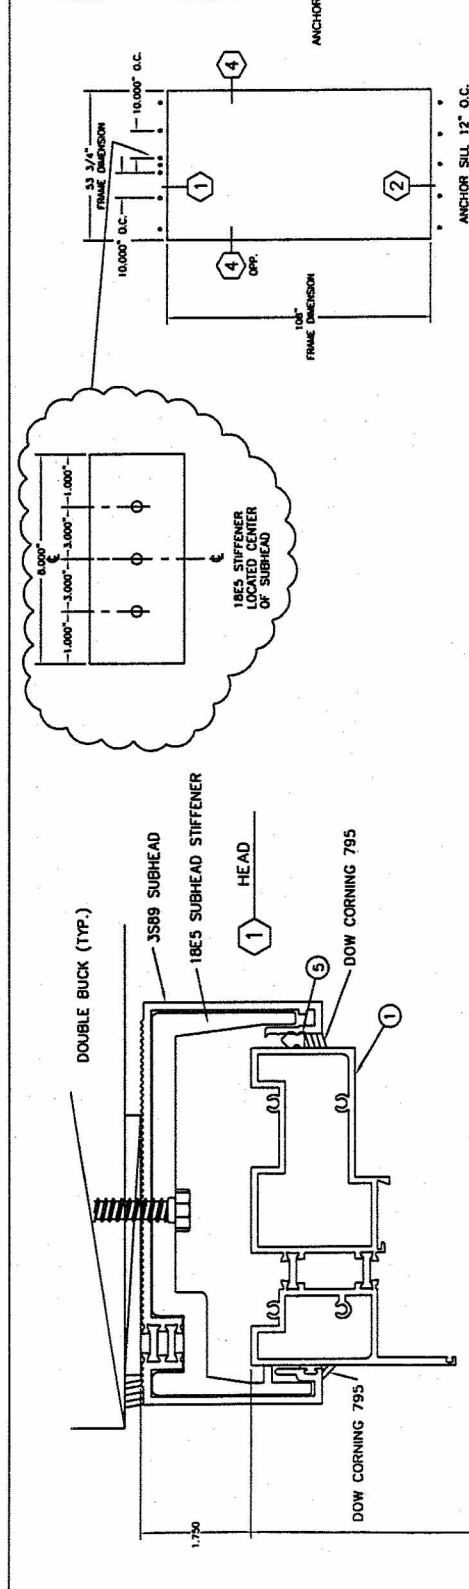


ANCHOR JAMBS 12" O.C.

ANCHOR SILL 12" O.C.

ALL ANCHORS ARE 3/8" LAG BOLTS x 4" LONG

INSULATED UNIT DESCRIPTION
 1 3/16" NOMINAL INSULATED UNIT
 1/4" TEMPERED CLEAR
 3/8" AIRSPACE
 9/16" VIRACON VANCEVA LAMINATED GLASS (.075 INTERLAYER) HEAT STRENGTHENED

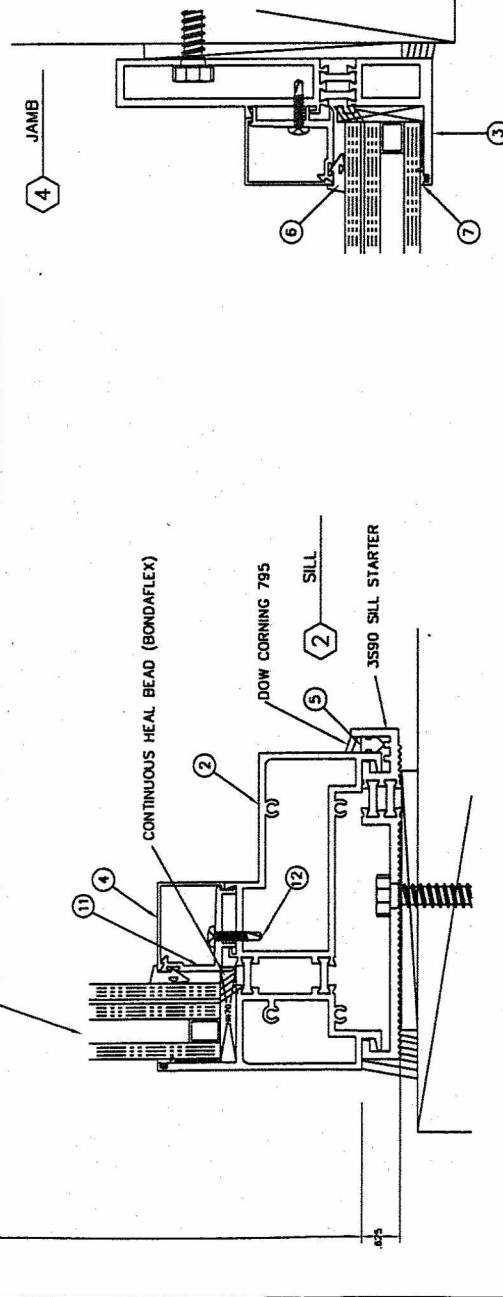

FRAME CORNER ASSEMBLY -
 SOR, CUT, END COPED, AND MECH. FASTENED.

CE
 CONSTRUCTION
 CONSULTING
 LABORATORY,
 INTERNATIONAL

1601 Luna Road
 Carrollton, Texas 75006

Phone (972) 242-0556
 Report # 08-071 Date 4/2/08

Reviewed BY *[Signature]*

LARGE MISSILE IMPACT

DRAWN BY	SCC	CHECKED BY	SCALE	REV.	EFCO CORPORATION	5FXT FIXED WINDOW	©2008 EFCO CORPORATION ALL RIGHTS RESERVED
DATE	8/6/07	DATE	FULL		1000 County Road - Monett, Missouri 65708	D.P. ??? PSF - O.L. ???PSF - AIR-WATER-STRUC	REPORT #
							##-###-##
							1 of 1