

REVISIONS			
REV	DESCRIPTION	DATE	APPROVED
A	CHANGE MANUFACTURER'S NAME	08/23/2021	R.L.
B	REVISED PER NEW CODE	08/10/2023	R.L.

NOTES:


1. THE PRODUCT SHOWN HEREIN IS DESIGNED AND MANUFACTURED TO COMPLY WITH REQUIREMENTS OF THE FLORIDA BUILDING CODE.
2. WOOD FRAMING AND MASONRY OPENING TO BE DESIGNED AND ANCHORED TO PROPERLY TRANSFER ALL LOADS TO STRUCTURE. FRAMING AND MASONRY OPENING IS THE RESPONSIBILITY OF THE ARCHITECT OR ENGINEER OF RECORD.
3. WHERE SHIM OR BUCK THICKNESS IS LESS THAN 1-1/2" WINDOW UNITS MUST BE ANCHORED THROUGH THE FRAME IN ACCORDANCE WITH MANUFACTURER'S PUBLISHED INSTALLATION INSTRUCTIONS. ANCHORS SHALL BE SECURELY FASTENED DIRECTLY INTO MASONRY, CONCRETE OR OTHER STRUCTURAL SUBSTRATE MATERIAL.
4. WHERE WOOD BUCK THICKNESS IS 1-1/2" OR GREATER, BUCK SHALL BE SECURELY FASTENED TO MASONRY, CONCRETE OR OTHER STRUCTURAL SUBSTRATE. WINDOW UNITS MAY BE ANCHORED THROUGH FRAME TO SECURED WOOD BUCK IN ACCORDANCE WITH MANUFACTURER'S PUBLISHED INSTALLATION INSTRUCTIONS.
5. WHERE 1X BUCK IS NOT USED DISSIMILAR MATERIALS MUST BE SEPARATED WITH APPROVED COATING OR MEMBRANE. SELECTION OF COATING OR MEMBRANE IS THE RESPONSIBILITY OF THE ARCHITECT OR ENGINEER OF RECORD.
6. BUCKS SHALL EXTEND BEYOND WINDOW INTERIOR FACE SO THAT FULL FRAME SUPPORT IS PROVIDED.
7. SHIM AS REQUIRED AT EACH ANCHOR LOCATION WITH LOAD BEARING SHIM. SHIM WHERE SPACE OF 1/16" OR GREATER OCCURS. MAXIMUM ALLOWABLE SHIM STACK TO BE 1/4".
8. SHIMS SHALL BE LOCATED, APPLIED AND MADE FROM MATERIALS AND THICKNESS CAPABLE OF SUSTAINING APPLICABLE LOADS.
9. WIND LOAD DURATION FACTOR Cd=1.6 WAS USED FOR WOOD ANCHOR CALCULATIONS.
10. FRAME MATERIAL: ALUMINUM 6063-T5.
11. UNITS MUST BE GLAZED PER ASTM E1300, WITH SAFETY GLASS.
12. APPROVED IMPACT PROTECTIVE SYSTEM IS REQUIRED FOR THIS PRODUCT IN WIND BORNE DEBRIS REGIONS.
13. FOR ANCHORING THROUGH FRAME INTO WOOD FRAMING OR 2X BUCK USE #10 WOOD SCREWS WITH SUFFICIENT LENGTH TO ACHIEVE A 1 1/4" MINIMUM EMBEDMENT INTO SUBSTRATE. LOCATE ANCHORS AS SHOWN IN ELEVATIONS AND INSTALLATION DETAILS.

14. FOR ANCHORING THROUGH FRAME INTO MASONRY/CONCRETE USE 3/16" TAPCONS WITH SUFFICIENT LENGTH TO ACHIEVE A 1 1/4" MINIMUM EMBEDMENT INTO SUBSTRATE WITH 2" MINIMUM EDGE DISTANCE. LOCATE ANCHORS AS SHOWN IN ELEVATIONS AND INSTALLATION DETAILS.
15. FOR ANCHORING THROUGH FRAME INTO METAL STRUCTURE USE #10 SMS OR SELF DRILLING SCREWS WITH SUFFICIENT LENGTH TO ACHIEVE 3 THREADS MINIMUM BEYOND STRUCTURE INTERIOR WALL. LOCATE ANCHORS AS SHOWN IN ELEVATIONS AND INSTALLATION DETAILS.
16. ALL FASTENERS TO BE CORROSION RESISTANT.
17. INSTALLATION ANCHORS SHALL BE INSTALLED IN ACCORDANCE WITH ANCHOR MANUFACTURER'S INSTALLATION INSTRUCTIONS AND ANCHORS SHALL NOT BE USED IN SUBSTRATES WITH STRENGTHS LESS THAN THE MINIMUM STRENGTH SPECIFIED BELOW:
 - A. WOOD: MINIMUM SPECIFIC GRAVITY OF G=0.42
 - B. CONCRETE: MINIMUM COMPRESSIVE STRENGTH OF 2,000 PSI.
 - C. MASONRY: HOLLOW/FILLED BLOCK PER ASTM C90 WITH Fm=2,000PSI MINIMUM.
 - D. METAL STRUCTURE: STEEL 18GA (.048") FY=33KSI/FU=52KSI OR ALUMINUM 6063-T5 FU=30KSI 1/8" THICK MINIMUM.
18. APPROVED CONFIGURATIONS: 1L, 1R, 2L, 2R, 3L, 3R, 4L, 4R, 2L2R, 5L, 5R, 6L, 6R, 7L, 7R, 8L AND 8R


TABLE OF CONTENTS	
SHEET NO.	DESCRIPTION
1	NOTES
2	ELEVATION
3 – 5	INSTALLATION DETAILS
6	COMPONENTS

C.R. LAURENCE CO., INC. 2503 E. VERNON AVE. LOS ANGELES, CA 90058		
MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR THERMALLY BROKEN W/RAISED TRACK NOTES		
DRAWN: R.L.	DWG NO. 08-02946	REV B
SCALE NTS	DATE 08/31/2016	SHEET 1 OF 6
L. ROBERTO LOMAS P.E. 208 7th Ave, INDIALANTIC, FL 32903 434-688-0609 rllomas@lrlomaspe.com		

SIGNED: 07/08/2026

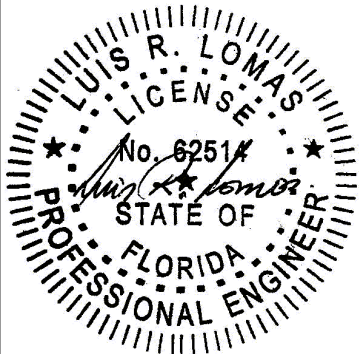

Luis R. Lomas P.E.
FL No.: 62514

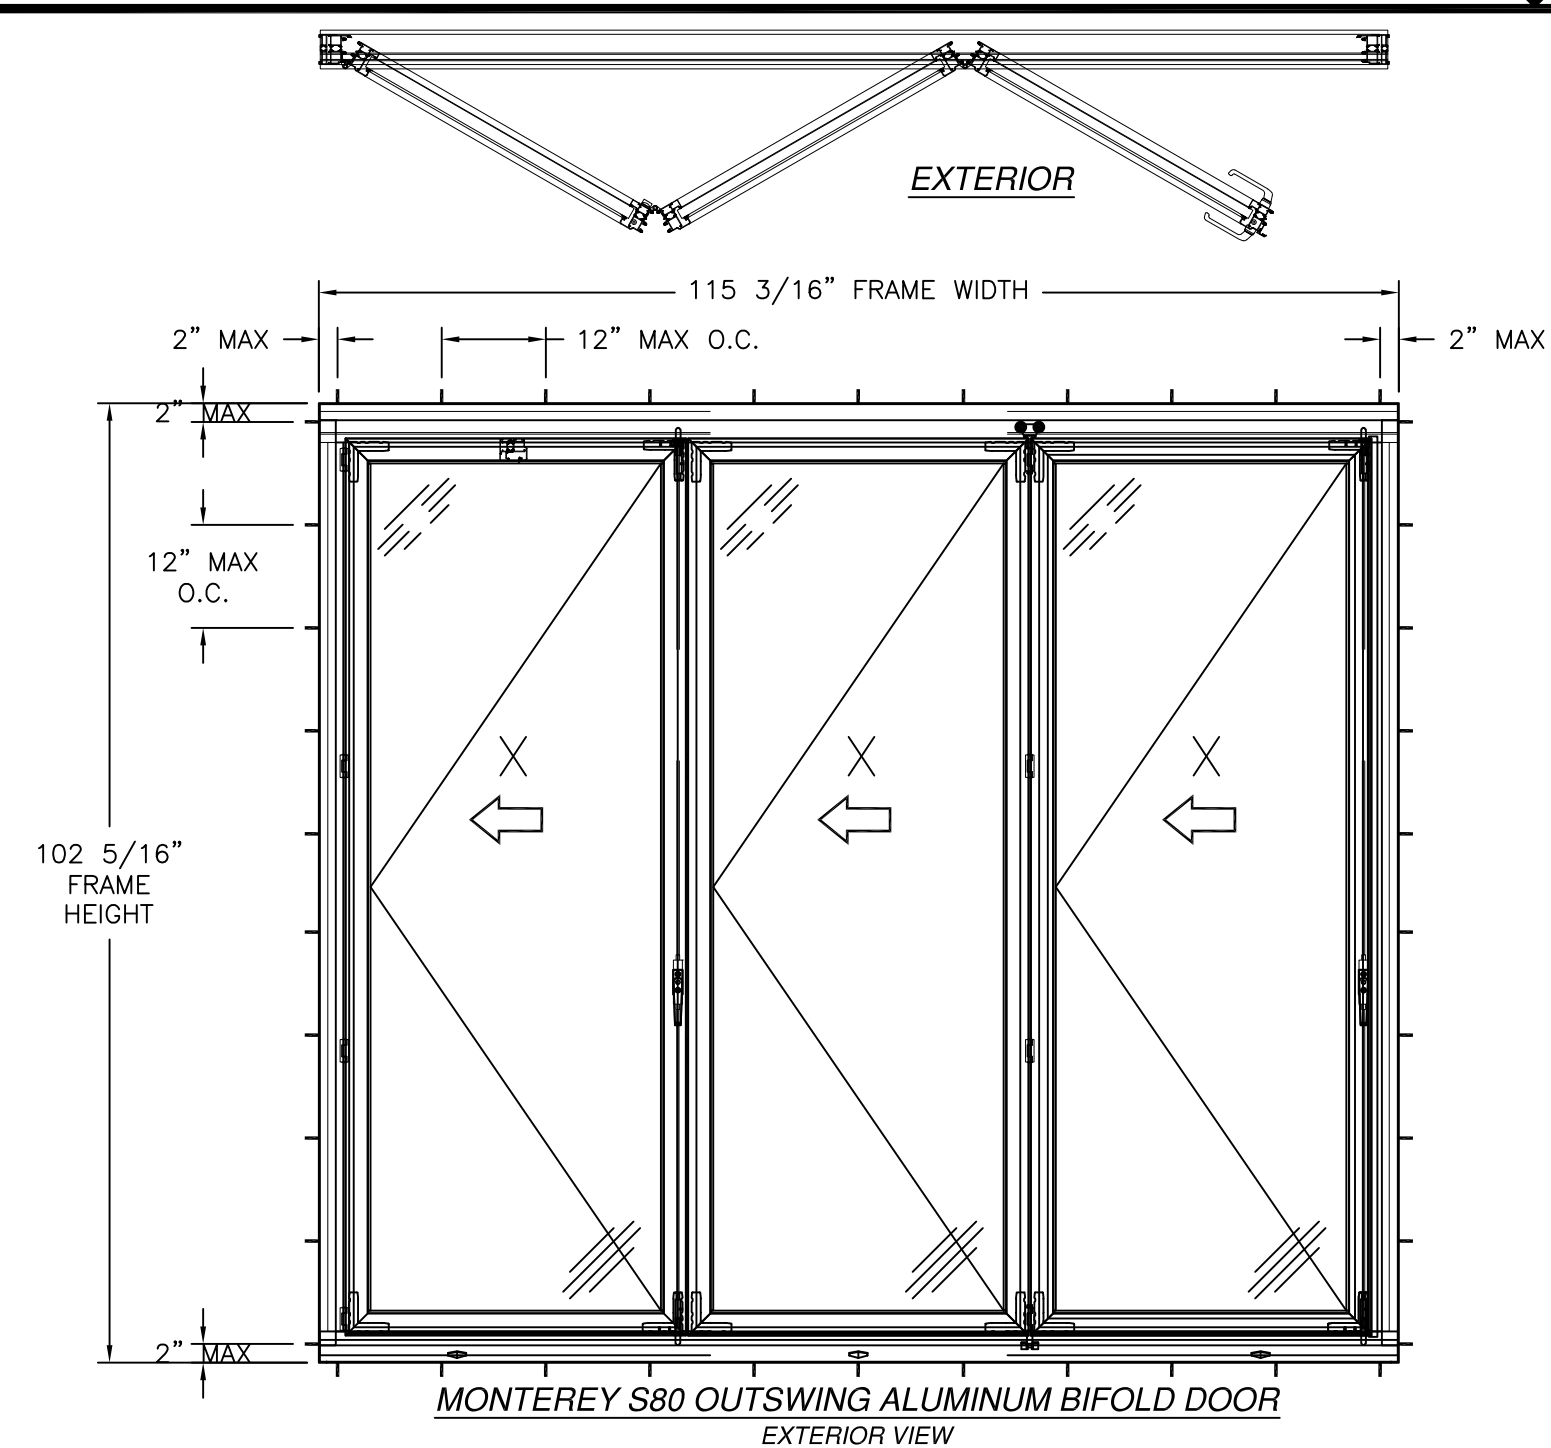

MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR
EXTERIOR VIEW

DESIGN PRESSURE RATING	IMPACT RATING
±30.0PSF	NONE

37 1/16" X 95 13/16" PANEL SHOWN. OTHER SIZES APPROVED AS LONG AS PANEL AREA DOES NOT EXCEED 24.66 FT²

HARDWARE SCHEDULE	
A.	(2) LARGE-HANDLE CATCH ASSEMBLY (MDAC350170EXT) AT 40" FROM SILL ON EACH LOCK STILE
B.	(4) CATCH BOLT (MDBOLT) THREADED ONTO THREADED ROD AT TOP AND BOTTOM OF EACH LOCK STILE
C.	(1) BOTTOM HINGE ASSEMBLY (MDAC350153B) AT 1 1/8" FROM BOTTOM RAIL OF STILE OPPOSITE LOCK JAMB STILE
D.	(1) TOP HINGE ASSEMBLY (MDAC350153T) AT 1 1/8" FROM TOP RAIL OF STILE OPPOSITE LOCK JAMB STILE
E.	(6) FIXED HINGE ASSEMBLY (MDAC350150) AT 32 1/2" AND 64" FROM SILL OF EACH PANEL

- NOTES:
- PANEL SIZE: 37 1/16" X 95 13/16"
 - D.L.O.: 31 3/16" X 90 9/16"

REVISIONS			
REV	DESCRIPTION	DATE	APPROVED
A	CHANGE MANUFACTURER'S NAME	08/23/2021	R.L.
B	REVISED PER NEW CODE	08/10/2023	R.L.

C.R. LAURENCE CO., INC.
2503 E. VERNON AVE.
LOS ANGELES, CA 90058

MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR
THERMALLY BROKEN W/RAISED TRACK
ELEVATION

DRAWN:
R.L.

DWG NO.
08-02946

REV
B


SCALE
NTS

DATE
08/31/2016


SHEET
2 OF 6

L. ROBERTO LOMAS P.E.
208 7th Ave, INDIALANTIC, FL 32903
434-688-0609 rllomas@lrlomaspe.com

SIGNED: 07/08/2026

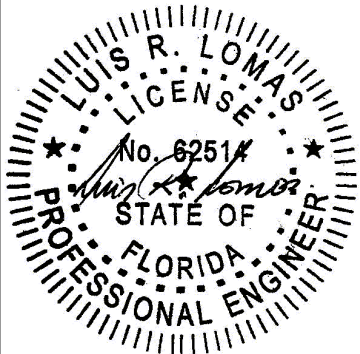


Luis R. Lomas P.E.
FL No.: 62514

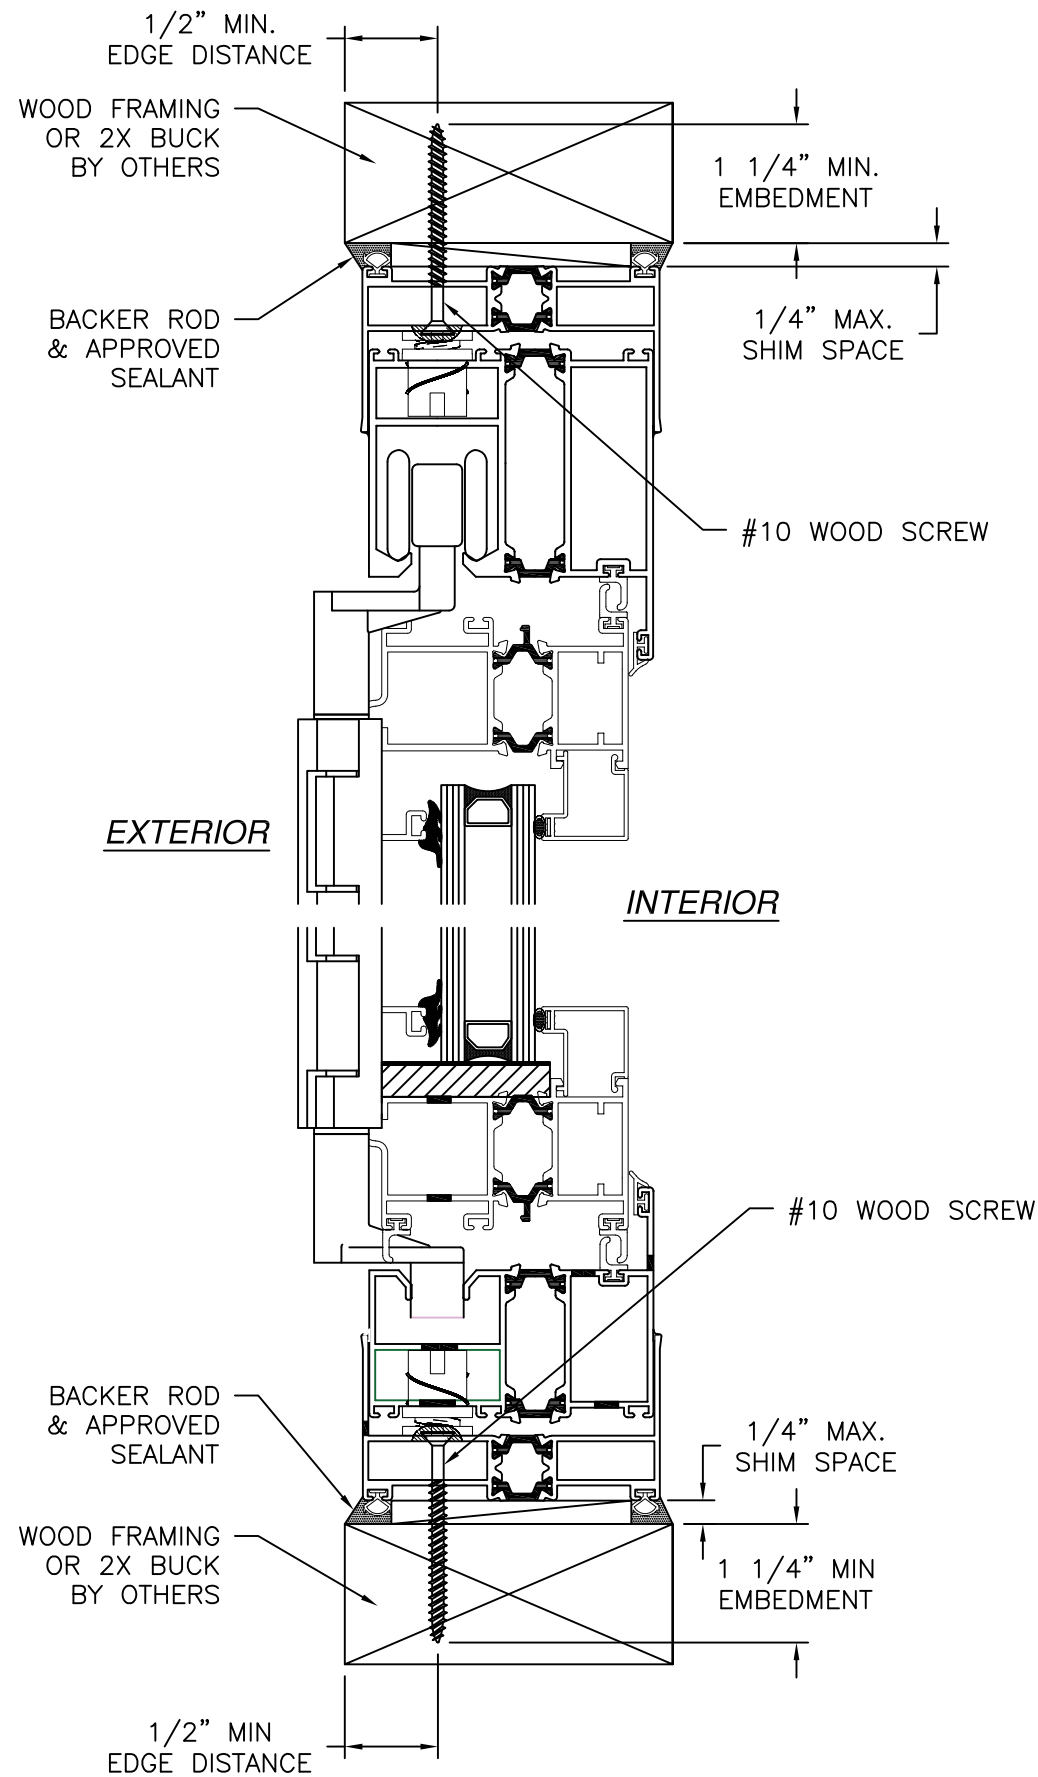

VERTICAL CROSS SECTION
WOOD FRAMING OR 2X BUCK INSTALLATION

REVISIONS			
REV	DESCRIPTION	DATE	APPROVED
A	CHANGE MANUFACTURER'S NAME	08/23/2021	R.L.
B	REVISED PER NEW CODE	08/10/2023	R.L.

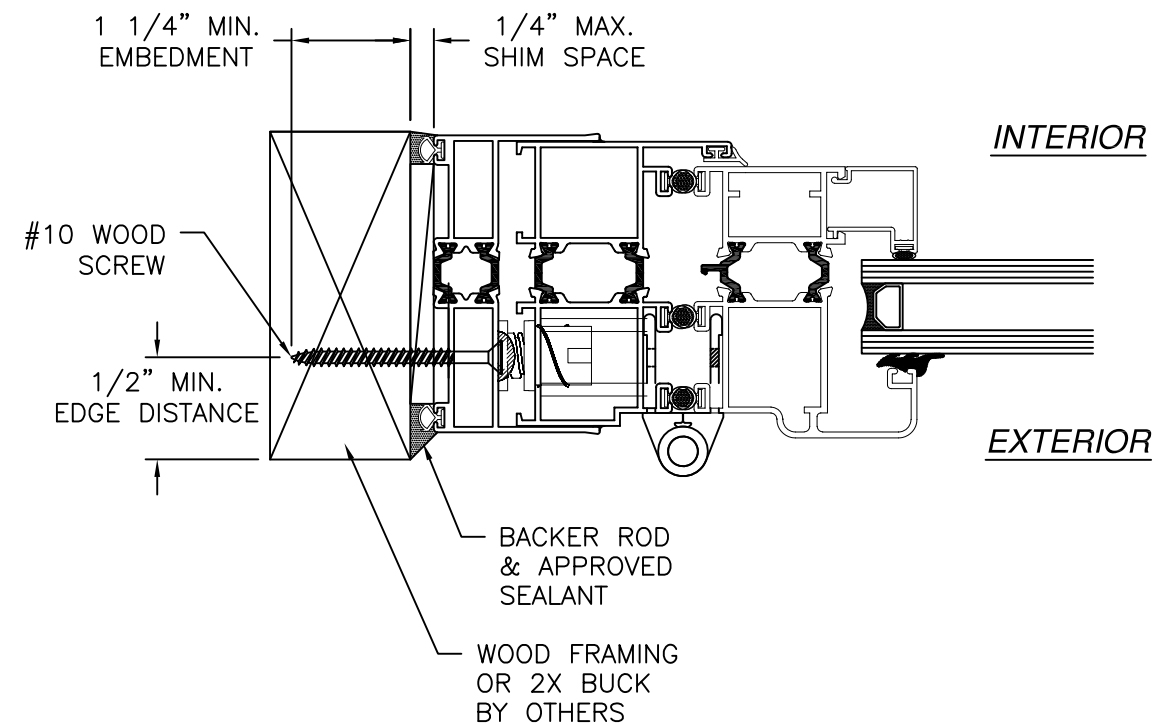


JAMB INSTALLATION DETAIL
WOOD FRAMING OR 2X BUCK INSTALLATION

NOTES:



1. INTERIOR AND EXTERIOR FINISHES, BY OTHERS, NOT SHOWN FOR CLARITY.
2. PERIMETER AND JOINT SEALANT BY OTHERS TO BE DESIGNED IN ACCORDANCE WITH ASTM E2112

SIGNED: 07/08/2026

C.R. LAURENCE CO., INC. 2503 E. VERNON AVE. LOS ANGELES, CA 90058		
MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR THERMALLY BROKEN W/RAISED TRACK INSTALLATION DETAILS		
DRAWN: R.L.	DWG NO. 08-02946	REV B
SCALE NTS	DATE 08/31/2016	SHEET 3 OF 6
L. ROBERTO LOMAS P.E. 208 7th Ave, INDIALANTIC, FL 32903 434-688-0609 rllomas@lrlomaspe.com		

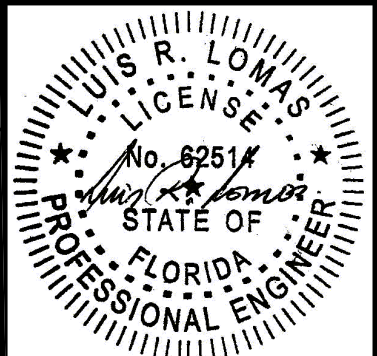

Luis R. Lomas P.E.
FL No.: 62514

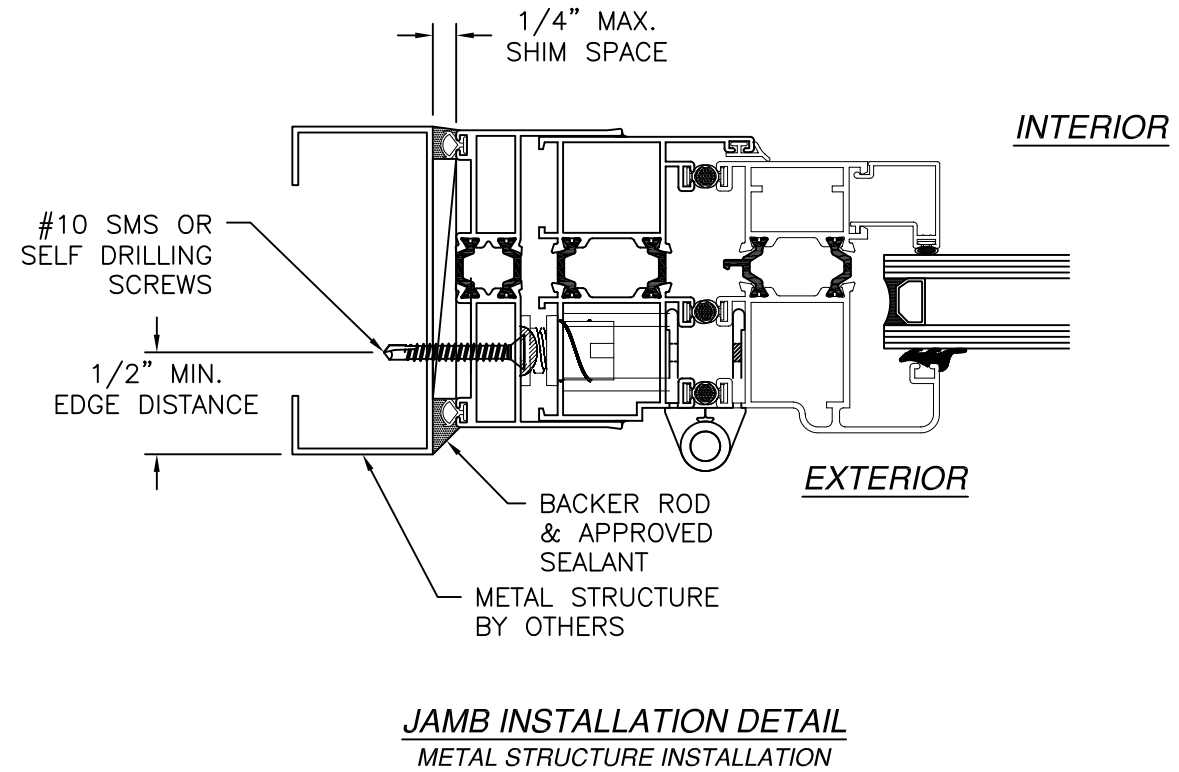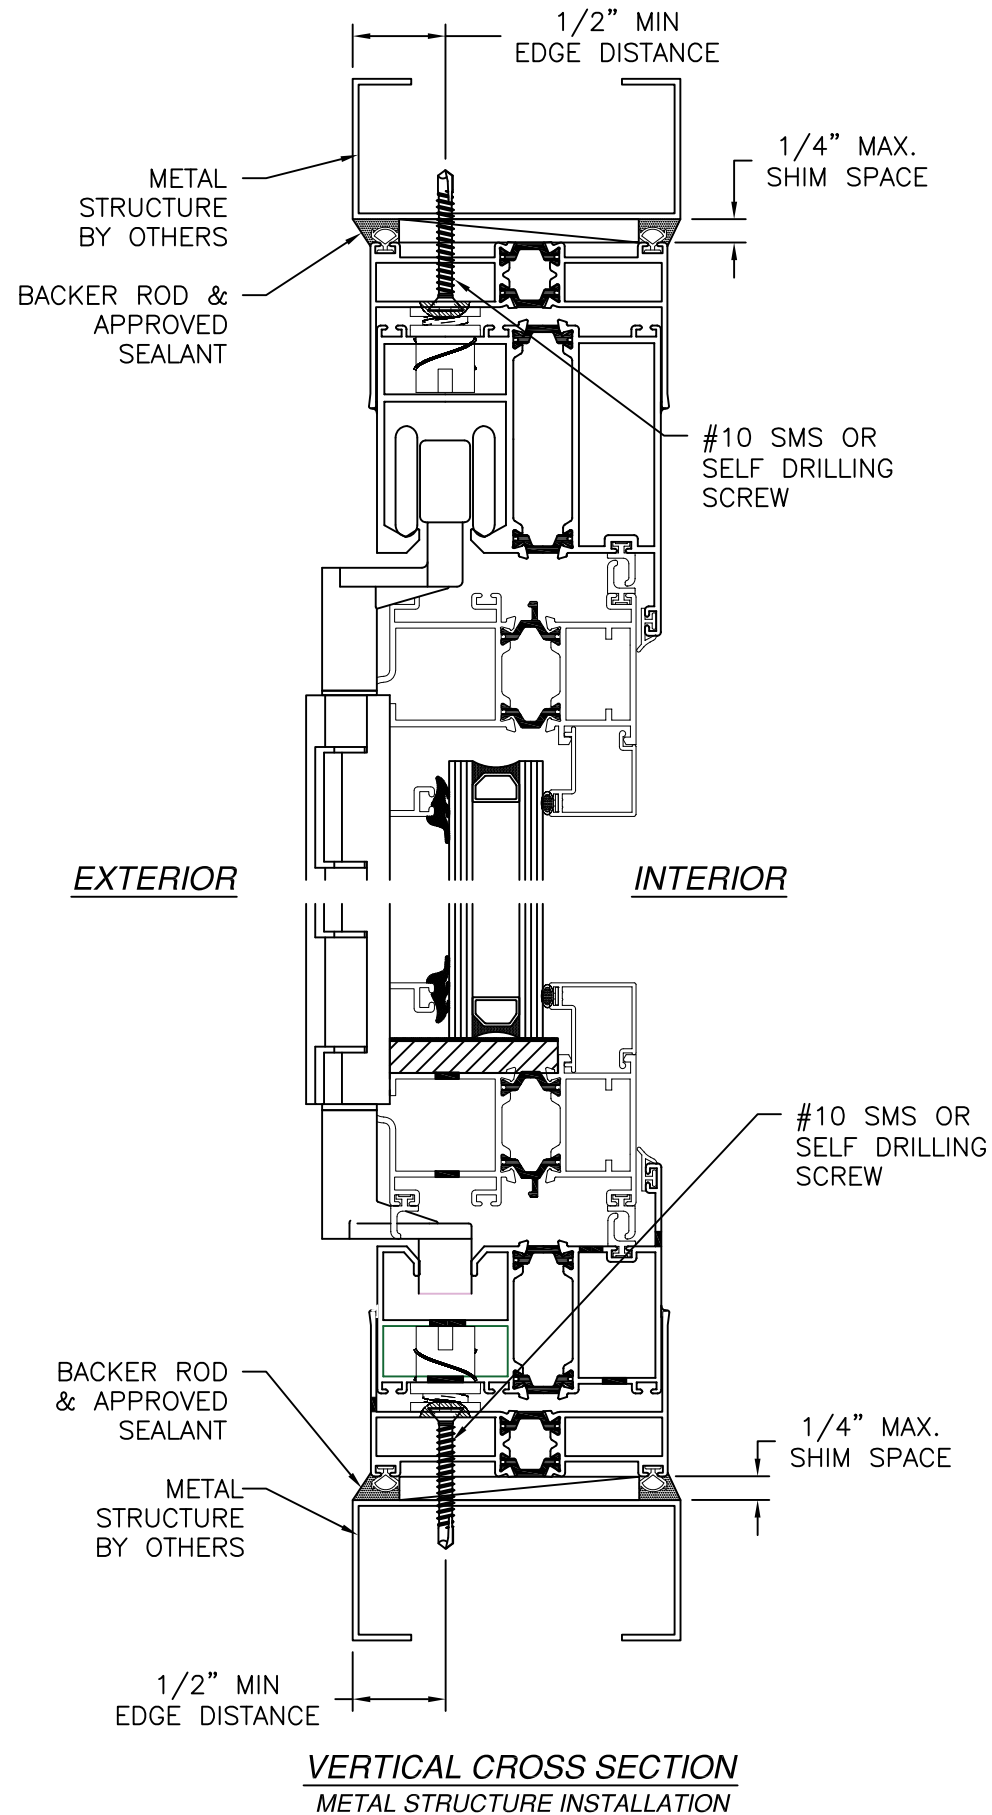


- NOTES:
1. INTERIOR AND EXTERIOR FINISHES, BY OTHERS, NOT SHOWN FOR CLARITY.
 2. PERIMETER AND JOINT SEALANT BY OTHERS TO BE DESIGNED IN ACCORDANCE WITH ASTM E2112


REVISIONS			
REV	DESCRIPTION	DATE	APPROVED
A	CHANGE MANUFACTURER'S NAME	08/23/2021	R.L.
B	REVISED PER NEW CODE	08/10/2023	R.L.

C.R. LAURENCE CO., INC. 2503 E. VERNON AVE. LOS ANGELES, CA 90058		
MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR THERMALLY BROKEN W/RAISED TRACK INSTALLATION DETAILS		
DRAWN: R.L.	DWG NO. 08-02946	REV B
SCALE NTS	DATE 08/31/2016	SHEET 4 OF 6
L. ROBERTO LOMAS P.E. 208 7th Ave, INDIALANTIC, FL 32903 434-688-0609 rllomas@lrlomaspe.com		


SIGNED: 07/08/2026

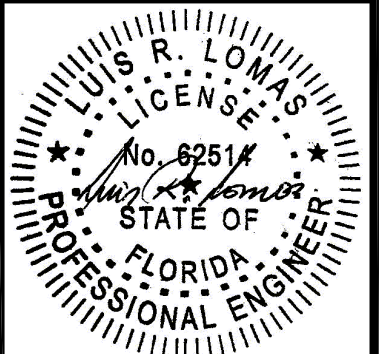

Luis R. Lomas P.E.
FL No.: 62514

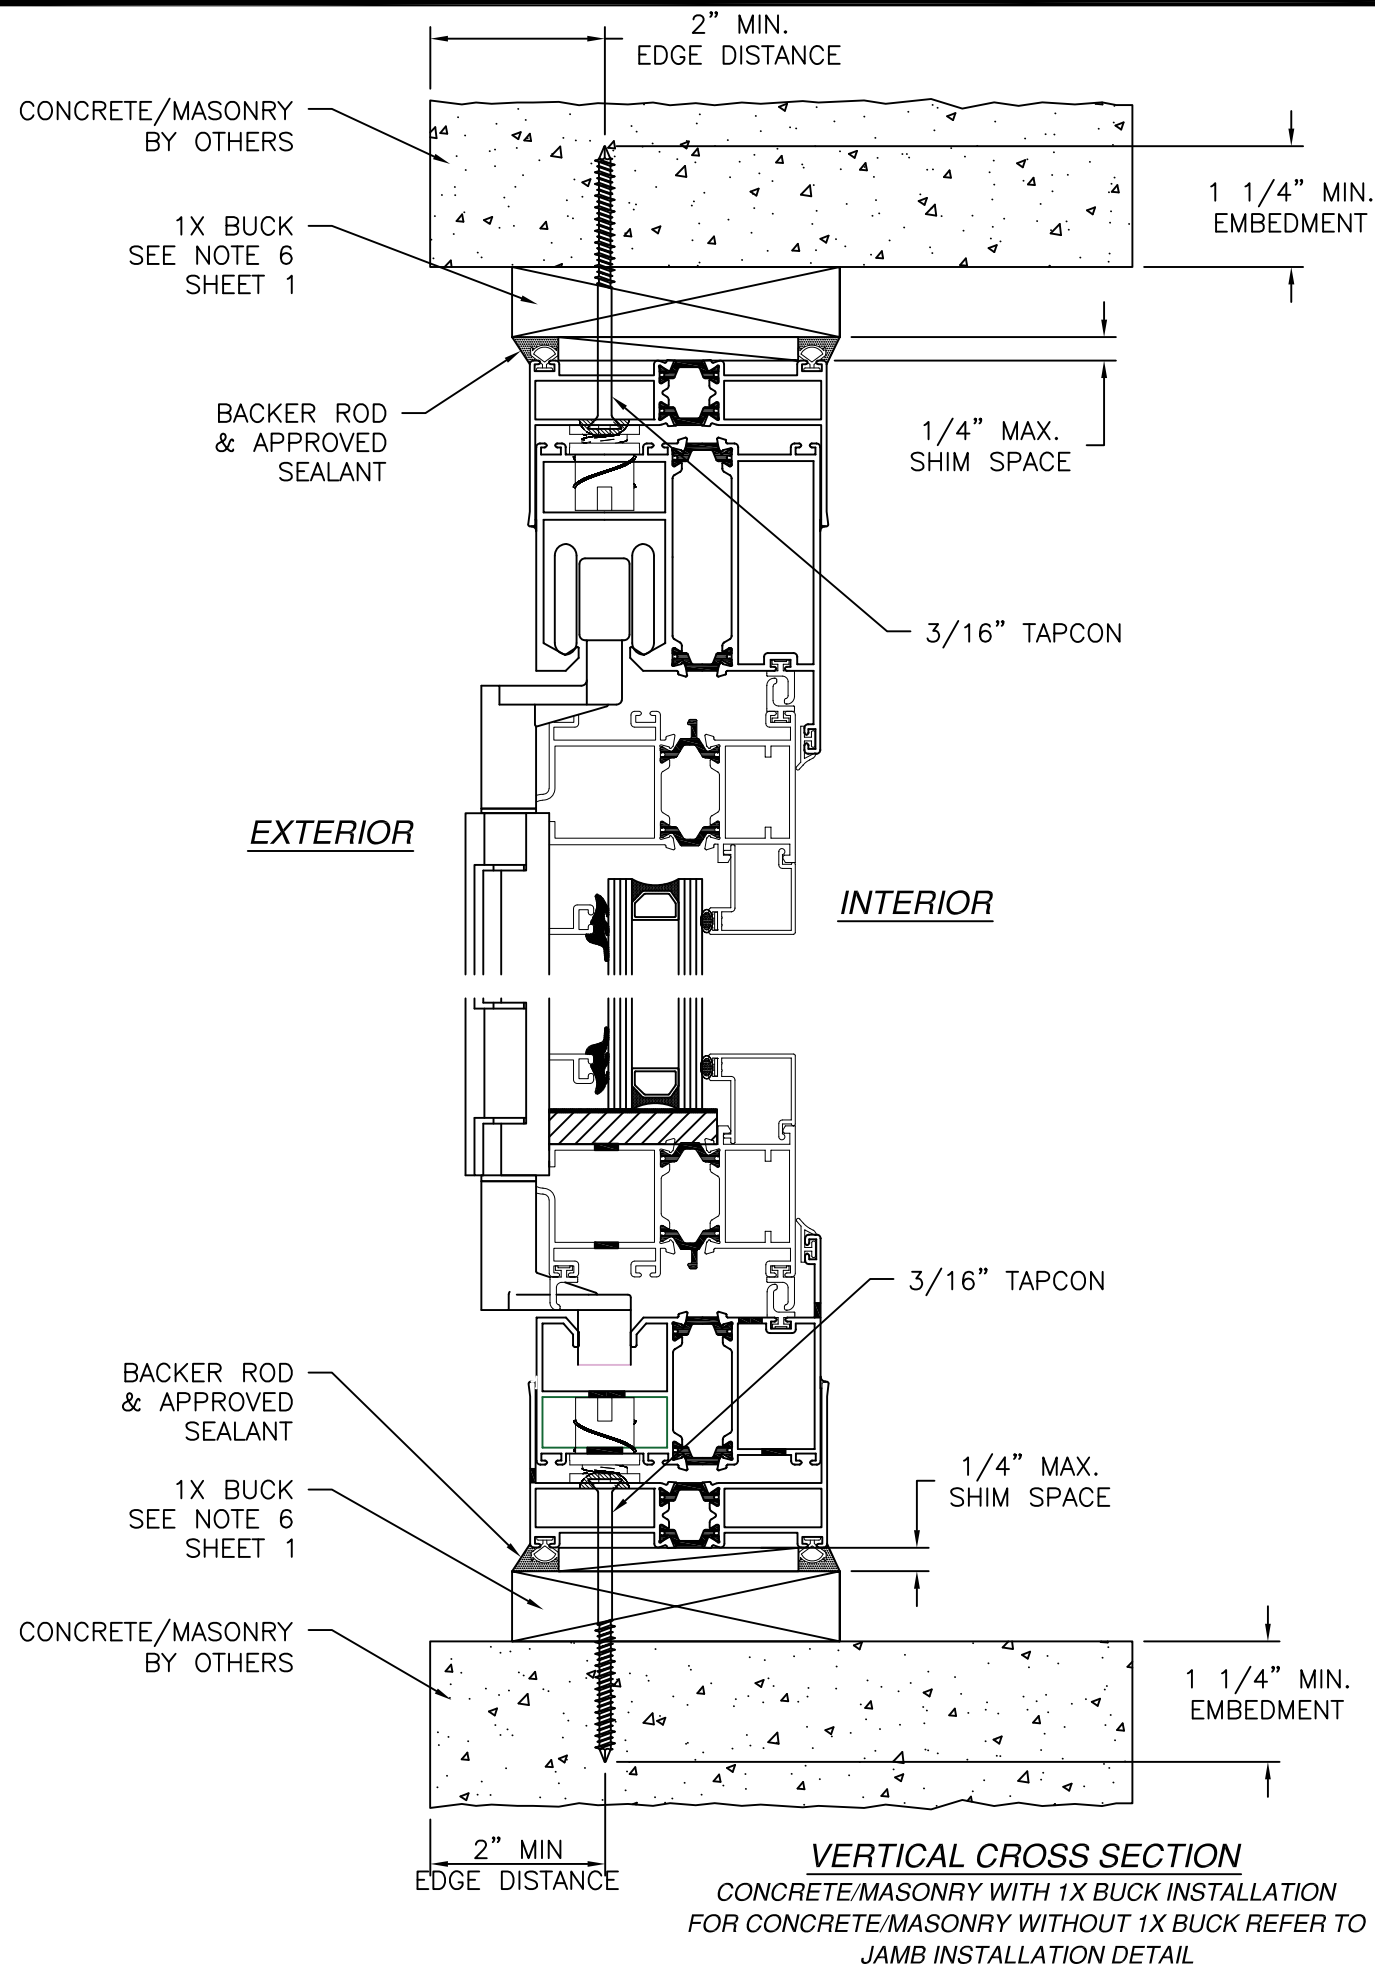

REVISIONS			
REV	DESCRIPTION	DATE	APPROVED
A	CHANGE MANUFACTURER'S NAME	08/23/2021	R.L.
B	REVISED PER NEW CODE	08/10/2023	R.L.

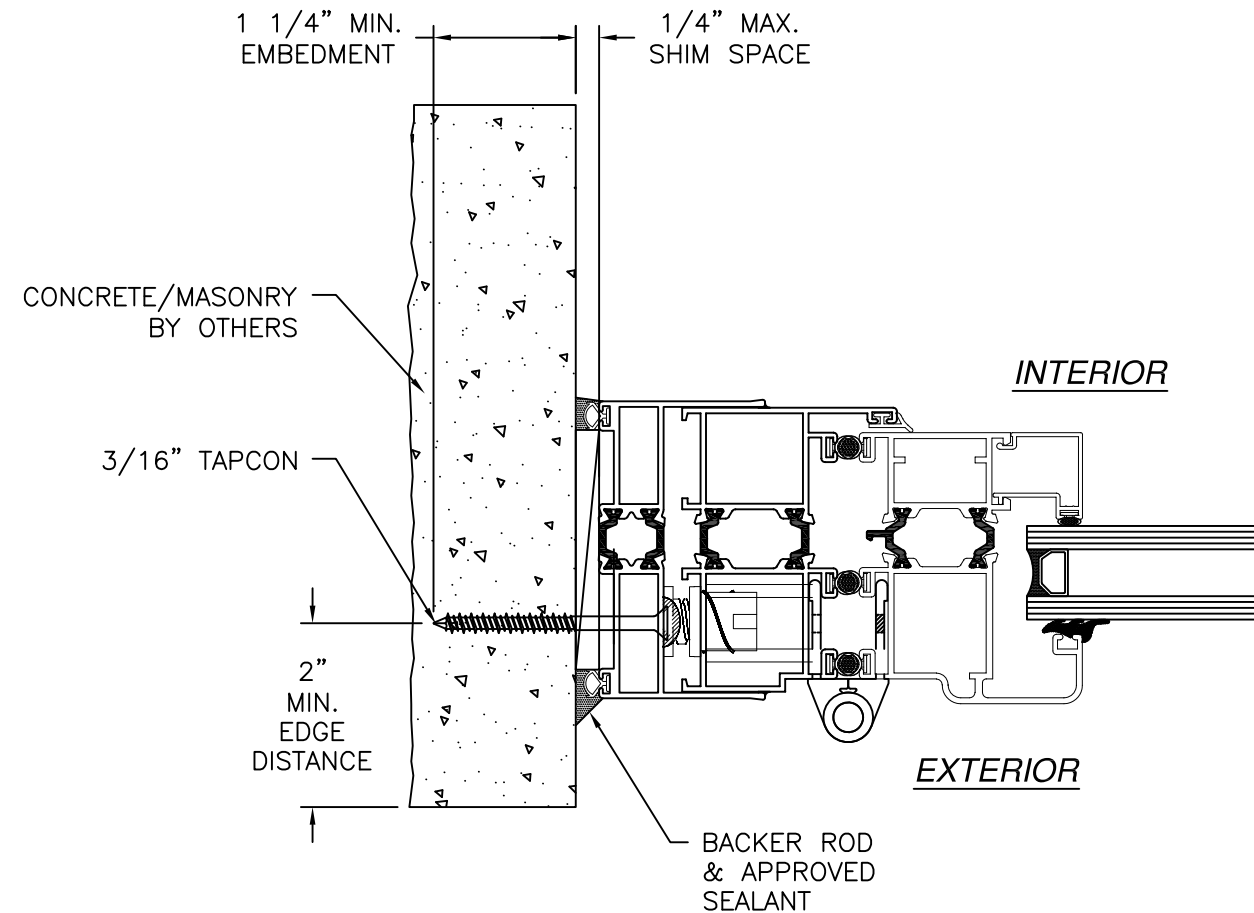


JAMB INSTALLATION DETAIL
CONCRETE/MASONRY WITHOUT 1X BUCK INSTALLATION
FOR CONCRETE/MASONRY WITH 1X BUCK REFER TO
HEAD AND SILL INSTALLATION DETAILS

NOTES:

1. INTERIOR AND EXTERIOR FINISHES, BY OTHERS, NOT SHOWN FOR CLARITY.
2. PERIMETER AND JOINT SEALANT BY OTHERS TO BE DESIGNED IN ACCORDANCE WITH ASTM E2112


SIGNED: 07/08/2026

C.R. LAURENCE CO., INC. 2503 E. VERNON AVE. LOS ANGELES, CA 90058		
MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR THERMALLY BROKEN W/RAISED TRACK INSTALLATION DETAILS		
DRAWN: R.L.	DWG NO. 08-02946	REV B
SCALE NTS	DATE 08/31/2016	SHEET 5 OF 6
L. ROBERTO LOMAS P.E. 208 7th Ave, INDIALANTIC, FL 32903 434-688-0609 rllomas@lrlomaspe.com		

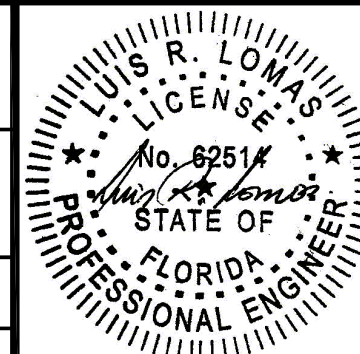


Luis R. Lomas P.E.
FL No.: 62514


REVISIONS			
REV	DESCRIPTION	DATE	APPROVED
A	CHANGE MANUFACTURER'S NAME	08/23/2021	R.L.
B	REVISED PER NEW CODE	08/10/2023	R.L.

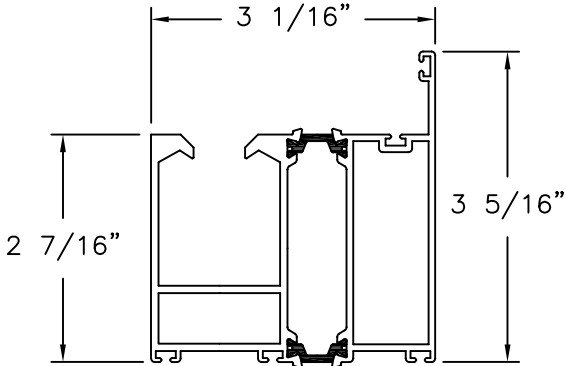


TOP TRACK
ALUMINUM 6063-T6 (MD80001)

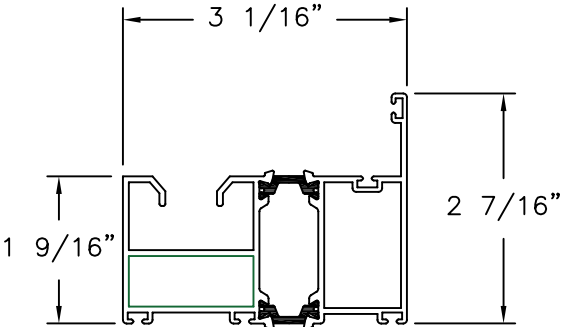


BOTTOM TRACK
ALUMINUM 6063-T5 (MD80002)

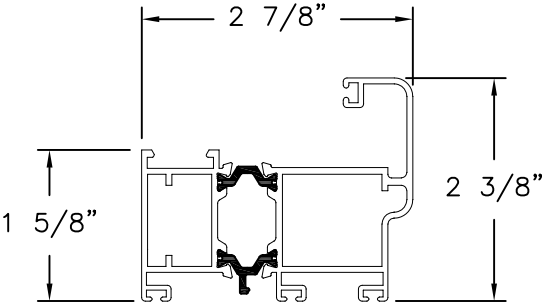


EXTERIOR LEAF
ALUMINUM 6063-T5 (MD80008)

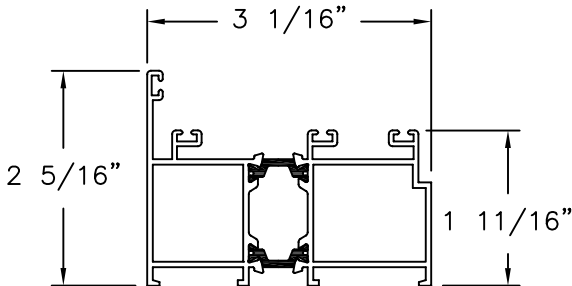

BREAK LATERAL FRAME
ALUMINUM 6063-T5 (MD80003)

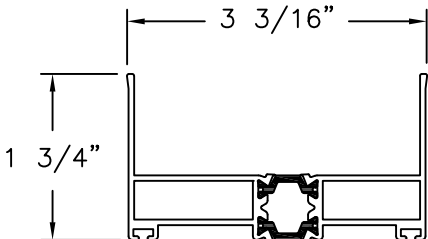

"U" CHANNEL
ALUMINUM 6063-T5 (MD80007)

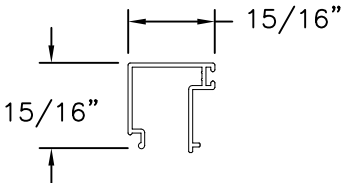

GLASS STOP
ALUMINUM 6063-T5 (MD94301)

SIGNED: 07/08/2026

C.R. LAURENCE CO., INC.

2503 E. VERNON AVE.
LOS ANGELES, CA 90058

MONTEREY S80 OUTSWING ALUMINUM BIFOLD DOOR
THERMALLY BROKEN W/RAISED TRACK
COMPONENTS

DRAWN: R.L.

DWG NO. 08-02946

REV B

SCALE NTS


DATE 08/31/2016

SHEET 6 OF 6

L. ROBERTO LOMAS P.E.

208 7th Ave, INDIALANTIC, FL 32903

434-688-0609 rllomas@lrlomaspe.com

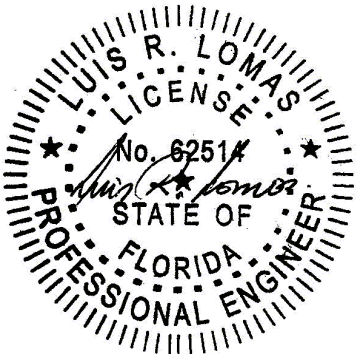

Luis R. Lomas P.E.
FL No.: 62514