



Clad Multi-Slide Plus 3-Panel Door
137" x 98 1/8" Overall Frame Size
Non-Impact

Clad Multi-Slide Plus 3-Panel Door
WDMA Instructions / Non-Impact

SHEET: 1 OF 2

UPDATED: 12/09/2019

DRAWN BY: B.K.

Width	Height	Design Pressure	Rating	CCL Listing #	Report No.	
137" (3480mm)	98 1/8" (2496mm)	±35.09 psf	Class LC-PG35	429-H-563.00-.04	J9823.01-901-47	1 3/4" Inside Sill Stop
137" (3480mm)	98 1/8" (2496mm)	±50.13 psf	Class LC-PG50	429-H-563.05-.09	J9823.01-901-47	2 1/8" Inside Sill Stop

INSTALLATION NOTES:

- USE 2" x _ PINE FOR WOOD BUCK
- 1/4" MAXIMUM SHIM SPACE
 - PLACE WOOD SHIM EVERY 6-10"
- INSTALL #8 X 3" PFH SCREWS SPACED APPROXIMATELY 3" FROM THE CORNERS AND 10" ON CENTER THEREAFTER THROUGH THE JAMB TRACK AND 24" ON CENTER THROUGH THE HEAD TRACK INTO THE FRAMING MATERIAL A MINIMUM OF 1" EMBEDMENT.
- APPLY BACKER ROD AND A CONTINUOUS CAP BEAD OF SEALANT AROUND THE PERIMETER BETWEEN THE FRAME AND THE ROUGH OPENING.

MAXIMUM OVERALL SIZE: B.U.S. (Basic Unit Size):



137" (3480mm) x 98 1/8" (2492mm)

GENERAL INSTALLATION NOTES:

- Check rough opening for proper size, plumb, level and square.
- Make all necessary adjustments to ensure rough opening is plumb, level & square.
- Sill must be flat, level and capable of supporting the weight of the unit.
- Opening must allow a maximum of 1/4" shim space at head, sill and jambs.
- Consult full installation instructions found on the Sierra Pacific web site, www.sierrapacificwindows.com, for all recommended installation procedures.
- Wood buck, framing, fasteners, sealant and all wall system materials are provided by others

FLASHING

- For units that have to meet a specific DP (Design Pressure) rating, any kind of building wrap must be folded and taped away from each rough opening before the unit is installed. Unit must come in contact with the building's bare sheathing.
- Once unit is installed and flashed properly, the building wrap must be reapplied and trimmed flush with the unit's exterior. A bead of sealant must be placed along the seam joint of the building wrap and the unit. Tape the corner cuts in the building wrap. See full door installation brochure for complete flashing details.

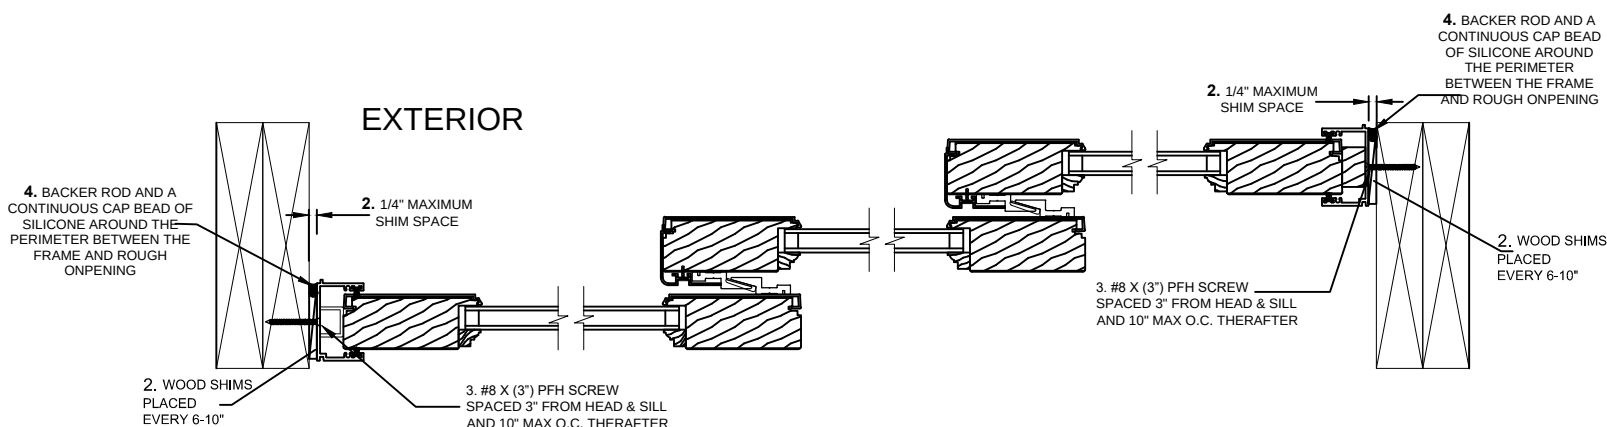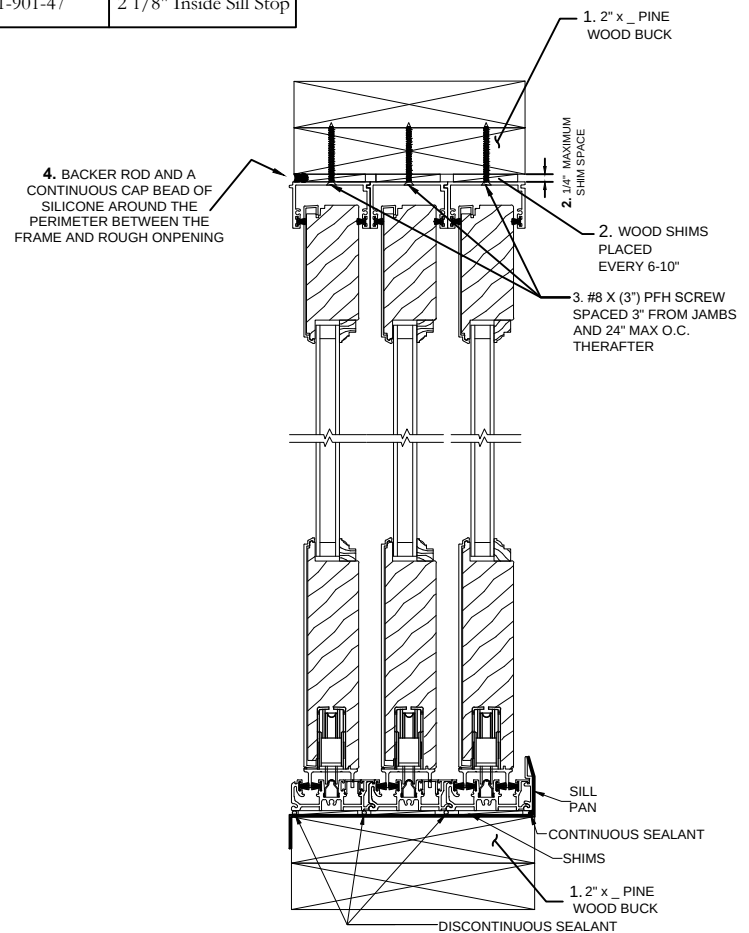

Installation requirements may vary in particular locations and in other types of construction. Proper installation is essential, and Sierra Pacific Windows, recommends consultation with an AAMA Certified Installer, or other qualified, registered building professional before installation of any Sierra Pacific product. Proper installation of Sierra Pacific products is the responsibility of the installer. Sierra Pacific is not responsible for proper installation. Sierra Pacific is not responsible for the design of, conditions in, or performance of building construction beyond the perimeters of the Sierra Pacific units. Sierra Pacific is not responsible for proper integration of the Sierra Pacific units with the weather-repellent systems of the building.



Clad Multi-Slide Plus 3-Panel Door
137" x 98 1/8" Overall Frame Size
Non-Impact

Clad Multi-Slide Plus 3-Panel Door
WDMA Instructions / Non-Impact


SHEET: 2 OF 2

UPDATED: 12/09/2019

DRAWN BY: B.K.

Width	Height	Design Pressure	Rating	CCL Listing #	Report No.	
137" (3480mm)	98 1/8" (2496mm)	±35.09 psf	Class LC-PG35	429-H-563.00-.04	J9823.01-901-47	1 3/4" Inside Sill Stop
137" (3480mm)	98 1/8" (2496mm)	±50.13 psf	Class LC-PG50	429-H-563.05-.09	J9823.01-901-47	2 1/8" Inside Sill Stop

**ELEVATION SHOWING
FASTENER LOCATION & SPACING (TYP.)**

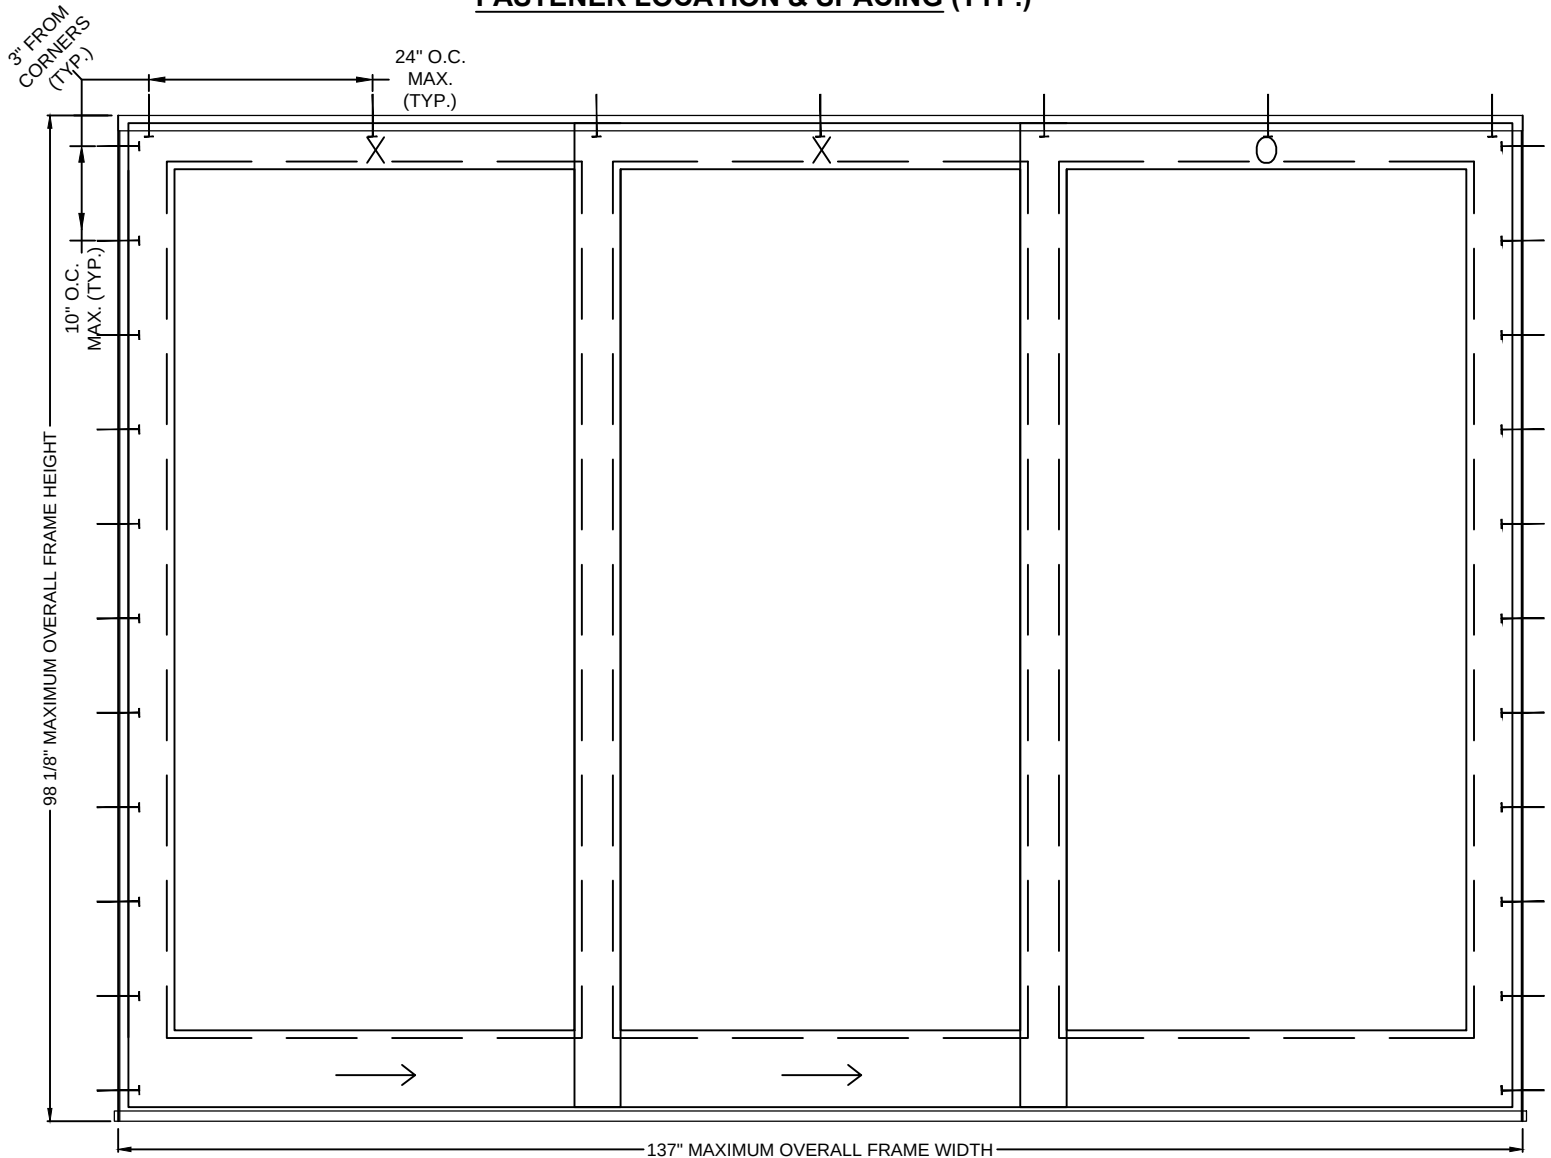

Installation requirements may vary in particular locations and in other types of construction. Proper installation is essential, and Sierra Pacific Windows, recommends consultation with an AAMA Certified Installer, or other qualified, registered building professional before installation of any Sierra Pacific product. Proper installation of Sierra Pacific products is the responsibility of the installer. Sierra Pacific is not responsible for proper installation. Sierra Pacific is not responsible for the design of, conditions in, or performance of building construction beyond the perimeters of the Sierra Pacific units. Sierra Pacific is not responsible for proper integration of the Sierra Pacific units with the weather-repellent systems of the building.