



# Farabaugh Engineering and Testing Inc.

Project No. T221-21

Report Date: July 28, 2021

No. Pages: 8 (inclusive)


## UL 580 / UL1897 UPLIFT RESISTANCE TESTING

ON

**ELITE RIB ROOF PANEL  
3'-0" COVERAGE X 29 GA. STEEL  
(FASTENERS INTO PINE PURLINS @ 24" O.C.  
WITH FASTENER PATTERN OF 9/9/9/6)**

FOR

ELITE METAL MANUFACTURING, LLC.  
10121 88<sup>TH</sup> TRACE  
LIVE OAK, FL. 32064

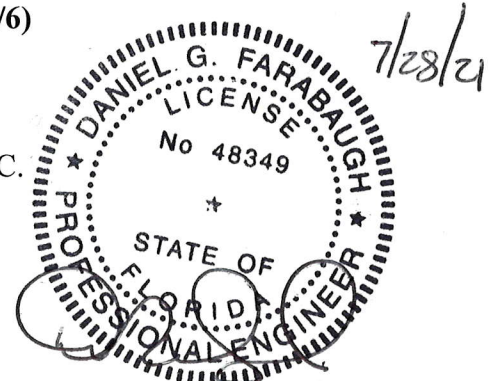

Prepared by:

Paul G. Farabaugh

Approved by:

Daniel G. Farabaugh  
**DANIEL G. FARABAUGH, P.E.**  
255 Saunders Station Rd,  
Trafford, PA 15085  
412-373-9238



DADE COUNTY  
ACCREDITED  
LABORATORY



AAMA  
ACCREDITED  
LABORATORY



TEXAS  
ACCREDITED  
LABORATORY



FLORIDA  
ACCREDITED  
LABORATORY  
& QC ENTITY

Project No. T221-21

**Purpose**

This test method covers the evaluation of uplift resistance of roof assemblies per UL 580-06 and UL 1897-12 and as provided herein.

**Test Dates:**

7/22/21 - Test #1 – Panel fasteners into pine purlins @ 24" o.c. location with fastener pattern of 9/9/9/6 across panel width.

**Test Specimen**

Manufacturer: Elite Metal Manufacturing LLC.  
10121 88<sup>th</sup> Trace  
Live Oak, FL. 32064

Test Specimen: Elite Rib Metal Panel 36" wide coverage x 29 ga.

Substrate: 15/32" plywood with 1 x 4 pine purlins at 24" o.c.

**Testing Apparatus**

*Test Chamber:* The test chamber consists of three sections: a top section to create a uniform vacuum, a center section in which the roof assembly is constructed, and a bottom section to create a uniform positive pressure.

*Pressure Chamber:* The air pressure in the pressure chamber was measured at five points. Each of four points were located 42" from chamber corners at a 45 degrees angle, with the fifth tube located 18" from the center of the air inlet opening. The end of each tube was 7" above the chamber floor. The tubes were connected to a manifold that, in turn was connected to a manometer.

*Vacuum Chamber Measurement:* The air pressure in the vacuum chamber was measured at five points. Each of four points was located 18" from chamber corners at a 45 degrees angle and 8" above the chamber floor. The fifth tube located 12" from the center of the exhaust opening and 6" below the opening. The tubes were connected to a manifold that, in turn was connected to a manometer. The pressure in the vacuum chamber was controlled by an automatic damper. The damper door was moved by means of an air motor hooked to an air line and controlled by pressure switches located in the control console. An additional pressure line from the manifold to pressure switches controlled the automatic damper.

### **Installation**

- The 15/32" plywood was attached to the wood joist (2x10) supports (spaced at 2'-0" o.c.) using 8d ring shank nails at 6" on center around the perimeter and at interior supports.
- 1 x 4 pine purlin spaced at 24" o.c. was attached with (2) #9 x 3" deck screws at 24" o.c. along the length of the purlin thru the plywood and into the wood joists.
- The metal roof panels were attached to the pine purlin substrate using #10-12 X 1-1/2" long, hex head wood screw, type 17 point, w/1/2" steel sealing washer. The screws were attached with a specified spacing pattern across the width of the panel with a fastening spacing of 24" o.c. along the length of the panel. The panel sidejoint was lap joint. The outer perimeter of the assembly was secured with perimeter fastening as required to maintain a periphery seal. See fastening pattern for location of fasteners across width of panel.
- A plastic barrier was located between the panels and the underlying substrate.

### **Test Procedure**

- The test assembly was subjected to positive and negative pressures to form an uplift pressure at the values and time duration as shown in the attached table.
- Each pressure increment was held for at least 1 minute.
- Vertical movement of the assembly during the tests was recorded.
- Subsequent to the completion of Phase 5 of the Class 90 test sequence, the test specimen was subjected to higher static uplift pressures per UL 1897 as shown on the attached table. The positive uplift pressure supplied from below was maintained at 48.5 psf while the negative uplift pressure supplied from above was increased in increments until failure or the desired uplift pressure was obtained.

Project No. T221-21

**TEST #1**  
**UL 580 UPLIFT TEST**

Test Date: 7/22/21

Test Specimen: Elite Rib Metal Panel 36" wide coverage x 29 ga

Fastener Spacing: 24" o.c. into pine purlins with 9/9/9/6 pattern

**Class 30 Deflection Measurements**

| Phase   | Time Duration (min.) | Negative Pressure (psf) | Positive Pressure (psf) | #1 (in) | #2 (in) | #3 (in) | #4 (in) |
|---------|----------------------|-------------------------|-------------------------|---------|---------|---------|---------|
| Initial | 0                    | 0                       | 0                       | 7-13/16 | 6-1/8   | 4-15/16 | 6       |
| 1       | 5                    | 16.2                    | 0                       | 7-3/4   | 5-7/8   | 4-7/8   | 5-3/4   |
| 2       | 5                    | 16.2                    | 13.8                    | 7-3/4   | 5-3/4   | 4-7/8   | 5-9/16  |
| 3       | 60                   | 8.1 – 27.7*             | 13.8                    | 7-11/16 | 5-5/8   | 4-13/16 | 5-1/2   |
| 4       | 5                    | 24.2                    | 0                       | 7-11/16 | 5-3/4   | 4-13/16 | 5-9/16  |
| 5       | 5                    | 24.2                    | 20.8                    | 7-7/16  | 5-9/16  | 4-1/2   | 5-3/8   |

**Class 60 Deflection Measurements**

| Phase | Time Duration (min.) | Negative Pressure (psf) | Positive Pressure (psf) | #1 (in) | #2 (in) | #3 (in) | #4 (in) |
|-------|----------------------|-------------------------|-------------------------|---------|---------|---------|---------|
| 1     | 5                    | 32.3                    | 0                       | 7-7/16  | 5-11/16 | 4-1/2   | 5-7/16  |
| 2     | 5                    | 32.3                    | 27.7                    | 7-3/8   | 5-1/2   | 4-7/16  | 5-1/4   |
| 3     | 60                   | 16.2 – 55.4*            | 27.7                    | 7-5/16  | 5-5/16  | 4-3/16  | 5-1/8   |
| 4     | 5                    | 40.4                    | 0                       | 7-3/8   | 5-9/16  | 4-5/16  | 5-5/16  |
| 5     | 5                    | 40.4                    | 34.6                    | 7-1/8   | 5-3/8   | 4-3/16  | 5-1/8   |

**Class 90 Deflection Measurements**

| Phase | Time Duration (min.) | Negative Pressure (psf) | Positive Pressure (psf) | #1 (in) | #2 (in) | #3 (in) | #4 (in) |
|-------|----------------------|-------------------------|-------------------------|---------|---------|---------|---------|
| 1     | 5                    | 48.5                    | 0                       | 7-1/8   | 5-1/2   | 4-3/16  | 5-3/16  |
| 2     | 5                    | 48.5                    | 41.5                    | 7       | 5-5/16  | 4       | 5       |
| 3     | 60                   | 24.2 – 48.5*            | 41.5                    | 7       | 5-5/16  | 4       | 5       |
| 4     | 5                    | 56.5                    | 0                       | 7       | 5-7/16  | 4-1/8   | 5-1/8   |
| 5     | 5                    | 56.5                    | 48.5                    | 6-15/16 | 5-1/4   | 3-7/8   | 4-7/8   |

\* Oscillation frequency as specified in UL 580.

Results: Upon completion of the above loading, there were no specimen failures.

Project No. T221-21

**TEST #1 (cont.)**

**UL 1897 UPLIFT TEST**

Test Date: 7/22/21

Test Specimen: Elite Rib Metal Panel 36" wide coverage x 29 ga

Fastener Spacing: 24" o.c. into pine purlins with 9/9/9/6 pattern

**Results:**

**Deflection Measurements**


| Total Uplift Pressure (psf) | Time Duration (min.) | #1 (in) | #2 (in) | #3 (in) | #4 (in) |
|-----------------------------|----------------------|---------|---------|---------|---------|
| 112                         | 1                    | 6-7/8   | 5-1/8   | 3-7/8   | 4-7/8   |
| 127                         | 1                    | 6-7/8   | 5-1/16  | 3-7/8   | 4-3/4   |
| 142                         | 1                    | 6-3/4   | 5       | 3-3/4   | 4-11/16 |
| 157                         | 1                    | 6-11/16 | 4-7/8   | 3-11/16 | 4-9/16  |
| 172                         | 1                    | 6-5/8   | 4-3/4   | 3-5/8   | 4-1/2   |
| 187                         | 1                    | 6-9/16  | 4-11/16 | 3-9/16  | 4-7/16  |
| 202                         | 1                    | 6-1/2   | 4-5/8   | 3-1/2   | 4-3/8   |
| 217                         | 1                    | 6-7/16  | 4-7/16  | 3-7/16  | 4-1/4   |

**Results:**

Maximum Total Uplift Pressure (Held for 1 min.) = 225.1 psf

Max.Total Uplift Test Pressure at Failure = 231.4 psf (Panel pulled over panel fastener)

## TEST SET UP


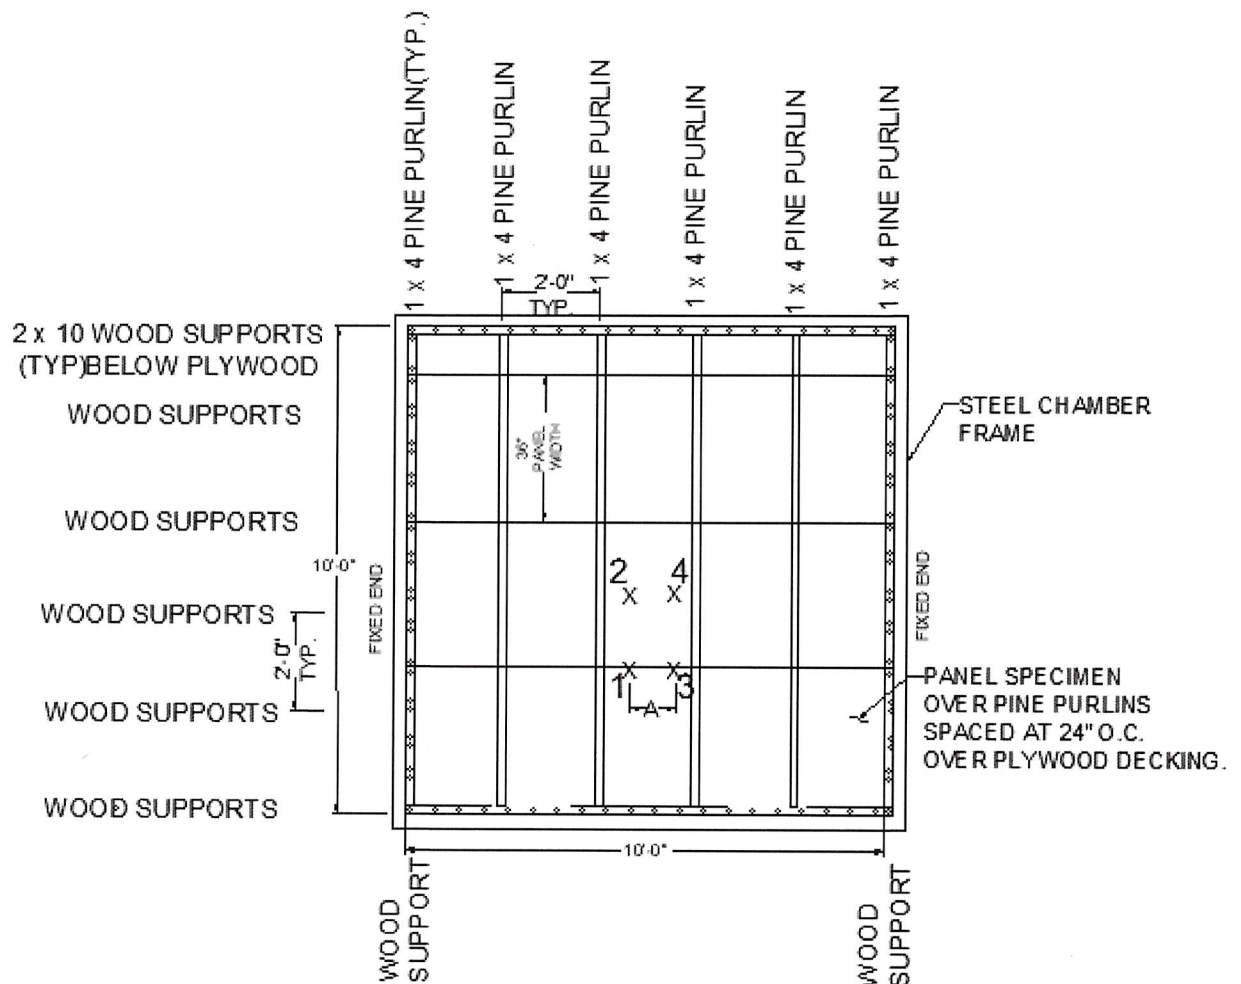


NOTE:- DEFLECTION POINT #1 AT FASTENER LOCATION  
 A = FASTENER LOCATION / 2  
 (FASTENERS AT PINE PURLIN LOCATION OF 24" O.C.)

X - DEFLECTION LOCATION

## PLAN VIEW OF PANELS

## ELITE RIB PANEL

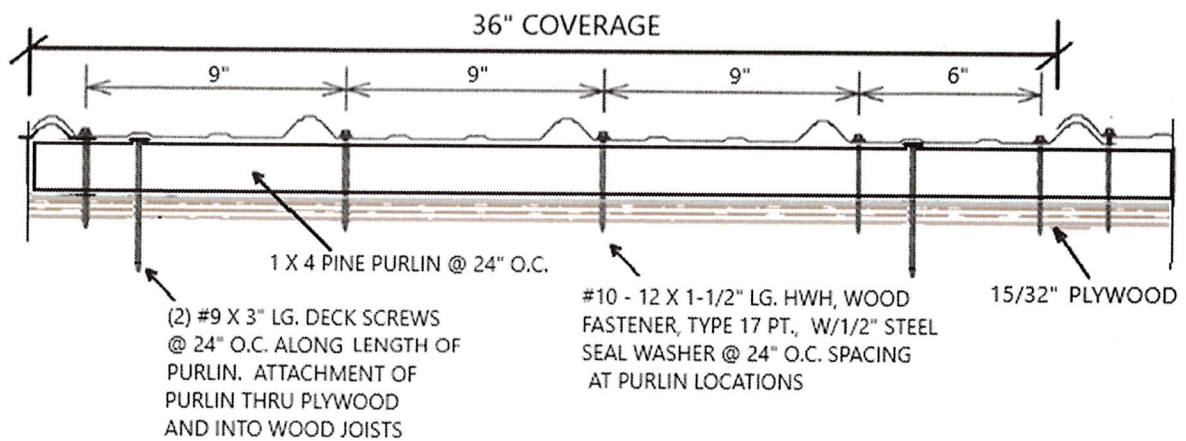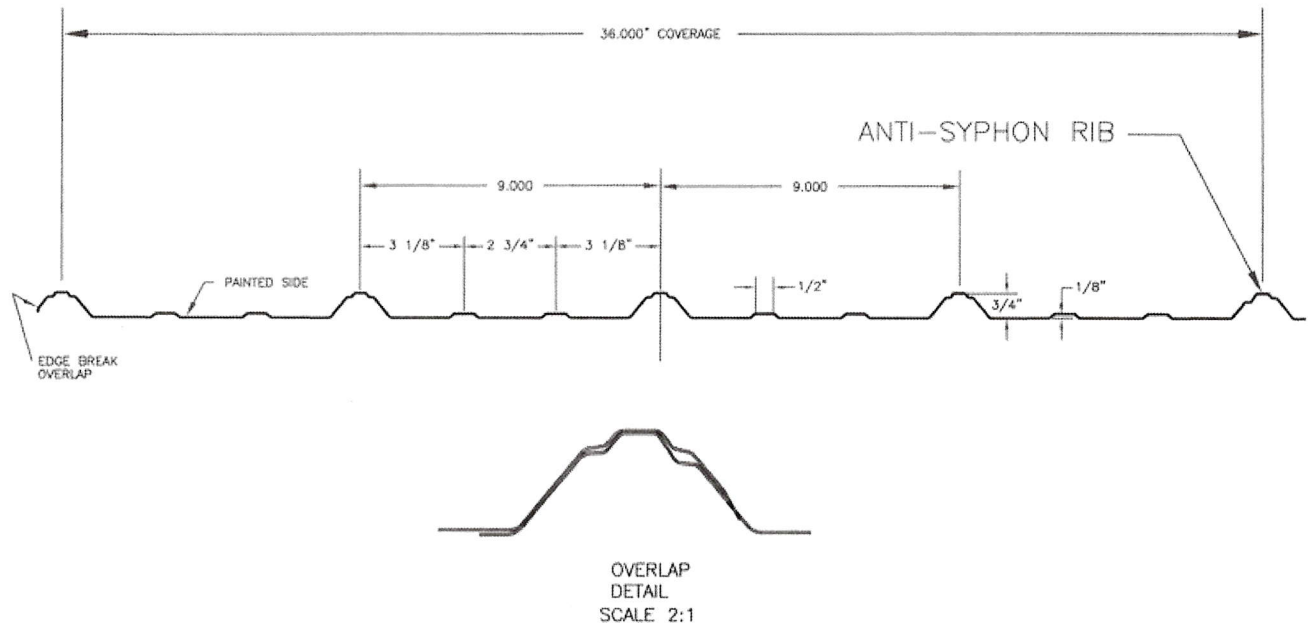

**FASTENER PATTERN 9/9/9/6 INTO PURLINS@ 24"**  
**O.C. ALONG LENGTH OF PANEL**

# *Spectrochemical Laboratories-Material Evaluation, Inc.*

155 Prominence Drive, New Kensington, PA. 15068

Phone: (724) 334-4140 Fax: (724) 334-4143

Date: 29-Jun-21

Page No.: 1 of 1

## **Report of Tensile Testing**

Client: Farabaugh Engineering & Testing (Ref PO #: Verbal - P. Farabaugh)

| PIN #           | Dimensions (in.) |             | Area<br>(sq.- in.) | Yield       |  | Tensile<br>Strength (lb.) | Yield           |  | Tensile<br>Strength (psi.) | Elongation   |  | Fracture        |
|-----------------|------------------|-------------|--------------------|-------------|--|---------------------------|-----------------|--|----------------------------|--------------|--|-----------------|
|                 | Width            | x Thickness |                    | Point (lb.) |  |                           | Strength (psi.) |  |                            | (% in 2 in.) |  |                 |
| ELITE RIB PANEL | 0.5009           | x 0.0124    | 0.0062             | 672         |  | 707                       | 108100          |  | 113800                     | 0.5          |  | U/4 (Out of GL) |

Test Method: Q2300.04 rev.14 (ASTM A370-20, E8-21, or E646-16 : Yld. by 0.2% offset, Elong. after fracture)

Equipment Used: Instron 5900R60HVL (s/n: 1602) w/ Extensometer (s/n: E93054)

Performed By: T. Ault

This test report shall not be reproduced except in full, without the written approval of the laboratory

The recording of false, fictitious, or fraudulent statements or entries on this report may be punished as a felony under federal law.

Please send your comments and concerns to us at [feedback@spectrochemicalinc.com](mailto:feedback@spectrochemicalinc.com)

For more information call: 724-334-4140

Respectfully submitted,



Todd A. Ault

Laboratory Manager