


5 x 4 - 5 x 4½ - 5 x 5
TEMPLATE FULL MORTISE MAGNETIC MONITORING HINGES



DO NOT SCALE

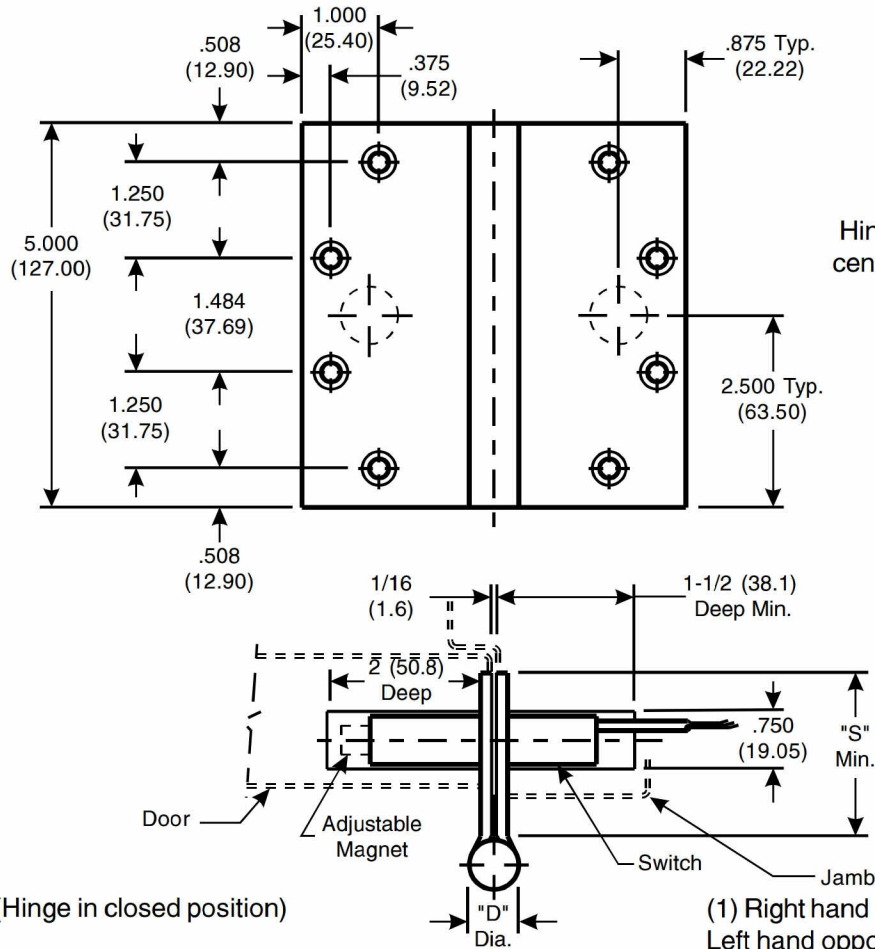

Bottom view (Hinge in closed position)

(1) Right hand application shown
Left hand opposite (2 Knuckle only)

CATALOG NUMBER		GAUGE OF METAL	"D" OUTSIDE DIAMETER	"S" DISTANCE (SWAGE LINE)		
STEEL HINGES	*NON-FERROUS HINGES			HINGE WIDTH		
				4 (101.6)	4½ (114.3)	5 (127.0)
TA 714xMM	TA 314xMM	.146 (3.71)	.648 (16.46)	**	1-7/8 (47.6)	2-1/8 (53.9)
TA 786xMM	TA 386xMM	.190 (4.83)	.752 (19.10)	**	1-53/64 (46.4)	2-5/64 (52.8)
TA/TB 2714xMM	TA/TB 2314xMM	.146 (3.71)	.648 (16.46)	**	1-7/8 (47.6)	2-1/8 (53.9)
TA/TB 3713xMM	TA/TB 3313xMM	.146 (3.71)	.648 (16.46)	**	1-7/8 (47.6)	2-1/8 (53.9)
(1) TA 2731xMM	(1) TA 3331xMM	.146 (3.71)	.525 (13.33)	1-21/32 (42.1)	1-29/32 (48.4)	2-5/32 (54.8)
(1) TA 3750xMM	(1) TA 3350xMM	.190 (4.83)	.701 (17.80)	**	1-13/16 (46.0)	2-1/16 (52.4)
T4A/T4B 3786xMM	T4A/T4B 3386xMM	.190 (4.83)	.752 (19.10)	**	1-53/64 (46.4)	2-5/64 (52.8)

McKINNEY Template Hinges of the above Catalog Numbers are made to conform to ANSI/BHMA 156.7 for Screw hole Location and Gauge of Metal. Switch size and location conforms to this drawing.

Machine Screw Size - 1/2 x 12-24 F.H.

Wood Screw Size - 1-1/4 x 12 F. H.

(1) Hinges are handed.

*Check Catalog for Metals.

**Dimensions will be supplied upon request.

McKINNEY Products Company

Manufacturer reserves the right to make changes without formal notice.