



Farabaugh Engineering and Testing Inc.

Project No. T330-24

Report Date: December 30, 2024

No. Pages: 8 (inclusive)

UL 580 / UL1897 UPLIFT RESISTANCE TESTING

ON

**ELITE RIB ROOF PANEL
3'-0" COVERAGE X 26 GA. STEEL
(FASTENERS INTO PINE PURLINS @ 24" O.C.
WITH FASTENER PATTERN OF 6/3/6/3/6/3/6/3)**

FOR


ELITE METAL MANUFACTURING, LLC.
10121 88TH TRACE
LIVE OAK, FL. 32064

Prepared by:

Paul G. Farabaugh

Approved by:

Daniel G. Farabaugh

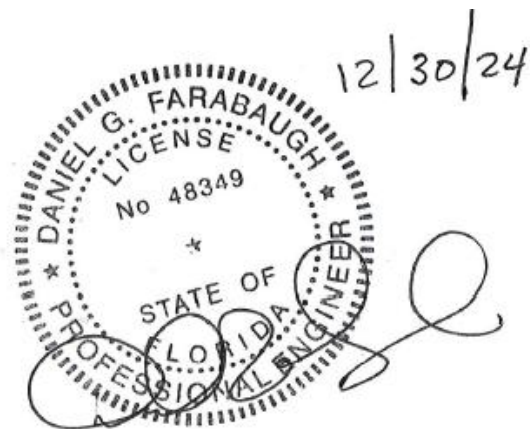

DANIEL G. FARABAUGH, P.E.
255 Saunders Station Rd
Trafford, PA 15085
412-417-5153



Purpose

This test method covers the evaluation of uplift resistance of roof assemblies per UL 580-06(Rev. 2018) and UL 1897-15 and as provided herein.

Test Dates:

12/5/24 - Test #1 – Panel fasteners into pine purlins @ 24” o.c. location with fastener pattern of 6/3/6/3/6/3/6/3 across panel width.

Test Specimen

Manufacturer: Elite Metal Manufacturing LLC.
10121 88th Trace
Live Oak, FL. 32064

Test Specimen: Elite Rib Metal Panel 36” wide coverage x 26 ga.

Substrate: 15/32” APA plywood (1/2” nominal)
Span Rating: 32/16
Grade of Plywood: C-D
Number of Plies: 4 ply

Purlins: 1 x 4 battens (pine) at 24” o.c.

Testing Apparatus

Test Chamber: The test chamber consists of three sections: a top section to create a uniform vacuum, a center section in which the roof assembly is constructed, and a bottom section to create a uniform positive pressure.

Pressure Chamber: The air pressure in the pressure chamber was measured at five points. Each of four points were located 42” from chamber corners at a 45 degrees angle, with the fifth tube located 18” from the center of the air inlet opening. The end of each tube was 7” above the chamber floor. The tubes were connected to a manifold that, in turn was connected to a manometer.

Vacuum Chamber Measurement: The air pressure in the vacuum chamber was measured at five points. Each of four points was located 18” from chamber corners at a 45 degrees angle and 8” above the chamber floor. The fifth tube located 12” from the center of the exhaust opening and 6” below the opening. The tubes were connected to a manifold that, in turn was connected to a manometer. The pressure in the vacuum chamber was controlled by an automatic damper. The damper door was moved by means of an air motor hooked to an air line and controlled by pressure switches located in the control console. An additional pressure line from the manifold to pressure switches controlled the automatic damper.

Installation

- The 15/32" plywood was attached to the wood joist (2x10) supports (spaced at 2'-0" o.c.) using 8d ring shank nails at 6" on center around the perimeter and at interior supports.
- 1 x 4 pine purlin spaced at 24" o.c. was attached with (2) #9 x 3" deck screws at 24" o.c. along the length of the purlin thru the plywood and into the wood joists.
- The metal roof panels were attached to the pine purlin substrate using #10-14 X 1-1/2" long, hex head, Hi-Lo, wood screw, type 17 point, w/1/2" steel sealing washer. The screws were attached with a specified spacing pattern across the width of the panel with a fastening spacing of 24" o.c. along the length of the panel. The panel sidejoint was lap joint. The outer perimeter of the assembly was secured with perimeter fastening as required to maintain a periphery seal. See fastening pattern for location of fasteners across width of panel.
- A plastic barrier was located between the panels and the underlying substrate.

Test Procedure

- The test assembly was subjected to positive and negative pressures to form an uplift pressure at the values and time duration as shown in the attached table.
- Each pressure increment was held for at least 1 minute.
- Vertical movement of the assembly during the tests was recorded.
- Subsequent to the completion of Phase 5 of the Class 90 test sequence, the test specimen was subjected to higher static uplift pressures per UL 1897 as shown on the attached table. The positive uplift pressure supplied from below was maintained at 48.5 psf while the negative uplift pressure supplied from above was increased in increments until failure or the desired uplift pressure was obtained.

TEST #1
UL 580 UPLIFT TEST

Test Date: 12/5/24

Test Specimen: Elite Rib Metal Panel 36" wide coverage x 26 ga

Fastener Spacing: 24" o.c. into pine purlins with 6/3/6/3/6/3/6/3 pattern

Class 30 Deflection Measurements

Phase	Time Duration (min.)	Negative Pressure (psf)	Positive Pressure (psf)	#1 (in)	#2 (in)	#3 (in)	#4 (in)
Initial	0	0	0	4-5/16	5-5/16	5-9/16	4-1/8
1	5	16.2	0	4-5/16	5-1/4	5-7/16	4-1/16
2	5	16.2	13.8	4-1/4	5-3/16	5-3/8	4-0
3	60	8.1 – 27.7*	13.8	4-3/16	5-1/8	5-5/16	4-0
4	5	24.2	0	4-1/4	5-1/4	5-7/16	4-0
5	5	24.2	20.8	4-3/16	5-1/8	5-5/16	4-0

Class 60 Deflection Measurements

Phase	Time Duration (min.)	Negative Pressure (psf)	Positive Pressure (psf)	#1 (in)	#2 (in)	#3 (in)	#4 (in)
1	5	32.3	0	4-1/4	5-3/16	5-3/8	4-0
2	5	32.3	27.7	4-3/16	5-1/16	5-1/4	3-15/16
3	60	16.2 – 55.4*	27.7	4-1/16	4-15/16	5-1/8	3-13/16
4	5	40.4	0	4-1/8	5-0	5-1/4	3-7/8
5	5	40.4	34.6	4-1/16	4-15/16	5-1/8	3-13/16

Class 90 Deflection Measurements

Phase	Time Duration (min.)	Negative Pressure (psf)	Positive Pressure (psf)	#1 (in)	#2 (in)	#3 (in)	#4 (in)
1	5	48.5	0	4-1/8	5-0	5-3/16	3-7/8
2	5	48.5	41.5	4-0	4-7/8	5-0	3-13/16
3	60	24.2 – 48.5*	41.5	4-0	4-7/8	5-0	3-13/16
4	5	56.5	0	4-1/8	5-1/16	5-1/4	3-15/16
5	5	56.5	48.5	4-0	4-13/16	5-0	3-3/4

* Oscillation frequency as specified in UL 580.

Results: Upon completion of the above loading, there were no specimen failures.

TEST #1 (cont.)

UL 1897 UPLIFT TEST

Test Date: 12/5/24

Test Specimen: Elite Rib Metal Panel 36" wide coverage x 26 ga

Fastener Spacing: 24" o.c. into pine purlins with 6/3/6/3/6/3/6/3 pattern

Results:

Deflection Measurements


Total Uplift Pressure (psf)	Time Duration (min.)	#1 (in)	#2 (in)	#3 (in)	#4 (in)
112	1	3-15/16	4-13/16	4-15/16	3-11/16
127	1	3-7/8	4-3/4	4-7/8	3-11/16
142	1	3-13/16	4-5/8	4-13/16	3-1/2
157	1	3-13/16	4-5/8	4-11/16	3-1/2
172	1	3-11/16	4-1/2	4-5/8	3-3/8
187	1	3-5/8	4-7/16	4-9/16	3-3/8
202	1	3-9/16	4-3/8	4-1/2	3-1/4
217	1	3-1/2	4-5/16	4-7/16	3-1/4
232	1	3-1/2	4-1/4	4-3/8	3-3/16
247	1	3-7/16	4-3/16	4-5/16	3-1/8
262	1	3-3/8	4-1/8	4-1/4	3-1/16
277	1	3-5/16	4-1/16	4-3/16	3-1/16
292	1	3-1/4	4-0	4-1/8	3-0
307	1	3-1/4	3-15/16	4-0	2-15/16
322	1	3-3/16	3-13/16	3-15/16	2-7/8
337	1	3-1/8	3-7/8	3-7/8	2-5/16

Results:

Maximum Total Uplift Pressure (Held for 1 min.) = 339.8 psf

Max.Total Uplift Test Pressure at Failure= 345.0psf (Panel buckled in middle of end span.)

TEST SET UP

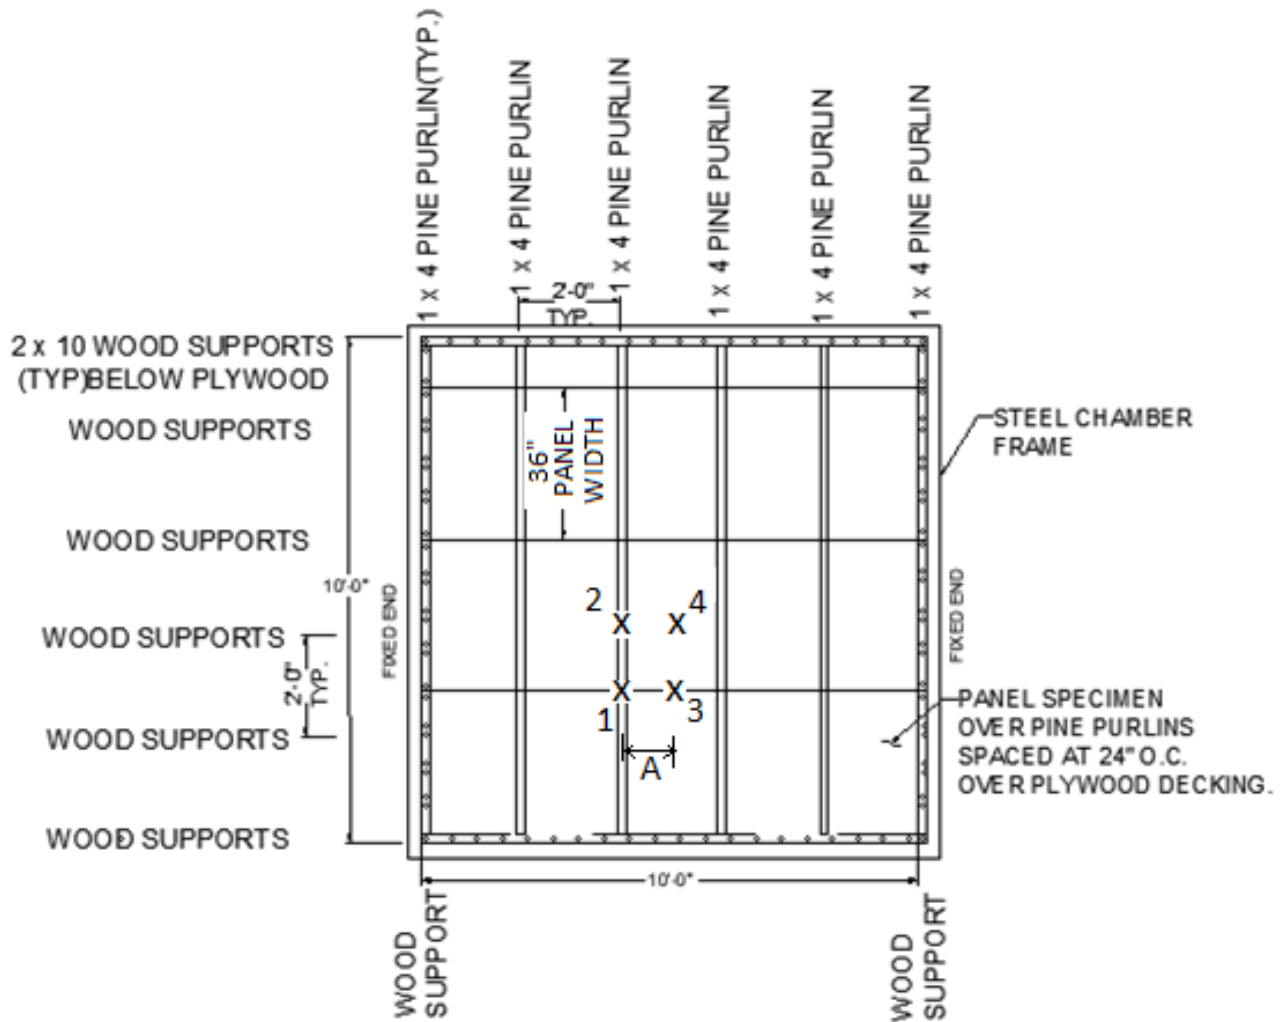



NOTE:- DEFLECTION POINT #1 AT FASTENER LOCATION
 A = FASTENER LOCATION / 2
 (FASTENERS AT PINE PURLIN LOCATION OF 24" O.C.)

X - DEFLECTION LOCATION

PLAN VIEW OF PANELS

ELITE RIB PANEL

STRIP WIDTH = 40.875

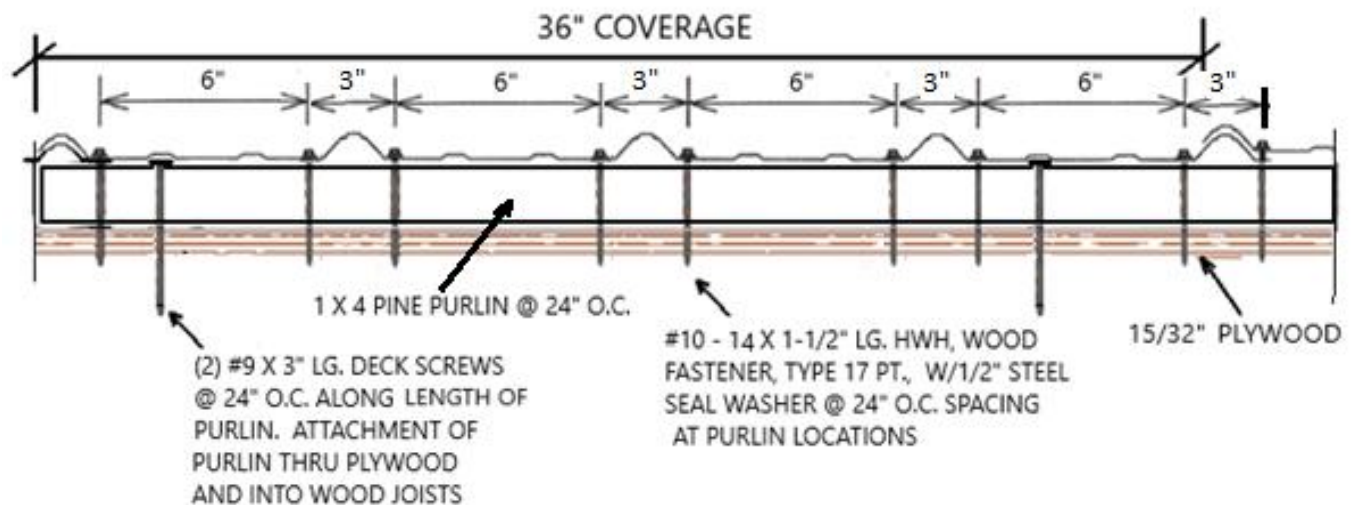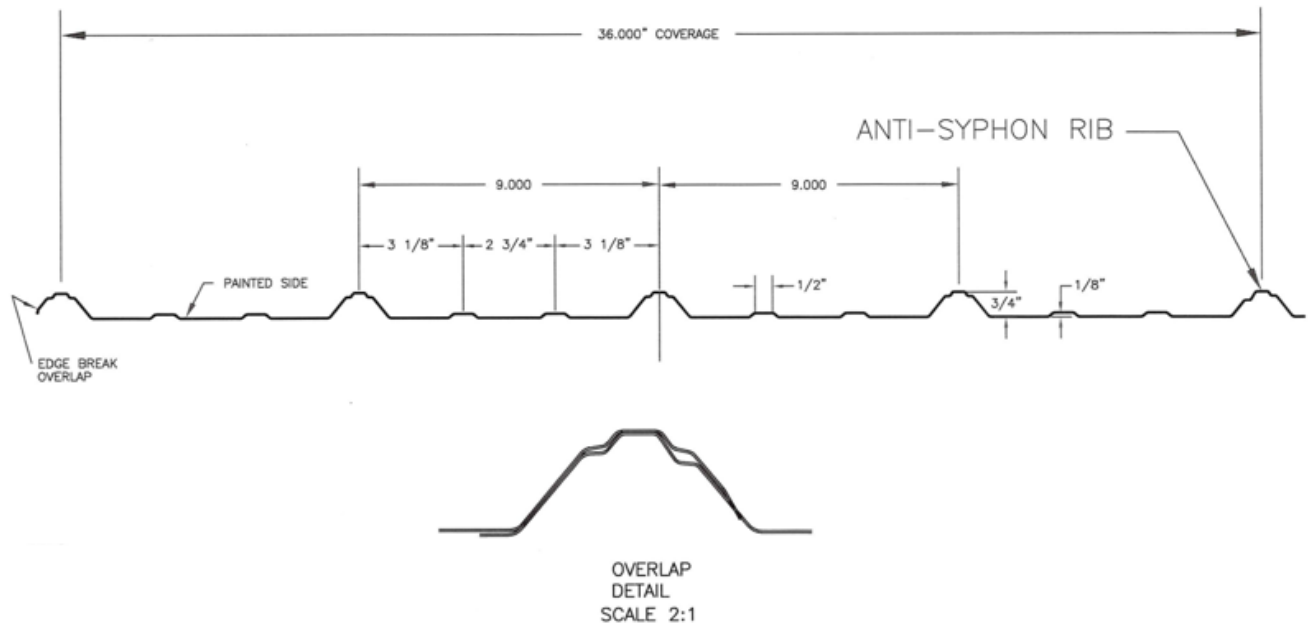

FASTENER PATTERN 6/3/6/3/6/3/6/3 INTO PURLINS@
24" O.C. ALONG LENGTH OF PANEL

TENSILE TEST REPORT

Manufacturer: Elite Metal Manufacturing LLC.
10121 88th Trace
Live Oak, FL. 32064

Test Specimen: Elite Rib Metal Panel 36" wide coverage x 26 ga.

Test Date: November 7, 2024

Test Method: ASTM A370-10

Sample No.	Width (in)	Thickness (in)	Yield Load (lb)	Max. Load (lb)	0.2% Offset Yield Strength (psi)	Tensile Strength (psi)	Elongation (% in 2 inches)
24122	0.506	0.017	473.49	516.03	55,044	59,990	22.5

Equipment Used: Tensile Machine #QT7-061196-020
Caliper #1074379
Extensometer #10311744D
Micrometer #110596927

Revision Log

<u>Rev. #</u>	<u>Date</u>	<u>Page(s)</u>	<u>Revision(s)</u>
0	12/30/24	NA	Original report issue

This report is confidential and exclusively intended for FET's Client as per the agreement between FET and its Client. FET is responsible only within the terms and conditions of the agreement and assumes no liability to any other party for any loss, expense or damage arising from the use of this report. The report may be copied or distributed only with the Client's authorization and in its entirety, and the observations and test results are relevant only to the specific sample tested.